## Walters No. 1

24 June 2013	Ran 5 ½ casing set at 3699'. Cemented with 170 sacks cement including rat hole and mouse hole. Finish 8:30pm
28 June 2013	Cement port collar 1380 to surface KCC representative Pat Staab approved job. Cement circ good. Ran bond log and found no cement from 3630 down.
2 July 2013	Drill wiper plug and float insert no cement on plug or bottom joint casing. Ran bond log to confirm no bond 3700 up to 3631 Perf 3632-3635-6 hole to re-cement set cement retainer at 3680' ran tubing back in hole ready to cement squeeze.
3 July 2013	Cementing cement retainer at 3680' Perforations 3632-35 cement circulated good. Pressure up to 500lbs 2 hrs. Pull tubing run drill collars and bit in hole to 3000' ready to drill cement.
4 July 2013	No Work
5 July 2013	Cement 3500' drilled cement 3500 to 3675 circ clean Pull tubing and drill collars swab hole down to 2800'
6 July 2013	Ran bonglog and perf 3642-3644 shut down-Saturday
8 July 2013	Fluid level same as when we perforated swab Dry Perf 3642-44 swab dry. No fluid coming in
9 July 2013	Se packer at 3637' acidize 250 gal communicated had Log truck verify packer depth. Swab dry.
10 July 2013	Fluid level 3600 set packer 3637 treat acidize 250 gal
11 July 2013	communicated to perf 3632-35 swab dry. We though we may have had packer leak on pervious acid job apparently not. Dumped 80 barrels salt water Fluid level 3450. Set cement retainer at 3628'. Run tubing in hole
	stung into cement retainer. Cemented 60 sacks into formation. Pulled tubing run drill collars and bit prepared to drill cement retainer.
12 July 2013	Drilling on cement retainer
15 July 2013	Finish drilling retainer and cement
16 July 2013	Perforate 3639-44 run tubing and packer. Set packer at 3637. Acidize 250 gallons. Zone treated good went on vacuum after
17 July 2013	acid job. Swab dry.  No fluid in hole. Pull tubing. Set cement retainer at 3630 cement squeeze only 18 sacks into formation. Pressure to 2000lb wash hole clean and pull tubing
18 July 2013	Swab hole to 2850' perforate 3625-28 12 holes swab dry no fluid coming in. Run tubing and packer spot acid set packer at 3620. Acidize 250 gal acid. Went on vacuum 15 min later run swab fluid level 3450. Swab test no fluid coming in. Pulled tubing and set cement retainer at 3621. Run tubing in hole with stinger for cement retainer ready to cement
19 July 2013	Waiting on cement trucks arrived at 2:30 pm Pumped 75sacks into formation 3625-28. Pulled tubing