D.S. & W. Well Servicing, Inc.

1822 24th Street Great Bend, KS 67530

Invoice

Date	Invoice #
11/21/2013	70630

Bill To

Carmen Schmitt, Inc.
Carmen Schmitt
P.O. Box 47
Great Bend, KS 67530-0047

Lease Name	Terms	Due Date
Splitter "B" #2-Plug well	30 Days	12/21/2013

Item	Description	Qty	Rate	Amount
Rig #23	Hess #1058-120 Double Drum Pole - #23	71	210.00	14,910.00T
Backhoe	John Deere Backhoe - with operator	14	80.00	1,120.00
Winch Truck	Winch Truck - with operator	2	90.00	180.00T
Winch Truck & Fl	Winch Truck with Float Trailer and operator	6	110.00	660.00T
MPPS	Mud Pump & Power Swivel	18-	175.00	3,150.00T
Swab Tank Rental	Swab Tank Rental	1	225.00	225.00T
Workover Head	Workover Head	1	125.00	125.00T
Stripper Rubber	5-1/2"x2-7/8" Stripper Rubber	1	146.33	146.33T
Thread Dope	Thread Dope	6	17.50	105.00T
Solvent	Cleaning Solvent	6-	7.48	44.88T
^	SWAB TANK STILL ON LOCATION			
	12800,0002			
	750755		1	
	750/55 "Rig For p1-99	ارسی ک		

Thank You

Walls File

Subtotal \$20,666.21

620-793-5838 Office 620-793-5860 Fax



Sales Tax (7.15%) \$1,397.55

Total \$22,063.76

Balance Due

\$22,063.76

D.S.&W. WELL SERVICING, INC.

1822 24th Street Great Bend, KS 67530

	Date:	11/21/13		1	Lease:	Splitter "E	3 ¹¹	
Com	pany:	Carmen Schmitt, Inc.			Well:	#2		
		PO Box 47, Great Bend, KS 6753	0	- Inv		70630		
			WELL PULLING REPORT	-				
		PULLED	1			R	UN	
JTS.	FT.	DESCRIPTION	EQUIPMENT	JTS.	FT.		DESCRI	PTION
			MUD ANCHOR					<u> </u>
			SEATING NIPPLE					<u>-</u>
		<u> </u>	WORKING BARREL					<u> '</u>
			HOLD DOWN					
97	·	2-3/8"	TÜBING	 				<u> </u>
<u> </u>	•		TUBING SUBS	1				(i,i) $\hat{\mathbf{v}}_{ij}$ (i,j)
			STRAINER GAS ANCHOR TRAVELING VALVE	 				
			PUMP					
			RODS	+				
		r. ————————————————————————————————————	ROD SUBS	1				7 (1)
			ROD SUBS	1				
			POLISH ROD					
			LINER					
Hess #	1058-	120 Double Drum Pole - Rig #23, op	perator & crew of 2 men	71.0	hrs @	\$210.00	\$	14,910.00
Materia	als & E	quipment Used: Backhoe - 14 hrs	. @ \$80.00				\$	1,120.00
		Winch trk 2 hrs	. @ \$90				\$	180.00
		Winch trk.w/float	- 6 hrs. @ \$110.00				\$	660.00
		Mud Pump & Pov	wer Swivel (MPPS) - 18 hrs. (@ \$175	.00		\$	3,150.00
		Swab Tank Rent	al			<u>.</u>	\$	225.00
		Workover Head					\$	125.00
		5-1/2"x2-7/8" Stri	pper Rubber				\$	146:33
e	: . 	Thread dope - 6	trips @ \$17.50				\$	105:00
<u>.</u>		Solvent - 6 gallor	ns @ \$7.48				\$	44.88
		Sub-Total					\$	20,666.21
		Sales Tax - Ellsw	orth County 7.15%				\$	1,397.55
		Total Due					\$	22,063.76
						.		
<u>11/21/</u>	13 - 5 E	Backhoe hrs Drove to location and	d dug workover pit. Moved tu	ibing. S	moothe	ed lease ro	oad.	
<u>11/21/</u> :	13 - 6 I	Rig hrs Move in and rig up. Discu	iss daily safety issues. Rig o	ver to ru	ın tubin	g. Wait or	and run	in w/
oversh	ot and	tubing - tally in. Got on fish. Tried	to release lock-set packer. (Could no	ot get re	leased. E	ventually	v brok <u>e</u>
grappl	e in too	ol - would not get on fish. Trip out w	//tubing and overshot. Shut d	lown.				
11/22/	13 - 6 F	Rig hrs Drive to location. Discuss	daily safety issues. Run in v	v/oversl				
Data V	Mari-	Data Mind	,		D	.S.& W. WI	ELL SERV	ICING, INC.
Date V		Date Work Completed			Rv	Danny	Schula	,

D.S.&W. WELL SERVICING, INC.

1822 24th Street **Great Bend, KS 67530**

Date: 11/21/13	Lease: Splitter "B"	
Company: Carmen Schmitt, Inc.	Well: #2	
Address: PO Box 47, Great Bend, KS 67530	Invoice #: 70630	
CONTINUATION SHEET	#1	
to run rods. Run in w/53 - 3/4" rods. Got past fish. Pull rods back out. Rig	over to pull tubing. Tried to release packer	
again. Would not release. Shut down.		
11/25/13 - 1 Backhoe hr Load tubing in yard.		
11/25/13 - 6 Winch trk.w/trailer hrs Loaded 112 jts.of 2-7/8" tubing from ya	ard. Hauled to location and unloaded. Returned	<u>t</u>
to Hoisington.		
11/25/13 - 4.5 Backhoe hrs Drove to location and moved tubing out of the	e way.	
11/25/13 - 12 Rig hrs Drive to location. Discuss daily safety issues. Wait	it on and rig up loggers. Run back off	
shot down tubing - only got down to 2390'. Back off 2-3/8" tubing @ 2386'.	Pull out w/tubing. Change out strings of tubing	
Run in w/overshot and 2-7/8" tubing. Got on fish. Run back off shot down to	backside. Tried to back off. Backed off above	
fish tool. Screw back into tubing and tighten tubing. Run another shot down	n backside. Got tubing backed off. Pull 1 jt.	
Shut down.		
11/26/13 - 2 Winch trk.hrs Hauled swab tank to location. Unloaded and d	drove back to the shop.	
11/26/13 - 8 Rig hrs. & 2 MPPS hrs Drive to location. Discuss daily safety	y issues. Trip out w/tubing, overshot and 19	
more jts.of 2-3/8" tubing. Wait on mill shoe and washpipe. Run in w/mill sh	noe, 4 jts.of washpipe and 10 jts.of tubing. Shut	
down. Loaded MPPS and hauled to location. Unloaded and returned to Ho	pisington yard.	
11/27/13 - 11 Rig hrs. & 6 MPPS hrs Drive to location. Discuss daily safe	ety issues. Finish running tubing - tag fill-up @	
2945'. Hook up MPPS. Break circulation. Wash over tubing down to packet	er @ 3021'. Clean out scale & formation. Mill	•
on packer - making 4"-5". Lay down PS. Trip out w/ tubing, wash pipe and	mill. Check mill. Stick back in hole. Shut	
dówn.		
12/02/13 - 11 Rig hrs. & 5 MPPS hrs Drive to location. Discuss daily safe	ety issues. Run washpipe and tubing back in	
hole. Tag fill-up @ 2950'. Hook up MPPS. Wash back down to packer - ge	etting black shale. Mill on packer - made 8"-9".	
Stopped making hole - mill just spinning - no torque. Lay down PS. Trip ou	ut w/tubing, washpipe and mill. Change mill	
shoe. Run shoe, washpipe and 15 jts.of tubing back in. Shut down.		
12/03/13 - 12 Rig hrs. & 5 MPPS hrs Drive to location. Discuss daily safe	ety issues. Finish running in w/tubing. Tag	
fill-up @ 2960'. Hook up MPPS. Wash back down to packer - getting black	k shale. Tried to mill on packer - just spinning.	
Circulate hole clean. Lay down PS. Trip out w/tubing, wash pipe and mill.	Wait on orders. Decided to plug the well.	
Wait on and rig up loggers. Perforate @ 1225', 925' and 250'. Tear down	loggers. Run in with tubing to 2960'. Wait	
on and hook up cementers. Spot 35 sacks of cement. Pull tubing out to 12	225'. Pump 35 sacks of cement w/3% CC.	
Pull tubing out. Wait 1 hour. Run tubing back in. Tag cement @ 1220'. Pu	ull up to 925'. Pump 35 sacks w/3% CC and	_
50# hulls. Pull tubing. Shut down.		
12/03/13 - 3.5 Backhoe hrs Drove to location. Moved pumping unit out of	f the way. Dig up wellhead.	
12/04/13 - 5 Rig hrs Drive to location. Discuss daily safety issues. Run in	n w/tubing. Tag cement @ 885'. Pull out to	

D.S.&W. WELL SERVICING, INC.

1822 24th Street Great Bend, KS 67530

Date: 11/21/13	Lease: Splitter "B"
Company: Carmen Schmitt, Inc.	Well: #2
Address: PO Box 47, Great Bend, KS 67530	Invoice #:
CONTINUATION SHEET :	#1
250'. Hook up cement trucks. Pump 40 sacks of cement. Circulated good	cement up casing. Pull rest of tubing. Hook
up to surface pipe - pumped 15 sacks of cement. Pressure to 250#. Shut in	n. Top off casing w/5 sacks of cement. Tear
down. Drive rig to the yard.	
· · · · · · · · · · · · · · · · · · ·	
NOTE: SWAB TANK STILL ON LOCATION	
······································	
	
- 	
- · · · · · · · · · · · · · · · · · · ·	
· <u></u>	
· · · · · · · · · · · · · · · · · · ·	
<u> </u>	
	
2000	
	
	-
	-
	-

D.S. & W. Well Servicing, Inc.Telephone (620) 587-3361 - P.O. Box 231 - Claflin, KS 67525

DAILY Workover Report

Company	armen Schmi	} +		Date <u>//-2/,22,</u>	25-2013
Rig#	Lease <i>5p\</i> :	tter B		City	
Section	Township	Range	County_Ellswor	H State KS.	
Oty Speci	ial Tools / Supplies Used				HRS.
1 trip il	ope V	Date: 11-21-13	Operator: Danny 5,		61
	olvent V		Floor Hand: Victor 5		61
	Indicator NK		Floor Hand: 55mon H		61
	ng head v	· · · · · · · · · · · · · · · · · · ·	Floor Hand:	-	
	,	vor to run tu	bing Walton Fran in	n W/ nuevsha	+ 3 tuhina-
tally in G	of on fish Tries	1 to release 1	ock-sel packer · could	d not get rel	eased
Eventually	broke grapple	In tool - would	d not get on fish	. Trio out w	1 Lubing
& overshot	Shut down.				, , , , , , , , , , , , , , , , , , ,
Qty Spec	ial Tools / Supplies Used				HRS.
		Date: 11-22-13	Operator: Banny 5		6 V
			Floor Hand: Victor 5,		61
			Floor Hand: 5/mon H.		_ 6V
			Floor Hand:	••	
Kun Inw/	53-74 nods-got	nest po-Lish, F	tubing. Got on Sist Pull rods back out. not release, Shut	Rig over to p	all to blug.
Oty Spec	ial Tools / Supplies Used				HRS.
1 1 1	lone 1	Date: 11-25-13	Operator: Danny 5,		12 1
1119	to par	11 = 2 /_	Floor Hand: Victor 5.	-	17 2
			Floor Hand: Simon H.		12./
			111		124
Work Performed: Di	TL, DDST. Walt or to 2390. Backot	I rig up logg	ers Run backoff show Q 2380, Pull out w	t down tuling	- only
5/rings of	tubing, Run	n w/overshot	& 2 18 tubing Got a	n fish Run d	ackadd
Into tubin Pull list.	p backside Tried of tighten tubing Shut down.	to backoff, E. Run another	Backed off above Sister Control of down backside.	Sh took Server	tod off

DAILY WORKOVER REPORT

D.S. & W. Well Servicing, Inc.Telephone (620) 587-3361 - P.O. Box 231 - Claflin, KS 67525

Lease Splitter B Well# 2 City Special Tools / Supplies Used Date: 11-26-13 Operator: Danny 5 8 Floor Hand: Victor 5 8 Floor Hand: Victor 5 8 Floor Hand: Siman H. 9 Floor Hand: Nictor Sima	Company <u>Cor</u>	men Schmift			Date <u>11-26,27,1</u> 2	2-2-2013
Determinent Determinent Signatur Victor S Special Tools / Supplies Used Determinent Dete		•	Her B		City	
Dobbie: 11-26-13 Operator: Danny 5 8 Foor Hand: Victor 5 8 Foor Hand: Siman H. 8 It frist Jape. Run in will mill share, 48th wash gipe I light of whing. Walt on mill share, 48th wash gipe I light of whing. Share Jowin. It frist Jape. V Date: 11-27-13 Dependent Wictor 5 1/1 John Solvent Sweet Jowel Jowel Foor Hand: Simon H. 1/1 Mrs PS It Performed: DTL, DDST, Finish Funning Libby teg Sill @ 2945. Hook up MITPS Break. Accordation, Wash over tuling down to packer @ 3021. clean and scale I formation. Mill on packer—making 4.5. Lay down PS. Trip out w/ tubing, wash pipe I mill, leach paill. Stick back in hale. Shut down Thereformed: DTL, DDST. Run wash pipe I tubing back in hole, Tag fill @ 2950. Hook up MITPS Broomed: It frip dapp. Thereformed: DTL, DDST. Run wash pipe I tubing back in hole, Tag fill @ 2950. Hook up MITPS Broomed: It from Hand: Simon H. II foor Hand: Simon H.	ection	•		County_Ellswork	4 State Ks.	
Floor Hand: Victor 5. 8 Floor Hand: Siman H. 8 If this dope I Date: 11-27-13 Decretor: Danny S. 11 Sirx 278 stripping rubber I Floor Hand: Victor S. 11 Mrs PS Floor Hand: Simon H. 11 Mrs PS In Performed: DTL, DDST, Finish runaling Juling - Leg July Hook up Mrt PS. Break Mill on packer - making 4-5. Lay down PS. Trip out w/ Juling, wash pipe i mill, theck mill Stick back in hale, Shurt down April Special Tools / Supplies Used Date: 12-2-13 Decretor: Danny S. 1. Mrs PS Floor Hand: Victor S. 11 Floor Hand: Victor S. 12 Floor Hand: Victor	Qty Special	Tools / Supplies Used				HRS.
Floor Hand: Victor 5, 8 Floor Hand: Siman H. 8 A page 8 10 ists of being, Short Jewn. I frig Jape 1 Date: 11-27-13 Operator: Danny S. 11 Shrx 278 stripping Fubber 1 Floor Hand: Victor S 11 Again Schrent Sungh Jank 1 Floor Hand: Victor S 11 April PS PS Floor Hand: Simon H. 11 In Performed DY2, DDST, Finish Funning Journ to packer @ 3021 - clean and scale & formatil will an packer - making 4.5. Lay down PS Trip out w/ Jubing, wash pipe & mill, check mill Stick back in hale, Shut down The part of Hand: Victor S 11 April Special Tools / Supplies Used 1 April PS Wash back Journ to packer - getting black shale, Mill on packer - made 1 A page of Stopped and King hale mill just spinning - no to 1909, Lay down PS Trip out w/ Jubing wash pipe & Trip out w/ Jubing washpipe & Jubing hock & Jun Shale, washpipe & Jubing book & In.			Date: 11-26-13	Operator: Danny 5.		8 ,
Thor Hand: Siman H. Floor Hand: Victor S. I frightly Stripping Fuelber Floor Hand: Victor S. I floor Hand: Siman H. III on packer — making 4-5. Ley down PS Trip out white hing, wash pipe I mill, check haill Stick back in hale, Shurd down Special Tools / Supplies Used His page Down Down: J2-2-13 Operator: Danny S. Floor Hand: Victor S Floor Ha		·		· · · · · · · · · · · · · · · · · · ·		81
Proor Hard: The Performed DTL, DDST, Trip out withbing, overshot & 19 more its. 21/8 holing, Walt on mill shoe, 4 the wash pipe & holing, Short Jown. The wash pipe. Runin will mill shoe, 4 the wash pipe & 10 the short, Short Jown. This Jope & Date: 11-27-13 Operator: Danny S. I strip Jope & Date: 11-27-13 Operator: Danny S. Jest 21/8 stripping rubber & Floor Hand: Victor S. Jest 21/8 stripping rubber & Floor Hand: Victor S. Jest 21/8 stripping rubber & Floor Hand: Victor S. Jest 21/8 stripping rubber & Floor Hand: Victor S. Jest 21/8 stripping rubber & Floor Hand: Victor S. Jest 21/8 stripping rubber & Floor Hand: Victor S. Jest 21/8 stripping rubber & Floor Hand: Victor S. Jest 21/8 stripping rubber & Floor Hand: Victor S. Jest 21/8 stripping wash pipe & mill, Strong place & Jest 21/8 stripping wash pipe & mill on packer - making 4/5." Lay down PS. Trip out with tubing, wash pipe & mill. Jeck mill Stick back in hale. Shurt down Departure Danny S. Jest 21/8 stripping rubber & Jest 1/8 short of the stripping stripping stripping and short on packer - made 1/8 stripping mill. Change mill shoe, Kun shoe, wash pipe & stripping back in the shoe		=				8 v
Special Tools / Supplies Used I trip slope / Date: 11-27-13 Operator: Danny S. II I STAX 278 stripping subber / Floor Hand: Victor S. II 2 gals Solvent / Suigh tank / Floor Hand: Simon H. III MPS PS / Floor Hand: Simon H. III MPS PS / Floor Hand: Simon H. III MPS PS / Floor Hand: Simon H. III IN Performed: DTL, DDST, Finish running hubing - teg SIII @ 2945. Hook up MITPS. Break It wash over tuting Jown to packer @ 3021 Clean and scale & Sermation III on packer - making 4.5. Lay down PS. Trip out w/ tubing, wash pipe I mill, Leck mill Stick back in hale. Shurt down Applies Simon H. III I trip dopa Date: 12-2-13 Operator: Danny S. II MPS PS / Floor Hand: Victor S. II MPS PS / Floor Hand: Victor S. III MPS PS / Floor Hand: Simon H. III Floor Hand: Shake Sown the packer - getting black in hole. Tag fill @ 2950. Hand up 18 PS. Wash back Sown the packer - getting black Shake, Mill on packer - made 3 - 9. Stepped making hale - mill just spinning - na to gue! Lay down PS. Trip out we whong, wash pipe it mill. Change mill shee, Kun Shak, wash pipe if 15 its tubing back in					-	
I frie dope / Date: 11-27-13 Operator: Danny S. 11 Str. X 2/8 stripping rubber / Floor Hand: Victor S. 11 2 gal. Solvent / Swap tank / Floor Hand: Simon H. 11 MP's PS / Floor Hand: Simon H. 11 IN Performed: DTL, DDST, Finish running tubing - tag \$I @ 2945. Hook up MI + PS. Break Dreval tion, Wash over tubing down to packer @ 3021 clean out scale & formation Mill on packer - making 4.5." Lay down PS. Trip out w/ tubing, wash pipe & mill, Theck mill, Stick back in hale, Shut down Date: 12-2-13 Operator: Danny S. 1. MP's PS / Floor Hand: Victor S. 1. MP's PS / Floor Hand: Victor S. 1. In Property J. DDST. Run wash pipe & tubing back in hole, Tag fill @ 2950. Haal up the packer - getting black shales Mill on packer - made 8-9". Stopped making hole - mill just spinning, - no to gut, Lay down PS. Trip out w/ Jubing, wash pipe & mill. Change mill shoe, Run Shale, wash pipe \$15,75 tubing back in.	Shoe & wash	pipe Runin W	mill show Yorks	wash pipe \$ 10 its of	bling, Shut Jown,	<u>' mill</u>
1 frig Jope / Date: 11-27-13 Operator: Danny S. 1 5/2x 2/8 stripping subber / Floor Hand: Victor S / 11 2 gall Schront / Surgh tank / Floor Hand: Victor S / 11 2 gall Schront / Surgh tank / Floor Hand: Simon H. Mfg PS / Floor Hand: The Performed: DTL, DDST, Finish running hubing - tag III @ 2945. Hook up Mt PS Break Strulation, Wash over tubing down to packer @ 3021 clean out scale & formation III an packer - making 4-5." Lay down PS Trip out w/ tubing, wash pipe & mill, Check mill Stick back in hale. Shut down Date: 12-2-13 Operator: Danny S. I frip dops / Date: 12-2-13 Operator: Danny S. III floor Hand: Victor S. Floor Hand: Simon H. Floor Hand: Simon H. Floor Hand: Simon H. III The Performed: DTL, DDST. Run wash pipe & tubing back in hole, Tag fill @ 2950. Hook up If PS. Wash back Jower to packer - gatting plack shale. Mill on packer - made 1 - 9". Stopped on King hole - mill just spinning no to 1944. Lay down PS. Trip out up Jubing, wash pipe & mill. Change mill shae, Run Shal, wash pipe & 15 tubing back in.						-
1 5/2 x 2/8 stripping rubber / Floor Hand: Victor 5 2 gali Solvent / Sugh tank / Floor Hand: Simon H, III MPS PS / Floor Hand: Simon H, III Floor Hand: Victor S, III MPS PS / Floor Hand: Victor S, III MPS PS / Floor Hand: Victor S, III MPS PS / Floor Hand: Simon H, III F	Oty Special	Tools / Supplies Used				HRS.
agali Solvent / Singh tank Floor Hand: Simon H. MP'S PS The Performed: DTL, DDST, Finish Funning Librag - tag III @ 2945. Hook up MITPS Break Discreptation, Wash over tubing down to packer @ 3021' - clean out scale & Sormathi Mill on packer - making 4'5." Lay down PS Trip out w/ tubing, wash pipe & mill, Theck mill Stick back in hale. Shut down Date: 12-2-13 Operator: Danny S. MP'S PS Floor Hand: Victor S. Floor Hand: Victor S. Floor Hand: Simon H. Floor Hand: Si	1 trie dop	oe/	Date: 11-27-13	Operator: Danny S.		
agali Solvent / Singh tank Floor Hand: Simon H. MP'S PS The Performed: DTL, DDST, Finish Funning Librag - tag III @ 2945. Hook up MITPS Break Discreptation, Wash over tubing down to packer @ 3021' - clean out scale & Sormathi Mill on packer - making 4'5." Lay down PS Trip out w/ tubing, wash pipe & mill, Theck mill Stick back in hale. Shut down Date: 12-2-13 Operator: Danny S. MP'S PS Floor Hand: Victor S. Floor Hand: Victor S. Floor Hand: Simon H. Floor Hand: Si	1 5/2x 27	1/8 stripping rub	ber 1	Floor Hand: Victor 5		
Mill on packer - making 4-5." Lay down PS. Trip out w/ hubing, wash pipe & mill, The performed: DTL, DDSI, Finish running hubing - tag III @ 2945. Hook up MITPS, Break Mill on packer - making 4-5." Lay down PS. Trip out w/ hubing, wash pipe & mill, Theck mill Stick back in hale, Shut down Date: 12-2-13 Operator: Danny S. MPS. PS. I trip dopy Date: 12-2-13 Operator: Danny S. I foor Hand: Victor S. I foor Hand: Simon H. Floor Hand: Simon H. III Floor Hand: DTL, DDSI. Run wash pipe & tubing back in hole, Tag fill @ 2950. Hook up 18 PS. Wash back Jown to packer - getting black shale, Mill on packer - made 18 - 9". Stopped making hele - mill sust spluning, - no to gue, Lay down PS. Trip out w/ Jubing, wash pipe & mill Change mill shae, Run Shae, wash pipe \$ 1.5;+5 tubing back in.	•	· · · · · · · · · · · · · · · · · · ·	,	Floor Hand: Simon H.		1/
The Performed: DTL, DDST, Finish Funning Lubing - tag \$1 @ 2945. Hook up Mt PS Break its cula tion, Wash over tuling down to packer @ 3021 clean out scale & formation on packer - making 4.5." Lay down PS. Trip out w/ tubing, wash pipe & mill, cleck mill. Stick back in hale. Shut down The property Danny S. I trip dopy Date: 12-2-13 Operator: Danny S. Floor Hand: Victor S. Floor Hand: Victor S. Floor Hand: Simon H. Floor Hand: Interformed: DTL, DDST. Run wash pipe & tubing back in hole, Tag fill @ 2950. Hook up the packer - getting black shale, Mill on packer - made of the packer in the packer of the	10 /	J				
Date: 12-2-13 Operator: Danny 5. MPSPS I Floor Hand: Victor 5. Floor Hand: Simon H. Floor Hand: The Performed: DTL, DDST. Run wash pipe & hubing back in hole, Tag fill @ 2950, Hook up 1978. Wash back I puon tu packer - getting black shale, Mill on packer - made 1999, Stopped making hole - mill just spinning, - no to 1948, Lay down PS, Trip out whething, wash pipe & mill. Change mill shoe, Run shoe, wash pipe & 15;+5 tuking back in.	Mill on pack	Ker-making 4-	5" Lay down	PS. Trip out w/ tub	ing wash pipe &	m://,
Floor Hand: Victor 5. Floor Hand: Victor 5. Floor Hand: Simon H. Floor Hand: Fl	Qty Special	Tools / Supplies Used				HRS.
Floor Hand: Simon H. Floor Hand: Floor Han	1 trip do	рі. 	Date: 12-2-13	Operator: Danny 5.		
Floor Hand: The Performed: DTL, DDST. Run wash pipe & tribing back in hole, Tag fill @ 2950, Hook up 1/2 PS. Wash back Jown to packer-getting black shale, Mill on packer-made 8"-9", Stopped making hole-mill just spinning, - no torque, Lay down PS, Trip out whether wash pipe \$ 15; to tuking back in.	MPSPS	·/		Floor Hand: Victor 5		
ork Performed: DTL, DDSI. Run wash pipe & tubing back in hole, Tag fill @ 2950, Hook up 1979. Wash back Jown to packer-getting black shales Mill on packer-made 18-9", Stopped making hole-mill just spinning, - no torque, Lay down PS, Trip out whether washpipe & mill. Change mill shoe, Run shoe, wash pipe & 15; to tubing back in.				Floor Hand: 51mon H		
1979. Wash back Jown to packer-getting black shales Mill on packer-made 8"-9". Stopped making hole-mill just spinning,-no torque, Lay down PS, Trip out whether washpipe & mill. Change mill shoe, Run shoe, washpipe & 15; to tubing back in.				Floor Hand:		
1979. Wash back down to packer-getting black shales Mill on packer-made 8"-9". Stopped making hole-mill just spinning, - no torque, Lay down PS, Trip out whether washpipe & mill. Change mill shoe, Run shoe, washpipe & 15; +5 tuking back in.	ork Performed: DTL	DOST. Run WA	sh pipe & tubina	back in hole Tag +	GII @ 2950, +	took us
bubing, washpipe & mill. Change mill shoe, Run shoe, wash pipe \$ 15;+5 tubing back in	182 PS. Wash	back Inun Lu	nacker - act	ing black shale M	Ill on Dacker - n	nade
bubing, washpipe & mill. Change mill shoe, Run shoe, wash pipe \$ 15;+5 tubing back in	8"-9" 5ta	posed making hal	- mill such so	maino - no torano Las	down PS. Toin	out ul
Shut Joun.	Lubban work	71 - 1 mill (10.	so hattle dans	Run Shap wall aire &	15:45 Anhan 1	a Dis
	SI. I . I	yujica milli. Smany	· Iniii znaci i	was snow, wash fift A	1-1. Arraina De	ALK UNI
	UNIT SOUN.					
				_		

DAILY WORKOVER REPORT

D.S. & W. Well Servicing, Inc.Telephone (620) 587-3361 - P.O. Box 231 - Claflin, KS 67525

Company Car	men Schmitt			_ Date <u>/2 - 3, 4 - 20</u>	/3
	Lease <i>Split</i> k	er B	Well#_ 2	•	
	Township				
	al Tools / Supplies Used				HRS.
2 trips d	ope /	Date: /2-3-13	Operator: Danny S.		12 1
2 991 50	Vent V		Floor Hand: Victor 5		12.1
	_		Floor Hand: Jimon H.		12 1
			Floor Hand:		
Work Performed: <i></i>	TL, DDSI Finish r	unning in with	ling. Tag fill @ 296	O. HOOK up MPTH	95
Wash back d	own to packer - qu	Hing black sha	Le Tried tomillon p	alker - just 3pl	nning
Cicculate 1	hole Clean, Lay o	OWN PS. Trippe	it w/ tubing, wash ply	re & mill Walt or	orters
Decided top	lug well Walt on	it sig up bagger	1. Perf. @ 1225, 925,	\$250' Tear down	n loggers
Run in w/+	ubing to 2960, 4	Jait on & hook 1	ip Cementars. Spot 3.5.	sxs cement Pul	11 tribing
out to 1215	1 Pump 35 5X5	cement w/320 a	C. Pull tuking out, h	Jait Ihr. Run of	y bina
back in Ta	a cement @ 12	10. Pull up to 9	C. Pull tubing out. W 25: Pukip 355x5 W/3/3	CC & Both wills. Pull	tubing,
Qty Speci	al Tools / Supplies Used				HRS.
		Date: 12-4-13	Operator: Danny S		5 V
			Floor Hand: Victor 5		51
			Floor Hand: Simon H.		51
	·· ·	·	Floor Hand:		
Of tholing.	HOOK UP to SURT	ace pipe-pump	circulated good cemes ed 15965 coment pr down, Drive rig	essure to 250. 3	Shut tnj
Qty Speci	ial Tools / Supplies Used				HRS.
		Date:	Operator:		
	<u> </u>		Floor Hand:		
			Floor Hand:		
			Floor Hand:		
Work Performed:					
		<u></u>			
	 	-			