

REMIT TO
 RR 1 BOX 90 D
 HOXIE, KS 67740

SCHIPPERS OIL FIELD SERVICE L.L.C.

NO 603

DATE <i>4/9/77</i> SEC. <i>15</i>	RANGE/TWP. <i>9-24</i>	CALLED OUT	ON LOCATION	JOB START <i>2:00 AM</i>	JOB FINISH <i>5:00 AM</i>
LEASE <i>Nicholson</i>			WELL # <i>15-1</i>		
			COUNTY <i>11</i>	STATE <i>15</i>	

CONTRACTOR <i>White Knight</i>	OWNER <i>Ron Oil Operation</i>				
TYPE OF JOB <i>Surf</i>					
HOLE SIZE <i>12 1/4</i>	T.D.	CEMENT			
CASING SIZE <i>8 5/8</i>	DEPTH <i>302</i>	AMOUNT ORDERED			
TUBING SIZE	DEPTH				
DRILL PIPE	DEPTH				
TOOL	DEPTH				
PRES. MAX	MINIMUM	COMMON	<i>225</i>	@ <i>17⁰⁰</i>	<i>3,150</i>
DISPLACEMENT	SHOE JOINT	POZMIX		@	
CEMENT LEFT IN CSG.		GEL	<i>6</i>	@ <i>22⁰⁰</i>	<i>135</i>
PERFS		CHLORIDE	<i>10</i>	@ <i>52⁰⁰</i>	<i>5205</i>
		ASC		@	
EQUIPMENT				@	
				@	
PUMP TRUCK				@	
# <i>504</i>				@	
BULK TRUCK				@	
#				@	
BULK TRUCK				@	
#				@	
		HANDLING	<i>241</i>	@ <i>1⁰⁰</i>	<i>361.50</i>
		MILEAGE	<i>32</i>	@ <i>.08/mi</i>	<i>46.96</i>
		TOTAL			

REMARKS	SERVICE	<i>Surf</i>		
<i>Circulate Cement</i>	DEPT OF JOB		@	
	PUMP TRUCK CHARGE	<i>71</i>	@ <i>950</i>	<i>750</i>
	EXTRA FOOTAGE		@	
<i>Plug Down @ 3 AM</i>	MILEAGE	<i>32</i>	@ <i>65⁰⁰</i>	<i>1920</i>
	MANIFOLD		@	
			@	
	TOTAL			

CHARGES TO: <i>Ron Oil</i>	
STREET	STATE
CITY <i>Perkins</i>	ZIP

PLUG & FLOAT EQUIPMENT	
	@
	@

To: Schippers Oil Field Services L.L.C.
 You are hereby requested to rent cementing equipment

Rons Oil Operations

Nickelson 15-1

4-23-17 Casing on location unload and inspect and talley and lube threads.

No floating equipment hot shot for that equipment. Start 51/2 casing in hole with floating equipment as follows. Float Shoe on bottom of casing.

Latch Down Baffle on top of Shoe Joint-length of 25.32 ft. in length.

Centralizers on collars 1-3-5-53-55 turbo type and port collar top of joint 54 2172 ft. Tag TD at 4105 ft with 120 joints of casing. Pickup 5 ft from bottom.

Casing at 4100 latch down at 4075 ft. Hook to circulate. Recipocate casing for

10 minutes and circulate the rest of 15 total minutes. Hook to Super Oil Well

Cementing. Plug Rat Hole with 30 sks Cement. Hook to 51/2 casing. Pump

500 gallons Mud Flush Mix 120 sks of Std. Cement with 10% Salt and 5 lbs

Gilsonite per sk. Wash out pump and lines Release Latchdown plug and start

Displacement. 1st 10 bbl 2% KCL water. Pump total of 97 Bbl displacement

with 75# lift psi. Plug landed at 1000 psi and held. Release psi Float Held.

Set slips in Braden Head Job Complete. 11 pm Terry Garrison