

JOB LOG

SWIFT Services, Inc.

DATE 10 OCT 17 PAGE NO. 1

CUSTOMER		WELL NO.		LEASE		JOB TYPE		TICKET NO.	
NORSTAR		1-28		NORTON		Plug to Abandon		30734	
CHART NO.	TIME	RATE (BPM)	VOLUME (BBL) (GAL)	PUMPS		PRESSURE (PSI)		DESCRIPTION OF OPERATION AND MATERIALS	
				T	C	TUBING	CASING		
									2 40 sk 60/40 poz mix (4% gel) 28 sk Benlate gel 2 sk cottonseed hulls 2 3/8 x 5 1/2
	0800								on loc TRK 110
	0830								tubing to 4572'
		3 3/4				Ø			Mix Benlate gel 21 sk
		3 3/4	25			400			catch pressure
		3 3/4	46			400			- circ fluid to surface -
		3 1/2	61			650			Switch to 60/40 poz (4%) @ 13.1 ppg
			74						Mix 30 sk w/ 2 sk hulls
		3 1/4	87			650			switch to flush - flush H <sub>2</sub> O
	0855		87			Ø			Kickout - on slight vacuum
									pull tubing to 1600'
	1005	3 1/2				Ø			Mix 30 sk 60/40 poz (4%) @ 13.1 ppg
		3 1/2	3			200			- circ fluid to surface -
		3 1/2	7			200			Switch to Flush
		3 1/2	11			200			Kickout - instant vacuum
	1020								pull to 1600'
	1050	3 1/2				Ø			Mix 60/40 poz mix (4%) @ 13.1 ppg
									(circ to surface)
		1 1/2	17			150			→ cement to surface ← 65 sk
	1100								pull tubing from hole
	1115	1/2				Ø			Hook up 8 1/8
		1/2	6			300			Mix 60/40 (4%) @ 13.1 ppg
									holding 300psi 25 sk
									top of 6' 5 1/2"
	1145								→ cement standing at surface ← Wash truck
									Rack up
	1220								job complete

160 cement mixed