

file on
map file

Concorde Resources Corp.
P.O. Box 841
111 South Main
Eufaula, OK 74432

McDaniels #1-14
Sec 14, Twp 15S, R 34W
Logan Co., KS

**Drilling Supervision,
Set Surface Pipe,
& Plug**

Prepared for: Gary Moores & Bill Woods

September 22, 2015

Prepared by:
Dreiling Enterprises, LLC
Preston L. Dreiling
815 Main Street
Victoria, KS 67671
(785) 639-2099

Concorde Resources Corp.
McDaniels #1-14
Friday January 5, 2018
Set Surface Pipe

Drill down to 308', circulate hole clean. Trip out of hole with collars and bit.

7 joints of 23# 8 5/8" (295.39').

Welder cut texas shoe on bottom joint of 8 5/8".

Trip in the hole with 8 5/8".

Run landing joint. Set pipe at 307'.

Tag bottom and rig up Quality Oilwell Cementing.

Break circulation with rigs mud pump.

Start mixing. Mixed 170 sacks common 3% C.C., 2% gel.

Done mixing. Start displacement.

Displaced 18 barrels of water. Left 10' of cement in 8 5/8".

(Circulated cement to pit.)

Rig Quality Oilwell Cementing down.

Concorde Resources Corp.

McDaniels #1-14

Sunday January 14, 2018

Plug

Run drill pipe open ended to 2385'.

Rig up QES.

Mix 50 sacks of 60/40 poz. 4% gel. 1/4# flo-seal and displaced.

Lay down drill pipe to 1200', mixed 100 sacks.

Lay down drill pipe to 360', mixed 50 sacks.

Lay down rest of pipe. Break down Kelly and rat hole.

Push plug to 40' and mix 10 sacks.

Plug rat hole with 30 sacks.

Plug mouse hole with 15 sacks.

Rig Quality Oilwell Cementing down.

Plug with 255 sacks 60/40 poz. 4% gel. 1/4# flo-seal.