4 - 060893

30 R

Form CP-2/3

163-03575-00-00 6-13 TO: API Number:15- -STATE CORPORATION COMMISSION **SE NE SE** /4 SEC. 06 , 10 S, 20 W CONSERVATION DIVISION - PLUGGING 130 SOUTH MARKET, SUITE 2078 1650 feet from S section line WICHITA, KANSAS 67202 330 _____ feet from E section line Operator license# -Lease Frank Hinkhouse Well # 2 Operator: State of Kansas - Fee Fund County: ____Rooks Well total depth____ Address: 2301 E. 13th Street - Dist.#4 3848 Hays, Kansas 67601 Conductor Pipe: 0 inch @ 0 feet Surface pipe 8 5/8 Inch @ 215 feet Noir-Blanc #3978 Aband. oil well_x, Gas well____, Input well___, SWD__, D & A_\frac{\frac{1}{2}}{2} Plugging contractor: Berexco, Inc. _____ License# **5363** Address: P.O. Box 723 - Hays, Kansas 67601 Company to plug at: Hour: A.M. Day: 12 Month: June Year: 1996 Plugging proposal received from: District #4 Staff - Kansas Corporation Commission Company: Berexco, Inc. Phone: 913-628-6101 Were: Order 375 sxs 60/40 posmix - 10% gel and hulls. Plug with tubing. Joint project between Kansas Corporation Commission and Berexco, Inc. to plug RECEIVED KANSAS CORPORATION COMMISSION the abandoned well. Plugging Proposal Received by: Herb Deines Plugging operations attended by agent? All[x], Part[], None[] CONSERVATION DIVISION WICHITA, KS Completed: Hour: 11:30 A.M. , Day: 13 , Month: June _____, Year:___**1996**__ Actual plugging report: 8 5/8" to 215'. 5 1/2" to 3846'. RU Berexco, Inc. equipment. Pulled plug. Perforated at 1025' - 1790' - 2300'. Ran tubing to 3750' to plug. Pumped 110 sxs cement with 400# hulls. Pulled tubing to 2300' and pumped 80 sxs with 300# hulls. Pulled tubing to 1200' and pumped 185 sxs cement with no returns. SDON. 06-13-96 Ran WL and found cement top at 1170'. Ran tubing to 1170' and circulated cement to surface with 100 sxs with 600# hulls. Pulled tubing. Tied onto annulus and pumped 10 sxs with instant 400# S.I.P. Tied onto production casing and pumped 5 sxs. Pressured to Max. 1000#. S.I.P. 1000#. Remarks: Allied Cementing-Log-Tech Inc. perforating-Keller Tank Sservice-Jerry's Roustabout. Condition of casing(in hole): GOOD___ BAD___X____ Anhy.plug: YES__X NO_ Bottom plug(in place): YES X , CALC ___ , NO ___ Dakota plug: YES X __ , NO ___ Plugged through TUBING X , CASING . Elevation: 2273 I did[X] / did not[] observe the plugging.