Notice: Fill out COMPLETELY and return to Conservation Division at the address below within 60 days from plugging date.

KANSAS CORPORATION COMMISSION OIL & GAS CONSERVATION DIVISION

WELL PLUGGING RECORD

Form CP-4 December 2003 Type or Print on this Form Form must be Signed All blanks must be Filled

K.A.R. 82-3-117

P.O. Roy 838	009-23797 -0001
	ock unit 11/13
Phone: (618) 943 - 2227	(CC PC)
Type of Well: Docket #: Spot Location (QQQQ)	: <u>5W-hW - NW</u>
(Oil, Gas D&A, SWD, ENHR, Water Supply Well, Cathodic, Other) OCKET #: (Oil, Gas D&A, SWD, ENHR, Water Supply Well, Cathodic, Other) Tocket #: 1065 Feet from	North / South Section Line
1/13/04	East / West Section Line
·····	S. R. 13 East west
Is ACO-1 filed? Tyes No If not is well log attached? Tyes No Barton	
Producing Formation(s): List All (If needed attach another sheet) Date Well Completed:	1.1/27/52 11/20/81
Depth to Top: 0235 Bottom: 0725 T.D. 0350 Plugging Commenced:	1/13/09
Depth to top. Bottom: 1.D. Physian Completed:	1/14/09
Depth to Top: Bottom: T.D	
Show depth and thickness of all water, oil and gas formations.	
Oil, Gas or Water Records Casing Record (Surface Conductor & Produc Formation Content From To Size Put In	_
	Pulled Out
	None
5 1/2" 3589'	1398'
Describe in detail the manner in which the well is plugged, indicating where the mud fluid was placed and the method or hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug Cast iron bridge plug @ 3200' w/ 5 sk cement on top, cut 5 1/2" casing off @ 1398' & pull out of hole, run tubing to	set.
	set. 1450', mix 34 sk gel, circulate hole
hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug Cast iron bridge plug @ 3200' w/ 5 sk cement on top, cut 5 1/2" casing off @ 1398' & pull out of hole, run tubing to	y set. 1450', mix 34 sk gel, circulate hole t w/ 200# hulls from 730' to 530'.
hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug Cast iron bridge plug @ 3200' w/ 5 sk cement on top, cut 5 1/2" casing off @ 1398' & pull out of hole, run tubing to w/ 73 bbl mud, spot 50 sk cement w/ 200# hulls from 1450' to 1250'. Pull tubing to 730', spot 50 sk cement	t w/ 200# hulls from 730' to 530'. t casing off 3' below ground level.
hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug Cast iron bridge plug @ 3200' w/ 5 sk cement on top, cut 5 1/2" casing off @ 1398' & pull out of hole, run tubing to w/ 73 bbl mud, spot 50 sk cement w/ 200# hulls from 1450' to 1250'. Pull tubing to 730', spot 50 sk cement Pull tubing to 400', spot 100 sk cement w/ 100# hulls from 400' to surface. Cement circulates to the surface. Cu Backfill & cleanup location.	y set. 1450', mix 34 sk gel, circulate hole t w/ 200# hulls from 730' to 530'.
hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug Cast iron bridge plug @ 3200' w/ 5 sk cement on top, cut 5 1/2" casing off @ 1398' & pull out of hole, run tubing to w/ 73 bbl mud, spot 50 sk cement w/ 200# hulls from 1450' to 1250'. Pull tubing to 730', spot 50 sk cement Pull tubing to 400', spot 100 sk cement w/ 100# hulls from 400' to surface. Cement circulates to the surface. Cu Backfill & cleanup location. Name of Plugging Contractor: Pratt Well Service License #: 5893	t w/ 200# hulls from 730' to 530'. t casing off 3' below ground level.
hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug Cast iron bridge plug @ 3200' w/ 5 sk cement on top, cut 5 1/2" casing off @ 1398' & pull out of hole, run tubing to w/ 73 bbl mud, spot 50 sk cement w/ 200# hulls from 1450' to 1250'. Pull tubing to 730', spot 50 sk cement Pull tubing to 400', spot 100 sk cement w/ 100# hulls from 400' to surface. Cement circulates to the surface. Cu Backfill & cleanup location. Name of Plugging Contractor: Pratt Well Service Address: P O Box 847 Pratt, KS 657124-0847	t w/ 200# hulls from 730' to 530'. t casing off 3' below ground level. KANSAS CORPOLEMON COMMISSIO. FED 2 0 2009 CONSERVATION DIVISIO
hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug Cast iron bridge plug @ 3200' w/ 5 sk cement on top, cut 5 1/2" casing off @ 1398' & pull out of hole, run tubing to w/ 73 bbl mud, spot 50 sk cement w/ 200# hulls from 1450' to 1250'. Pull tubing to 730', spot 50 sk cement Pull tubing to 400', spot 100 sk cement w/ 100# hulls from 400' to surface. Cement circulates to the surface. Cu Backfill & cleanup location. Name of Plugging Contractor: Pratt Well Service Address: P O Box 847 Pratt, KS 657124-0847 Name of Party Responsible for Plugging Fees: Herman L. Loeb Lawrence	t casing off 3' below ground level. KANSAS CORPOLATION COMMISSION FED 2 0 2009
hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug Cast iron bridge plug @ 3200' w/ 5 sk cement on top, cut 5 1/2" casing off @ 1398' & pull out of hole, run tubing to w/ 73 bbl mud, spot 50 sk cement w/ 200# hulls from 1450' to 1250'. Pull tubing to 730', spot 50 sk cement Pull tubing to 400', spot 100 sk cement w/ 100# hulls from 400' to surface. Cement circulates to the surface. Cu Backfill & cleanup location. Name of Plugging Contractor: Pratt Well Service License #: 5893 Address: P O Box 847 Pratt, KS 657124-0847 Name of Party Responsible for Plugging Fees: Herman L. Loeb State of Illinois County, Lawrence , ss.	t w/ 200# hulls from 730' to 530'. t casing off 3' below ground level. KANSAS CORPOLEMON COMMISSION FED 2 0 2009 CONSERVATION DIVISION WICHITA KS
hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug Cast iron bridge plug @ 3200' w/ 5 sk cement on top, cut 5 1/2" casing off @ 1398' & pull out of hole, run tubing to w/ 73 bbl mud, spot 50 sk cement w/ 200# hulls from 1450' to 1250'. Pull tubing to 730', spot 50 sk cement Pull tubing to 400', spot 100 sk cement w/ 100# hulls from 400' to surface. Cement circulates to the surface. Cu Backfill & cleanup location. Name of Plugging Contractor: Pratt Well Service Address: P O Box 847 Pratt, KS 657124-0847 Name of Party Responsible for Plugging Fees: Herman L. Loeb State of Illinois County, Lawrence, ss.	t w/ 200# hulls from 730' to 530'. t casing off 3' below ground level. KANSAS CONFOLUTION COMMISSION FED 2 0 2009 CONSERVATION DIVISION WICHITA KS
hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug Cast iron bridge plug @ 3200' w/ 5 sk cement on top, cut 5 1/2" casing off @ 1398' & pull out of hole, run tubing to w/ 73 bbl mud, spot 50 sk cement w/ 200# hulls from 1450' to 1250'. Pull tubing to 730', spot 50 sk cement Pull tubing to 400', spot 100 sk cement w/ 100# hulls from 400' to surface. Cement circulates to the surface. Cu Backfill & cleanup location. Name of Plugging Contractor: Pratt Well Service Address: P O Box 847 Pratt, KS 657124-0847 Name of Party Responsible for Plugging Fees: Herman L. Loeb State of Illinois County, Lawrence (Employee of Operator) or (Operator) or	t w/ 200# hulls from 730' to 530'. t casing off 3' below ground level. KANSAS CONFOLUTION COMMISSION FED 2 0 2009 CONSERVATION DIVISION WICHITA KS
hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug Cast iron bridge plug @ 3200' w/ 5 sk cement on top, cut 5 1/2" casing off @ 1398' & pull out of hole, run tubing to w/ 73 bbl mud, spot 50 sk cement w/ 200# hulls from 1450' to 1250'. Pull tubing to 730', spot 50 sk cement Pull tubing to 400', spot 100 sk cement w/ 100# hulls from 400' to surface. Cement circulates to the surface. Cu Backfill & cleanup location. Name of Plugging Contractor: Pratt Well Service Address: P O Box 847 Pratt, KS 657124-0847 Name of Party Responsible for Plugging Fees: Herman L. Loeb State of Illinois County, Lawrence State of Cemployee of Operator) or (Operator) or sworn on oath, says: That I have knowledge of the facts statements, and matters herein contained, and the log of the above the surface of the surface.	t w/ 200# hulls from 730' to 530'. t casing off 3' below ground level. KANSAS CONFOLUTION COMMISSION FED 2 0 2009 CONSERVATION DIVISION WICHITA KS
hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug Cast iron bridge plug @ 3200' w/ 5 sk cement on top, cut 5 1/2" casing off @ 1398' & pull out of hole, run tubing to w/ 73 bbl mud, spot 50 sk cement w/ 200# hulls from 1450' to 1250'. Pull tubing to 730', spot 50 sk cement Pull tubing to 400', spot 100 sk cement w/ 100# hulls from 400' to surface. Cement circulates to the surface. Cu Backfill & cleanup location. Name of Plugging Contractor: Pratt Well Service Address: P O Box 847 Pratt, KS 657124-0847 Name of Party Responsible for Plugging Fees: Herman L. Loeb State of Illinois County, Lawrence State of Cemployee of Operator) or (Operator) or swom on oath, says: That I have knowledge of the facts statements, and matters herein contained, and the log of the absame are true and correct, so help me God.	t w/ 200# hulls from 730' to 530'. t casing off 3' below ground level. KANSAS CONFOLUTION COMMISSION FED 2 0 2009 CONSERVATION DIVISION WICHITA KS
hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug. Cast iron bridge plug @ 3200' w/ 5 sk cement on top, cut 5 1/2" casing off @ 1398' & pull out of hole, run tubing to w/ 73 bbl mud, spot 50 sk cement w/ 200# hulls from 1450' to 1250'. Pull tubing to 730', spot 50 sk cement Pull tubing to 400', spot 100 sk cement w/ 100# hulls from 400' to surface. Cement circulates to the surface. CuBackfill & cleanup location. Name of Plugging Contractor: Pratt Well Service Address: P O Box 847 Pratt, KS 657124-0847 Name of Party Responsible for Plugging Fees: Herman L. Loeb State of Illinois County, Lawrence Swom on oath, says: That I have knowledge of the facts statements, and matters herein contained, and the log of the absame are true and correct, so help me God.	t w/ 200# hulls from 730' to 530'. t casing off 3' below ground level. KANSAS CONFOLUTION COMMISSION FED 2 0 2009 CONSERVATION DIVISION WICHITA KS
hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug Cast iron bridge plug @ 3200' w/ 5 sk cement on top, cut 5 1/2" casing off @ 1398' & pull out of hole, run tubing to w/ 73 bbl mud, spot 50 sk cement w/ 200# hulls from 1450' to 1250'. Pull tubing to 730', spot 50 sk cement Pull tubing to 400', spot 100 sk cement w/ 100# hulls from 400' to surface. Cement circulates to the surface. Cu Backfill & cleanup location. Name of Plugging Contractor: Pratt Well Service License #: 5893 Address: P O Box 847 Pratt, KS 657124-0847 Name of Party Responsible for Plugging Fees: Herman L. Loeb State of Illinois County, Lawrence swom on oath, says: That I have knowledge of the facts statements, and matters herein contained, and the log of the absame are true and correct, so help me God. (Signature) (Address) P O Box 743 Newburgh, IN 47629-0743 SUBSCRIBED and SWORN TO before me this 13th day of February	t w/ 200# hulls from 730' to 530'. It casing off 3' below ground level. KANSAS CORPOLATION COMMISSION FED 2 0 2009 CONSERVATION DIVISION WICHITA KS In above-described well, being first duly prove-described well is as filed, and the

WARRICK COUNTY, INDIANA COMMISSION EXPIRES 9/14/2014