

TO: STATE CORPORATION COMMISSION
CONSERVATION DIVISION - PLUGGING
130 SOUTH MARKET, SUITE 2078
WICHITA, KANSAS 67202

API Well Number: 15-115-19211-00-00
Spot: SWSESWNW Sec/Twnshp/Rge: 26-17S-4E
2964 feet from S Section Line, 4620 feet from E Section Line
Lease Name: MEYER Well #: 1
County: MARION Total Vertical Depth: 2394 feet

Operator License No.: 33005
Op Name: RANDON PRODUCTION COMPANY IN
Address: 2761 REMINGTON RD
MARION, KS 66861

String	Size	Depth (ft)	Pulled (ft)	Comments
SURF	8.625	208		
PROD	5.5	2390		

Well Type: OIL UIC Docket No: _____ Date/Time to Plug: 06/03/2010 10:00 AM
Plug Co. License No.: 33005 Plug Co. Name: RANDON PRODUCTION COMPANY INC.
Proposal Rcvd. from: RANDY L. SVITAK Company: RANDON PRODUCTION Phone: (620) 381-1856

Proposed Plugging Method: AS PER KCC

Plugging Proposal Received By: _____ Witness Type: PARTIAL
Date/Time Plugging Completed: 06/04/2010 4:30 PM KCC Agent: SHANE JONES

Actual Plugging Report:

5/28/2010 RANDON CAN NOT GET TO BOTTOM. THEY APPEAR TO BE OUTSIDE OF THE CASING AT APPROX 275'. RANDY SVITAK SPOKE WITH J KLOCK DIST 2 WHO GAVE HIM PERMISSION TO PLUG WELL. 6/2/2010 RANDON GOT DOWN TO 345' AND SPOTTED A 40 SX PLUG OF 60/40 POS MIX. THEY THEN CAME UP TO 270' AND SPOTTED A 35 SX PLUG. THEY NEVER DID GET CIRCULATION. 6/3/2010 RANDON WENT BACK IN WITH TUBING AND TAGGED PLUG @ 190' INSIDE THE 5.5" CASING. 6/4/2010 RANDON RAN 1" DOWN ON BACKSIDE. CONSOLIDATED TIED ON AND TRIED TO CIRCULATE UP THE BACKSIDE. THEY PUMPED @ 2.5 BBLS A MINUTE, BUT NEVER GOT IT TO CIRCULATE. IT WAS DECIDED TO SPOT A 50 SX PLUG @ 150' WITH CLASS A W/3% CAC1. LET SET FOR 2 HRS. WENT BACK IN WITH 1" DOWN THE BACKSIDE TO 150' DI DNOT TAG CEMENT. THEY TRIED CIRCULATING AGAIN. BACKSIDE CIRCULATED @ 3.5 BBLS., BUT FELL OUT OF SITE AS SOON AS THEY STOPPED PUMPING. IT WAS DECIDED TO PUMP ANOTHER 50 SX PLUG. AT APPROX 30SX FLUID STARTED CIRCULATING OUT OF THE 5.5". THEY DECIDED TO CONTINUE PUMPING CEMENT. CEMENT CIRCULATED UP THE BACKSIDE AND UP THE 5.5" CASING. THEY STOPPED AT 80 SX CLASS A W/3% CAC1. ONCE THEY STOPPED PUMPING CEMENT FELL OUT OF SITE ON BACKSIDE AND DOWN 5.5" CASING. IT WAS DECIDED TO LET IT SET AGAIN FOR 1.5 HRS. AFTER 1.5 HURS THEY RAN 1" DOWN 5.5" TO 150'. THEY DID NOT TAG AN CEMENT. THEY PULLED THE 1" OUT, AND RAN IT DOWN THE BACKSIDE TO 150'. THEY DID NOT TAG AN CEMENT. CONSOLIDATED TIED BACK ON AND TRIED CIRCULATING THE BACKSIDE. THE BACKSIDE CIRCULATED @ 4BBLS. THEY DID NOT GET AN CIRCULATION UP THE 5.5" CASING. THEY DECIDED TO PUMP ANOTHER 50 SX PLUG @ 150' ON THE BACKSIDE. THEY STARTED PUMPING CEMENT AND AGAIN AT APPROX 25 SX OF CEMENT IT STARTED CIRCULATING UP THE 5.5". THEY CIRCULATED WITH APPROX 80 SX AND HAD GOOD CEMENT ON THE BACKSIDE AND INSIDE THE 5.5" CASING. RANDON PULLED THE 1", AND CONSOLIDTED TOPPED OFF THE HOLE WITH ANOTHER 10 SXS. 6/7/2010 I CHECKED TOP PLUG FINDING IT APPROX 8' DOWN. THEY USED A TOTAL OF 75 SX 60/40 POS MIX & 220SX Class A w/3% CAC1 TK #28820

Perfs:

6/11/10
2012061242

RECEIVED
JUN 11 2010
KCC WICHITA

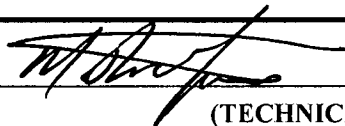
Remarks: WELL PLUGGED DUE TO DENIED TA 10 YEAR RULE

✓

Plugged through: TBG

District: 02

Signed _____

A handwritten signature in black ink, appearing to be 'M. St. John', written over a horizontal line.

(TECHNICIAN)

Form CP-2/3

RECEIVED
JUN 11 2010
KCC WICHITA