

TO: STATE CORPORATION COMMISSION
CONSERVATION DIVISION - PLUGGING
130 SOUTH MARKET, SUITE 2078
WICHITA, KANSAS 67202

API Well Number: 15-115-19204-00-01
Spot: SWNE Sec/Twnshp/Rge: 27-17S-4E
4512 feet from S Section Line, 1046 feet from E Section Line
Lease Name: MEYER Well #: 7
County: MARION Total Vertical Depth: 2686 feet

Operator License No.: 33005
Op Name: RANDON PRODUCTION COMPANY IN
Address: 2761 REMINGTON RD
MARION, KS 66861

String	Size	Depth (ft)	Pulled (ft)	Comments
SURF	8.625	150		
T2	1.5	2528	2528	
PKR	3	2525	2100	
PROD	5.5	2624	250	

Well Type: SWD UIC Docket No: D23879.0 Date/Time to Plug: 10/15/2010 10:00 AM
Plug Co. License No.: 33005 Plug Co. Name: RANDON PRODUCTION COMPANY INC.
Proposal Rcvd. from: RANDY SVITAK Company: RANDON PRODUCTION CO Phone: (620) 381-1856

Proposed Plugging Method: AS PER JEFF KLOCK, KCC DIST 2

Plugging Proposal Received By: Witness Type: PARTIAL
Date/Time Plugging Completed: 10/15/2010 3:00 PM KCC Agent: SHANE JONES

Actual Plugging Report:

RANDON WAS REQUIRED PER KCC TO PULL THE 1.5" TUBING AND THEN SHOOT THE 3" TUBING OFF AT THE TOP OF THE PACKER AND PULL IT. RANDON WAS ABLE TO RETRIEVE ALL THE 1.5" TUBING. THE 3" PARTED @ APPROX 2100' LEAVING 425' OF 3" PLASTIC LINED STEEL TUBING ABOVE THE PACKER. RANDON ALLOWED TO LEAVE TUBING AND PACKER IN THE HOLE. THEY WERE REQUIRED TO SAND THE HOLE TO 50' ABOVE THE PARTED TUBING (2050'). RANDY SVITAK SAID. THEY TAGGED SAND @ 2050' AND CAPPED WITH 5 SXS CEMENT. THEY TRIED SHOOTING CASING OFF AT 750' AND 500', BUT CASING WOULD NOT COME FREE. THEY FINALLY SHOT CASING OFF @ 250' AND WAS ABLE TO PULL IT. 10/15/2010 I ARRIVED ON SITE FINDING TUBING RAN INTO 250' AND RANDON ALREADY HAD 40 SXS OF 60/40 MIXED UP. THEY COULD NOT GET IT TO PUMP DOWN THE TUBING. AFTER PULLING UP ON TUBING AND THEN SETTING BACK DOWN. THEY REALIZED THEY WERE EITHER SETTING ON TOP OF THE 5.5" OR OUTSIDE THE 5.5" STACKED OUT IN THE MUD. THEY PULLED UP ABOUT 5' AND PUMPED THEIR CEMENT. THEY MIXED AND PUMPED APPROX 100 SXS OF 60/40 MIX TOTAL AND RAN OUT OF CEMENT. NEVER DID GET CEMENT TO CIRCULATE TO SURFACE. IT WAS DECIDED TO PULL TUBING AND GO TO LUNCH. AFTER LUNCH WILL TRY TO TAG CEMENT AND CALCULATE HOW MUCH MORE IS NEEDED. AFTER LUNCH TAGGED CEMENT @ APPROX 90'. RANDY WENT TO GET MORE CEMENT. THEY RAN IN APPROX 90' OF TUBING AND MIXED UP ANOTHER 30 SXS (24SX CEMENT & 6 SX FLYASH). THEY PUMPED THIS DOWN AND CIRCULATED CEMENT TO SURFACE. THEY PULLED TUBING AND HOLE STOOD FULL. THEY USED A TOTAL OF 130 SXS FOR TOP PLUG FINISHING AT 3:00 PM. 10/18/2010 I CHECKED TOP PLUG FINDING IT AT THE SURFACE OF THE 8.625".

Perfs:


Top	Bot	Thru	Comments
2624	2686	OH	

Remarks: COMMISSION ORDER TO PLUG OR REPAIR WELL FOR FAILING TO MIT

Plugged through: TBG

District: 02

Signed

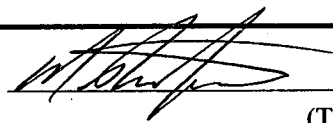

(TECHNICIAN)

RECEIVED
OCT 28 2010
KCC WICHITA

✓