FORM CP-2/3 Rev.01-84

· 1 050218

CTATE COR		
STATE CORPORATION COMMISSION CONSERVATION DIVISION - PLUGGING SECTION 200 COLORADO DERBY BUILDING WICHITA, KANSAS 67202		, SEC31, T19S, R21 (
•		
	N'S PLUGGING REPORT	
Operator	L1cense # 5447	Lease Name Foos 'A' Well # 1
	Cities Service Oil & Gas Corp.	County Ness
Nameå Address	800 Sutton Place	Well Total Depth 4414 143.46
	Wichita, KS 67202	Conductor Pipe: Sizefeet
	·	Surface Casing: Size 8 5/8 feet 516
Abandoned	Oll Weil X Gas Well	Input WellD&A
	' ·	
		License Number 6454
Address	Box 384, North Highway 283, Ness	City, KS 67560
Company †	o plug at: Hour: $9:30$ am Day: 1	5 Month: May Year:19 84
Plugging	proposal received from Bob Walte	rs
/		
rcombany	name)Cities Service	(phone) 91.3-398-4333
were:	4 1/2 set at 4412' PBTD 4409 Pe	
were:set 20 sx	4 1/2 set at 4412' PBTD 4409 Pe at 4406	
set 20 sx	4 1/2 set at 4412' PBTD 4409 Pe at 4406 at 1500	
set 20 sx	4 1/2 set at 4412' PBTD 4409 Pe at 4406	
<pre>set 20 sx set 20 sx set 20 sx set 5 sx</pre>	4 1/2 set at 4412' PBTD 4409 Pe at 4406 at 1500 at 660 at 60	rfs 4403-06 Squeezed at 3900 - 3435 620-635
<pre>set 20 sx set 20 sx set 20 sx set 5 sx</pre>	4 1/2 set at 4412' PBTD 4409 Pe at 4406 at 1500 at 660 at 60	rfs 4403-06 Squeezed at 3900 - 3435 620-635
set 20 sx set 20 sx set 20 sx set 5 sx Make sure	4 1/2 set at 4412' PBTD 4409 Pe at 4406 at 1500 at 660 at 60 mud is spotted between plugs Plugging Propos	sal Received by Richard M. Lacy (TECHNICIAN)
set 20 sx set 20 sx set 20 sx set 5 sx Make sure	4 1/2 set at 4412' PBTD 4409 Pe at 4406 at 1500 at 660 at 60 mud is spotted between plugs Plugging Propos	sal Received by Richard M. Lacy (TECHNICIAN) None
set 20 sx set 20 sx set 20 sx set 5 sx Make sure	4 1/2 set at 4412' PBTD 4409 Pe at 4406 at 1500 at 660 at 60 mud is spotted between plugs Plugging Propos	sal Received by Richard M. Lacy (TECHNICIAN)
set 20 sx set 20 sx set 20 sx set 5 sx Make sure Plugging Operation	4 1/2 set at 4412' PBTD 4409 Pe at 4406 at 1500 at 660 at 60 mud is spotted between plugs Plugging Propos Operations attended by Agent?: Al	sal Received by Richard M. Lacy (TECHNICIAN) X Part None None 84
set 20 sx set 20 sx set 20 sx set 5 sx Make sure Plugging Operation ACTUAL PL	4 1/2 set at 4412' PBTD 4409 Pe at 4406 at 1500 at 660 at 60 mud is spotted between plugs Plugging Propo Operations attended by Agent?: All s Completed: Hour: 1:00 pm Day: UGGING REPORT Ran tubing to 4402'	sai Received by Richard M. Lacy (TECHNICIAN) X Part None 15 Month: May Year: 19 84 pumped 20 sx cement, pulled 10 joints tubi
set 20 sx set 20 sx set 20 sx set 5 sx Make sure Plugging Operation ACTUAL PL and pumper	4 1/2 set at 4412' PBTD 4409 Pe at 4406 at 1500 at 660 at 60 mud is spotted between plugs Plugging Propos Operations attended by Agent?: Al s Completed: Hour: 1:00 pm Day: UGGING REPORT Ran tubing to 4402' di 15 sx gel. Pulled tubing to 1500	sal Received by Richard M. Lacy (TECHNICIAN) X Part None 84
set 20 sx set 20 sx set 20 sx set 20 sx Make sure Plugging Operation ACTUAL PL and pumper	4 1/2 set at 4412' PBTD 4409 Pe at 4406 at 1500 at 660 at 60 mud is spotted between plugs Plugging Propo Operations attended by Agent?: Al s Completed: Hour: 1:00 pm Day: ugging REPORT Ran tubing to 4402' d 15 sx gel. Pulled tubing to 1500 d pumped 5 sx gel. Pulled tubing to	sai Received by Richard M. Lacy (TECHNICIAN) X Part None 15 Month: May Year:19 84 pumped 20 sx cement, pulled 10 joints tubit 0' and pumped 20 sx gement. Pulled 10 joints to 660' and circulated cement. Pulled tubin
set 20 sx set 20 sx set 20 sx set 20 sx Make 5 sx Make sure Plugging Operation ACTUAL PL and pumpe tubing and	4 1/2 set at 4412' PBTD 4409 Pe at 4406 at 1500 at 660 at 60 mud is spotted between plugs Plugging Propos Operations attended by Agent?: Al s Completed: Hour: 1:00 pm Day: UGGING REPORT Ran tubing to 4402' d 15 sx gel. Pulled tubing to i pumped 5 sx gel. Pulled tubing to e hole and filled the hole with cer	sai Received by Richard M. Locary (TECHNICIAN) X Part None 15 Month: May Year: 19 84 pumped 20 sx cement, pulled 10 joints tubic of and pumped 20 sx gement. Pulled 10 joints to 660' and circulated cement. Pulled tubin ment. Pumped 60 sx cement down 8 5/8" and
set 20 sx set 20 sx set 20 sx set 20 sx Make 5 sx Make sure Plugging Operation ACTUAL PL and pumpe tubing and	4 1/2 set at 4412' PBTD 4409 Pe at 4406 at 1500 at 660 at 60 mud is spotted between plugs Plugging Propo Operations attended by Agent?: Al s Completed: Hour: 1:00 pm Day: ugging REPORT Ran tubing to 4402' d 15 sx gel. Pulled tubing to 1500 d pumped 5 sx gel. Pulled tubing to	sal Received by Richard M. Lacin (TECHNICIAN) X Part None 15 Month: May Year: 19 84 pumped 20 sx cement, pulled 10 joints tubi O' and pumped 20 sx gement. Pulled 10 joints to 660' and circulated cement. Pulled tubin ment. Pumped 60 sx cement down 8 5/8" and
set 20 sx set 20 sx set 20 sx set 20 sx Make 5 sx Make sure Plugging Operation ACTUAL PL and pumpe tubing and	4 1/2 set at 4412' PBTD 4409 Pe at 4406 at 1500 at 660 at 60 mud is spotted between plugs Plugging Propos Operations attended by Agent?: Al s Completed: Hour: 1:00 pm Day: UGGING REPORT Ran tubing to 4402' d 15 sx gel. Pulled tubing to i pumped 5 sx gel. Pulled tubing to e hole and filled the hole with cer	sai Received by Richard M. Locary (TECHNICIAN) X Part None 15 Month: May Year: 19 84 pumped 20 sx cement, pulled 10 joints tubic o' and pumped 20 sx gement. Pulled 10 joints to 660' and circulated cement. Pulled tubing the first temped 60 sx cement down 8 5/8" and
set 20 sx set 20 sx set 20 sx set 5 sx Make sure Plugging Operation ACTUAL PL and pumper tubing and out of the	4 1/2 set at 4412' PBTD 4409 Pe at 4406 at 1500 at 660 at 60 mud is spotted between plugs Plugging Propos Operations attended by Agent?: All s Completed: Hour: 1:00 pm Day: uGGING REPORT Ran tubing to 4402' di 15 sx gel. Pulled tubing to 1500 if pumped 5 sx gel. Pulled tubing to the pumped 5 sx gel. Pulled tubing to the pumped 5 sx gel. Pulled tubing to the hole and filled the hole with certain the state of the pumper pressure and the state of the pumper pressure and the state of the state of the state of the pumper pressure and the state of the	None 15 Month: May Year: 19 84 15 pumped 20 sx cement, pulled 10 joints tubing of and pumped 20 sx gement. Pulled 10 joints to 660' and circulated cement. Pulled tubing ment. Pumped 60 sx cement down 8 5/8" and a of 750 psi RECEIVED STATE CORPORATION COMMISSION.
set 20 sx set 20 sx set 20 sx set 20 sx set 5 sx Make sure Plugging Operation ACTUAL PL and pumper tubing and out of the 4 1/2" and	4 1/2 set at 4412' PBTD 4409 Pe at 4406 at 1500 at 660 at 60 mud is spotted between plugs Plugging Propos Operations attended by Agent?: All s Completed: Hour: 1:00 pm Day: uGGING REPORT Ran tubing to 4402' di 15 sx gel. Pulled tubing to 1500 di pumped 5 sx gel. Pulled tubing to e hole and filled the hole with centulus. Had a maximum pump pressure USe 60/40 Pozmix 2% gel 3% cc by Ha (If additional description is completed)	sai Received by Richard M. Lacery (TECHNICIAN) X Part None 15 Month: May Year: 19 84 pumped 20 sx cement, pulled 10 joints tubing and pumped 20 sx gement. Pulled 10 joints tubing to 660' and circulated cement. Pulled tubing the ment. Pumped 60 sx cement down 8 5/8" and the of 750 psi RECEIVED STATE CORPORATION COMMISSION
set 20 sx set 20 sx set 20 sx set 20 sx set 5 sx Make sure Plugging Operation ACTUAL PL and pumper tubing and out of the 4 1/2" and	4 1/2 set at 4412' PBTD 4409 Pe at 4406 at 1500 at 660 at 60 mud is spotted between plugs Plugging Propos Operations attended by Agent?: All s Completed: Hour: 1:00 pm Day: uGGING REPORT Ran tubing to 4402' di 15 sx gel. Pulled tubing to 1500 if pumped 5 sx gel. Pulled tubing to the pumped 5 sx gel. Pulled tubing to the pumped 5 sx gel. Pulled tubing to the hole and filled the hole with certain the state of the pumper pressure and the state of the pumper pressure and the state of the state of the state of the pumper pressure and the state of the	sai Received by Richard M. Lacery (TECHNICIAN) X Part None 15 Month: May Year: 19 84 pumped 20 sx cement, pulled 10 joints tubing and pumped 20 sx gement. Pulled 10 joints tubing to 660' and circulated cement. Pulled tubing the ment. Pumped 60 sx cement down 8 5/8" and the of 750 psi RECEIVED STATE CORPORATION COMMISSION