

15-007-30275-00-01

RECEIVED
STATE CORPORATION COMMISSION
JAN 21 1974
1-21-74
CONSERVATION DIVISION
Wichita, Kansas

STATE OF KANSAS
STATE CORPORATION COMMISSION

Give All Information Completely
Make Required Affidavit
Mail or Deliver Report to:
Conservation Division
State Corporation Commission
212 No. Market
Wichita, Kansas 67202

WELL PLUGGING RECORD

Barber County, Sec. 7 Twp. 35S Rge. (E) 15 (W)

Location as "NE/CNW/SW" or footage from lines C NE/4

Lease Owner Midwest Oil Corporation

Lease Name Ballet Ranch Well No. 5

Office Address Suite 333, 100 Park Avenue Building, Okla. City, OK 73102

Character of Well (completed as Oil, Gas or Dry Hole) Uneconomical gas, dry hole

Date well completed December 6 1966

Application for plugging filed November 29 1973

Application for plugging approved December 3 1973

Plugging commenced January 9 1974

Plugging completed January 12 1974

Reason for abandonment of well or producing formation Uneconomical gas zone

If a producing well is abandoned, date of last production No gas ever sold 19

Was permission obtained from the Conservation Division or its agents before plugging was commenced? Yes

Name of Conservation Agent who supervised plugging of this well Mr. G. Russell Biberstein

Producing formation Mississippi Depth to top 5174 Bottom 5210 Total Depth of Well 5252 Feet

Show depth and thickness of all water, oil and gas formations.

OIL, GAS OR WATER RECORDS

CASING RECORD

FORMATION	CONTENT	FROM	TO	SIZE	PUT IN	PULLED OUT
Redbed, shells, shale	Fr. Water	0	1020	8-5/8	1015'	None
Shale & Shells	--	1020	1620			
Shale & Lime	Salt Water	1620	4483			
Lime	Salt Water	4483	5252	4-1/2	5200'	4201'

Describe in detail the manner in which the well was plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used, state the character of same and depth placed, from _____ feet to _____ feet for each plug set.

The well had no tubing. Used pump & plug method. Pumped 50 sx cement plug & spotted 4504-5180'. Displaced behind plug with plugging mud. Shot off 4-1/2" casing at 4201' and start pulling casing. Spot 50 sx cement plug from 1085-945'. Finish pulling 4-1/2" casing. Place 10 sx cement in top of surface pipe. Cut off surface casing and weld on steel plate. P&A.

(If additional description is necessary, use BACK of this sheet)

Name of Plugging Contractor Sargent Casing Pulling

Address Box 506, Liberal, Kansas

STATE OF Oklahoma, COUNTY OF Oklahoma ss.
C. Ray Williams

(employee of owner) or (owner-or-operator) of the above-described well, being first duly sworn on oath, says: That I have knowledge of the facts, statements, and matters herein contained and the log of the above-described well as filed and that the same are true and correct. So help me God.

(Signature)

Suite 333, 100 Park Ave. Bldg., Okla. City, OK 73102
(Address)

SUBSCRIBED AND SWORN TO before me this 16th day of January, 1974

My commission expires August 31, 1976

Notary Public.