KS	NM	67	93	1

ine 1990)	DEPARTMENT	D STATES OF THE INTERIOR ND MANAGEMENT	FORM APPROVED Budget Bureau No. 1004-0135 Expires: March 31, 1993
	BUREAU OF LA	ND MANAGEMENT	5. Lease Designation and Serial No.
!	SUNDRY NOTICES AI		KS NM 67931
		ND REPORTS ON WELLS BLM-TULSA or to deepen or reentry to a different reservo	5. D. G. If Indian, Allottee or Tribe Name
Us	e "APPLICATION FOR F		<u> </u>
		· · · · · · · · · · · · · · · · · · ·	7. If Unit or CA, Agreement Designation
	SORWII IL	N TRIPLICATE	
I. Type of Well Oil Gas Well Well Well Other Dual Oil & Gas			8. Well Name and No.
2. Name of Operator			Low "C" No. 4
_Anadarko_Petroleum_Corporation			9. API Well No. 15-129 - 20074.00
3. Address and Telephone No.			3-21-72 Drill Date
P. O. Box 351, Liberal, Kansas 67905-0351 (316) 624-6253			10. Field and Pool, or Exploratory Area
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 3300' FSL & 4620' FEL Section 17-33S-40W			Cimarron Valley
			11. County or Parish, State
	ť		Morton, Kansas
CHECK A	PPROPRIATE BOX(s)	TO INDICATE NATURE OF NOTICE, REP	
	UBMISSION		
		TYPE OF ACTION	ON
Notice of I	ntent	Abandonment	Change of Plans
X Subsequent Report		Recompletion Plugging Back	New Construction Non-Routine Fracturing
CON DESCRIPTION	Nepolt	Casing Repair	Water Shut-Off
☐ Binal Aban	ndonment Notice	Altering Casing	Conversion to Injection
Car Fillar Atlas			
Li Filiai Adar		Other	Dispose Water
			(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form;
Describe Proposed or Comp		ortinent details, and give pertinent dates, including estimated date of st depths for all markers and zones pertinent to this work.)*	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form;
Describe Proposed or Comp give subsurface location	ons and measured and true vertical d	ertinent details, and give pertinent dates, including estimated date of st depths for all markers and zones pertinent to this work.)*	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form , arting any proposed work. If well is directionally drilled,
Describe Proposed or Comp give subsurface location	ons and measured and true vertical d	ertinent details, and give pertinent dates, including estimated date of st	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form , arting any proposed work. If well is directionally drilled,
Describe Proposed or Comp give subsurface location Subsequent repo	ons and measured and true vertical do	ertinent details, and give pertinent dates, including estimated date of st depths for all markers and zones pertinent to this work.)* Intention to plug and abandon a ter	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form , arting any proposed work. If well is directionally drilled,
Describe Proposed or Comp give subsurface location Subsequent repo	ons and measured and true vertical do	ertinent details, and give pertinent dates, including estimated date of st depths for all markers and zones pertinent to this work.)* Intention to plug and abandon a ter	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form , arting any proposed work. If well is directionally drilled,
Describe Proposed or Comp give subsurface location Subsequent repo Original Comple Plugged and Aba	ons and measured and true vertical door to of Notice of it etion Date: 3-31-andoned: 1-12-93	ertinent details, and give pertinent dates, including estimated date of st depths for all markers and zones pertinent to this work.)* Intention to plug and abandon a ter	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form, arting any proposed work. If well is directionally drilled, appropriately abandon well.
Describe Proposed or Compgive subsurface location Subsequent report Original Comple Plugged and Aba Plugging Method	ors and measured and true vertical door to of Notice of it etion Date: 3-31-andoned: 1-12-93	ertinent details, and give pertinent dates, including estimated date of st depths for all markers and zones pertinent to this work.)* Intention to plug and abandon a ter 72 g to 5388. Pmpd 2 sxs hulls + 25	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form, arting any proposed work. If well is directionally drilled. Imporarily abandon well. SXS cmt plug @ 5188-5388.
Describe Proposed or Compgive subsurface location Subsequent report Original Complete Plugged and Aba Plugging Method TOH w/tbg to 50 tbg to 2000.	ort of Notice of interest of the street of t	rtinent details, and give pertinent dates, including estimated date of state depths for all markers and zones pertinent to this work.)* ntention to plug and abandon a ter 72 g to 5388. Pmpd 2 sxs hulls + 25 Shot 5 1/2 csg @ 2216. Rec 68 jt om 2200-2100, 50 sxs cmt from 1530	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form, arting any proposed work. If well is directionally drilled, mporarily abandon well. sxs cmt plug @ 5188-5388. ts 5 1/2 csg. TIH w/1 1/4 0-1430, 35 sxs cmt from
Describe Proposed or Compagive subsurface location Subsequent report Original Complete Plugged and Abar Plugging Method TOH w/tbg to 50 tbg to 2000. It	ort of Notice of interest of interest of Notice of interest of int	g to 5388. Pmpd 2 sxs hulls + 25 Shot 5 1/2 csg @ 2216. Rec 68 jt om 2200-2100, 50 sxs cmt from 1530 Cut off csg & capped 8 5/8 csg 3	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form, arting any proposed work. If well is directionally drilled, mporarily abandon well. sxs cmt plug @ 5188-5388. ts 5 1/2 csg. TIH w/1 1/4 0-1430, 35 sxs cmt from
Describe Proposed or Compagive subsurface location Subsequent report Original Complete Plugged and Abar Plugging Method TOH w/tbg to 50 tbg to 2000. 10 700-600, 10 sxs	ort of Notice of interest of interest of Notice of interest of int	rtinent details, and give pertinent dates, including estimated date of state depths for all markers and zones pertinent to this work.)* ntention to plug and abandon a ter 72 g to 5388. Pmpd 2 sxs hulls + 25 Shot 5 1/2 csg @ 2216. Rec 68 jt om 2200-2100, 50 sxs cmt from 1530	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form, arting any proposed work. If well is directionally drilled, mporarily abandon well. sxs cmt plug @ 5188-5388. ts 5 1/2 csg. TIH w/1 1/4 0-1430, 35 sxs cmt from
Describe Proposed or Compagive subsurface location Subsequent report Original Complete Plugged and Abar Plugging Method TOH w/tbg to 50 tbg to 2000. It 700-600, 10 sxs	ort of Notice of interest of interest of Notice of interest of int	g to 5388. Pmpd 2 sxs hulls + 25 Shot 5 1/2 csg @ 2216. Rec 68 jt om 2200-2100, 50 sxs cmt from 1530 Cut off csg & capped 8 5/8 csg 3	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form, arting any proposed work. If well is directionally drilled. Imporarily abandon well. sxs cmt plug @ 5188-5388. ts 5 1/2 csg. TIH w/1 1/4 0-1430, 35 sxs cmt from below ground level.
Describe Proposed or Compagive subsurface location Subsequent report Original Complete Plugged and Abar Plugging Method TOH w/tbg to 50 tbg to 2000. 10 700-600, 10 sxs	ort of Notice of interest of interest of Notice of interest of int	g to 5388. Pmpd 2 sxs hulls + 25 Shot 5 1/2 csg @ 2216. Rec 68 jt om 2200-2100, 50 sxs cmt from 1530 Cut off csg & capped 8 5/8 csg 3	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form, arting any proposed work. If well is directionally drilled. Imporarily abandon well. sxs cmt plug @ 5188-5388. ts 5 1/2 csg. TIH w/1 1/4 0-1430, 35 sxs cmt from below ground level.
Describe Proposed or Compagive subsurface location Subsequent report Original Complete Plugged and Abar Plugging Method TOH w/tbg to 5 tbg to 2000. It to 2000.	ort of Notice of inetion Date: 3-31-andoned: 1-12-93 d: TIH W/1 1/4 tb 100. Circ w/mud. Pmpd 30 sxs cmt fr s cmt from 40-3'. d. Restore locati	g to 5388. Pmpd 2 sxs hulls + 25 Shot 5 1/2 csg @ 2216. Rec 68 ji om 2200-2100, 50 sxs cmt from 1530 Cut off csg & capped 8 5/8 csg 3 on to USFS specifications.	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form, arting any proposed work. If well is directionally drilled. Imporarily abandon well. sxs cmt plug @ 5188-5388. ts 5 1/2 csg. TIH w/1 1/4 0-1430, 35 sxs cmt from below ground level.
Describe Proposed or Compagive subsurface location Subsequent report Original Complete Plugged and Abar Plugging Method TOH w/tbg to 5 tbg to 2000. It to 2000.	ort of Notice of interest of interest of Notice of interest of int	g to 5388. Pmpd 2 sxs hulls + 25 Shot 5 1/2 csg @ 2216. Rec 68 ji om 2200-2100, 50 sxs cmt from 1530 Cut off csg & capped 8 5/8 csg 3 on to USFS specifications.	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form, arting any proposed work. If well is directionally drilled. Imporarily abandon well. sxs cmt plug @ 5188-5388. ts 5 1/2 csg. TIH w/1 1/4 0-1430, 35 sxs cmt from below ground level.
Describe Proposed or Compagive subsurface location Subsequent report Original Complete Plugged and Abar Plugging Method TOH w/tbg to 5 tbg to 2000. It to 2000.	ort of Notice of inetion Date: 3-31-andoned: 1-12-93 d: TIH W/1 1/4 tb 100. Circ w/mud. Pmpd 30 sxs cmt fr s cmt from 40-3'. d. Restore locati	g to 5388. Pmpd 2 sxs hulls + 25 Shot 5 1/2 csg @ 2216. Rec 68 ji om 2200-2100, 50 sxs cmt from 1530 Cut off csg & capped 8 5/8 csg 3 on to USFS specifications.	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form, arting any proposed work. If well is directionally drilled, mporarily abandon well. sxs cmt plug @ 5188-5388. ts 5 1/2 csg. TIH w/1 1/4 0-1430, 35 sxs cmt from
Describe Proposed or Compagive subsurface location Subsequent report Original Complete Plugged and Abar Plugging Method TOH w/tbg to 5 tbg to 2000. It to 2000.	ort of Notice of inetion Date: 3-31-andoned: 1-12-93 d: TIH W/1 1/4 tb 100. Circ w/mud. Pmpd 30 sxs cmt fr s cmt from 40-3'. d. Restore locati	g to 5388. Pmpd 2 sxs hulls + 25 Shot 5 1/2 csg @ 2216. Rec 68 ji om 2200-2100, 50 sxs cmt from 1530 Cut off csg & capped 8 5/8 csg 3 on to USFS specifications.	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form arting any proposed work. If well is directionally drilled. Imporarily abandon well. sxs cmt plug @ 5188-5388. ts 5 1/2 csg. TIH w/1 1/4 0-1430, 35 sxs cmt from below ground level. STATE CONSELLED
Describe Proposed or Compgive subsurface location Subsequent report Original Complete Plugged and Abar Plugging Method TOH w/tbg to 5 tbg to 2000. It will be to 2000.	ort of Notice of interior Date: 3-31-andoned: 1-12-93 d: TIH W/1 1/4 tb 100. Circ w/mud. Pmpd 30 sxs cmt from 40-3'. d. Restore locati	g to 5388. Pmpd 2 sxs hulls + 25 Shot 5 1/2 csg @ 2216. Rec 68 ji om 2200-2100, 50 sxs cmt from 1530 Cut off csg & capped 8 5/8 csg 3 on to USFS specifications.	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form, arting any proposed work. If well is directionally drilled. Imporarily abandon well. sxs cmt plug @ 5188-5388. ts 5 1/2 csg. TIH w/1 1/4 0-1430, 35 sxs cmt from below ground level. STATE CONSCENCE.
Describe Proposed or Compagive subsurface location Subsequent report Original Complete Plugged and Abare Plugging Method TOH w/tbg to 5 tbg to 2000. It is seen to 200	ort of Notice of interior Date: 3-31-andoned: 1-12-93 d: TIH W/1 1/4 tb 100. Circ w/mud. Pmpd 30 sxs cmt from 40-3'. d. Restore locati	g to 5388. Pmpd 2 sxs hulls + 25 Shot 5 1/2 csg @ 2216. Rec 68 ji om 2200-2100, 50 sxs cmt from 1530 Cut off csg & capped 8 5/8 csg 3 on to USFS specifications.	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form, arting any proposed work. If well is directionally drilled. Imporarily abandon well. sxs cmt plug @ 5188-5388. ts 5 1/2 csg. TIH w/1 1/4 0-1430, 35 sxs cmt from below ground level.
Describe Proposed or Compagive subsurface location Subsequent report Original Complete Plugged and Abar Plugging Method TOH w/tbg to 5 tbg to 2000. It will be to 2	ort of Notice of interior of Notice of interior Date: 3-31-andoned: 1-12-93 d: TIH W/1 1/4 tb 100. Circ w/mud. Pmpd 30 sxs cmt from 40-3'. d. Restore location of the control of the cont	g to 5388. Pmpd 2 sxs hulls + 25 Shot 5 1/2 csg @ 2216. Rec 68 ji om 2200-2100, 50 sxs cmt from 1530 Cut off csg & capped 8 5/8 csg 3 on to USFS specifications.	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form, arting any proposed work. If well is directionally drilled. Imporarily abandon well. sxs cmt plug @ 5188-5388. ts 5 1/2 csg. TIH w/1 1/4 0-1430, 35 sxs cmt from below ground level. STATE CONSCENCE.
Describe Proposed or Compagive subsurface location Subsequent report Original Complete Plugged and Abardan Method and Abardan M	ort of Notice of inetion Date: 3-31- andoned: 1-12-93 d: TIH W/1 1/4 tb 100. Circ w/mud. Pmpd 30 sxs cmt fr s cmt from 40-3'. d. Restore locati Orporation Commiss Tesping is true and correct Williams State office use) SSD.) VIRGIL L. PAUL!	g to 5388. Pmpd 2 sxs hulls + 25 Shot 5 1/2 csg @ 2216. Rec 68 ji om 2200-2100, 50 sxs cmt from 1530 Cut off csg & capped 8 5/8 csg 3 on to USFS specifications.	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form, arting any proposed work. If well is directionally drilled. Imporarily abandon well. sxs cmt plug @ 5188-5388. ts 5 1/2 csg. TIH w/1 1/4 0-1430, 35 sxs cmt from below ground level. STATE CONSCENCE.

stions as to any matter within its jurisdiction.