frage 1 - P		TYPE OR PRINT NOTICE: Fill out <u>complete</u> :			•		1-1
•			to Cons. Div.		SESSWENW Ft. from 5 Section Line		
	•		1017	w days.	 	Ft. from	E Section Line
LEASE OPERATOR Berexco, Inc.					SEC3	O TWP 188 RG	E. 11W (E) or (W)
ADDRESS Box 7	RESS Box 723 Hays, Kansas 67601				· COUNTY	Barton	
PHONE/(785 628 6	5101 OPERATORS	LICENSE	но	5363	. Date W	eli Camplete	3-22-57
Character of Well	oil			•	Pluggl	ng Commenced	9/19/2000
(OII, Gas, O&A, S)	10, input, Water :	Supply We	11)		Pluggi	ng Completed	9/19/2000
The plugging propo	osal was approved	on	· · · · · · · · · ·	9/19			(date)
	Jay Pfeifer						 Ngent's Name).
•		la vall					
Is ACO-1 filed7			_	_			3460
Producing Formatio	on	Oept	h to T	op	Bot	to≡ <u>`</u> T.	.0
Show depth and thi	ckness of all van	ter, oll	and ga	s formati	ans.	•	
OIL, GAS OR WATER	RECORDS			· · ·	ASING REC	ORD	<u> </u>
Formation	Content	From	То	}	1	Pulled out	
	Surface			8 5/8			
	l Casing	_[0	3459	1 . 5 4 ·	1	•	
escribe in detail	. Casing	ich the	3459	s plugge	d, indicat	ting where th	e mud fluid
Shot 2 holes	the manner in whathed or methods when the character of each at 1450' and with 200# hulls	iich the iised in iic or same ii d 675'.	ntroducend de Ran 2	as plugge cing it i pth plac 3/8 opener	d, Indicat nto the ho ed, from nd tbf. to	feet to	t or other pl fee: each so 70 sk 60/40 0° gel with
siaced and the me very used, state Shot 2 holes pos, 10% gel 200# hulls:	the manner in whithout or methods with character of each at 1450' and with 200# hulls	d 675'.	ntroducind de Ran 2	as plugge cing it i pth plac 3/8 opener 2000'	d, Indicat nto the ho sei, from nd tbf to Mix 90 ck	3000' Mix 60/40 pes, 1	t or other pl fee: each so 70 sk 60/40 0% gel with g. The to 5½
Shot 2 holes pos, 10% gel 200# hulls: Circ. cement to 500#. Sh	the manner in whathod or methods we the character of each at 1450' and with 200# hulls cire. cement to surface perwant in at 400#.	d 675'. Pull + surface.	reli wantroducind de Ran 2 mbg. ± between 3	as plugge cing it i pth place 3/8 opened con 2/3/8 con 2	d, Indicated the hole of from the hole of	3000' Mix 60/40 pos, 1 Pull tubin 1. Snut in 8	t or other pl fee: each se 70 sk 60/40 0° gel with g. Tie to 52 5/8. Press.
Shot 2 holes pos, 102 gel 200# hulls: Circ. cement to 500#. Sh	the manner in whathod or methods we the character of each at 1450' and with 200# hulls cire. cement to surface perwant in at 400#.	d 675'. Pull + surface.	reli wantroducind de Ran 2 mbg. ± between 3	as plugge cing it i pth place 3/8 opened con 2/3/8 con 2	d, Indicated the hole of from the hole of	3000' Mix 60/40 pos, 1 Pull tubin 1. Snut in 8	t or other plets: each set 70 sk 60/40 % gel with g. Tie to 51 5/8. Press.
Shot 2 holes Pos. 10% gel 200# hulls: Circ. cement to 500#. Sh	the manner in whathod or methods we the character of each at 1450' and with 200# hulls cire. cement to surface perwant in at 400#.	d 675'. Pull + surface. een o 5/8	reli wantroducind de Ran 2 mbg. ± between 3	as plugge cing it i pth place 3/8 opened con 2/3/8 con 2	d, Indicated the hole of from the hole of	3000' Mix 60/40 pos, 1 Pull tubin 1. Shut in 8 STATE CORPOR	t or other pl fee: each so 70 sk 60/40 0% gel with g. Tie to 5½ 5/8. Press. CFB369
Shot 2 holes Pos. 10% gel 200# halls: Circ. cement to 500#. Sh	the manner in whathed or methods we the character of each at 1450' and with 200# hulls cire. cement to to surface perwant in at 400#. Contractor 723: Havs, Kansa	d 675'. pull + surface. een 6 5/8 Berex	well wantroducing de Ran 2 mbg + between 3 co, In	as plugge cing it i pth place 3/8 opened con 2/3/8 con 2	d, Indicate nto the holes, from nd tbf. to Mix 90 ck. and 5½ csy 0 sk. tota	3000' Mix 60/40 pos, 1 Pull tubin 1. Shut in 8 STATE CORPOR	t or other plets: each set 70 sk 60/40 % gel with g. Tie to 51 5/8. Press.
Shot 2 holes Pos. 10% gel 200# halls: Circ. cement to 500#. Sh	the manner in whethod or methods we the character of each at 1450' and with 200# hulls cire. cement to to surface petwort in at 400#. Contractor 723: Havs. Kansa	d 675'. pull + surface. een 6 5/8 Berex	well wantroducing de Ran 2 mbg + between 3 co, In	as plugge cing it i pth place 3/8 opened 2000' den 2 3/8 opened 2 mix 50	d, Indicate nto the holes, from nd tbf. to Mix 90 ck. and 5½ csy 0 sk. tota	3000' Mix 3000' Mix 60/40 Pos, 1 Full tubin I. Snut in 8 STATE CORPOR	t or other plants of the control of
POS. 10% gol 200# halls: Circ. cement to 500#. Sh Name of Plugging C Address Box NAME OF PARTY RESP	the manner in whethod or methods we the character of each at 1450' and with 200# hulls cire. cement to to surface petwort in at 400#. Contractor 723: Havs. Kansa	d 675' pull + surface. een 6 5/8 Berex s 67601	well wantroducing de Ran 2 mbg + between 3 co, In	as plugge cing it i pth place 3/8 opener c 2000' cm 2 3/8 c Mix 50	d, Indicate nto the holes, from nd tbf. to Mix 90 ck. and 5½ csy 0 sk. tota	3000' Mix 3000' Mix 60/40 pos, 1 Full tubin 1. Snut in 8 Vicense MARE STATE CORPOR	t or other process for sk 60/40 % gel with g. The to 5 5/8. Press CFR/69 AATION COMMISSION 2 5 2000

STATE CORPORATION COMMISSION