

Date 1-22-01

() New Situation
() Response to Request

Operator Chesapeake Oper # 32334

1250' () Follow-up
1250' PUL

Address P.O. Box 18496

Location NW, Sec 22, T 21 S, R 40 W

Oklahoma City, OK 73154

Lease Doerr Well # 2-22 3-22

Phone No. _____
Oper. _____ Other _____

County Hamilton

Reason for Investigation: Log-Tech of Kansas can Bond Log well
didn't circulate to surface.

Problem: cmf didn't circulate on AIT II well

Person(s) Contacted: _____

Findings: TOC @ 730'

RECEIVED
STATE CORPORATION COMMISSION

FEB 21 2001

photos taken: _____

Action/Recommendations: Cement from 730' to surface

- () Lease Inspection
- () Complaint
- Field Report

By Kevin O Strube
PIAT II

Retain 1 copy Joint District Office
Send one copy Conservation Division

Date 2-2-01

- New Situation
- Response to Request
- Follow-up

Operator Chesapeake Oper. # _____

Address _____

Location NW, Sec 22, T 2, S, R 40W

Lease Doerr Well # 2-2 3-22

Phone No. _____
Oper. _____ Other _____

County Hamilton

Reason for Investigation: ALT II completion

Problem: _____

Person(s) Contacted: _____

Findings: Ran Bond Log on 1-22-01 and found top of cement @ 730' on 2-1-01 Log-Tech of Kansas, perforated @ 630' + set cement retainer @ 580' (2-2-01) Superior ~~Service~~ Servicing Ran tubing in hole w/ stringer for cement retainer, Allied cementing pump 6 sx gel + 180 sx cement circulated to surface,

Started @ 10:30 Finished @ 1:30 photos taken: _____

Action/Recommendations: Type CMT Class A 2% CC, 5# gilsonite 1/4# flow seal

- Lease Inspection
- Complaint
- Field Report

By Kevin D Strube
PIRT II

Retain 1 copy Joint District Office
Send one copy Conservation Division