



TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 43542 16036

Well Name & No. Ginther A #1 BY: _____ Test No. 1 Date 7-15-11
Company John C. Ginther Elevation 2180 KB 2172 GL _____
Address 2719 Ash Street, Hays, KS. 67601
Co. Rep / Geo. Marc Downing Rig Discovery #3
Location: Sec. 29 Twp. 12s Rge. 20w Co. Ellis State KS

Interval Tested 3487-3514 Zone Tested 'C'
Anchor Length 27' Drill Pipe Run 3454 Mud Wt. 8.7
Top Packer Depth 3482 Drill Collars Run 30 Vis 59
Bottom Packer Depth 3487 Wt. Pipe Run 0 WL 8.8
Total Depth 3514 Chlorides 2100 ppm System LCM 4#

Blow Description IFP - Weak Blow, Built to 1 1/2"
ISI - Dead
FFP - Weak Blow, Built to 1/2"
FSI - Dead

Rec	Feet of	%gas	%oil	%water	%mud
<u>50</u>	<u>Gassy Mud (odor)</u>				
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud


Rec Total 50' BHT 110° Gravity _____ API RW _____ @ _____ °F Chlorides _____ ppm
(A) Initial Hydrostatic 1641 ☒ Test 1125" T-On Location 22:45
(B) First Initial Flow 11 ☐ Jars _____ T-Started 23:39
(C) First Final Flow 29 ☐ Safety Joint _____ T-Open 1:45
(D) Initial Shut-In 819 ☐ Circ Sub _____ T-Pulled 4:15
(E) Second Initial Flow 31 ☐ Hourly Standby _____ T-Out 6:15
(F) Second Final Flow 34 ☒ Mileage 40 RT 56" Comments _____
(G) Final Shut-In 725 ☐ Sampler _____
(H) Final Hydrostatic 1616 ☐ Straddle _____

Initial Open 45 ☐ Ruined Shale Packer _____
Initial Shut-In 45 ☐ Ruined Packer _____
Final Flow 30 ☐ Extra Packer _____
Final Shut-In 30 ☐ Extra Recorder _____
☐ Day Standby _____ Sub Total _____
☐ Accessibility _____ Total 1181"
Sub Total 1181" MP/DST Disc't _____

Approved By _____

Our Representative Jana Mc Lennan

Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

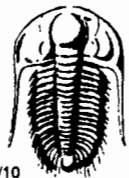

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 43543

JUL 18 2011

Well Name & No. Ginther A #1 Test No. 2 Date 7-17-11
 Company John C. Ginther Elevation 2180 KB 2172 GL
 Address 2719 Ash Street, Hays, KS. 67601
 Co. Rep / Geo. Marc Downing Rig Discovery #3
 Location: Sec. 29 Twp. 12s Rge. 20w Co. Ellis State KS

Interval Tested 3767-3791 Zone Tested Marmaton
 Anchor Length 24' Drill Pipe Run _____ Mud Wt. 8.8
 Top Packer Depth 3762 Drill Collars Run 30 Vis 50
 Bottom Packer Depth 3767 Wt. Pipe Run 0 WL 10.4
 Total Depth 3791 Chlorides 4300 ppm System LCM 2#
 Blow Description IFP-Weak Blow, Built to 4"
ISI-Dead
FFP-Weak Blow, Built to 5"
FSI-Dead

Rec	Feet of	%gas	%oil	%water	%mud
<u>55</u>	<u>Free Oil</u>				
<u>10</u>	<u>MCO</u>		<u>60</u>		<u>40</u>
	<u>60 GIP</u>				

Rec Total 65 BHT _____ Gravity 37 API RW _____ @ _____ °F Chlorides _____ ppm

(A) Initial Hydrostatic 1833
 (B) First Initial Flow 12
 (C) First Final Flow 28
 (D) Initial Shut-In 832
 (E) Second Initial Flow 25
 (F) Second Final Flow 36
 (G) Final Shut-In 814
 (H) Final Hydrostatic 1763

☒ Test 1125
☐ Jars _____
☐ Safety Joint _____
☐ Circ Sub _____
☐ Hourly Standby _____
☒ Mileage 40 RT 56
☐ Sampler _____
☐ Straddle _____
☐ Shale Packer _____
☐ Extra Packer _____
☐ Extra Recorder _____
☐ Day Standby _____
☐ Accessibility _____
 Sub Total _____

T-On Location 2:23
 T-Started 2:38
 T-Open 5:01
 T-Pulled 8:01
 T-Out 9:52
 Comments _____
☐ Ruined Shale Packer _____
☐ Ruined Packer _____
☐ Extra Copies _____
 Sub Total _____
 Total 1181
 MP/DST Disc't _____

Initial Open 45
 Initial Shut-In 45
 Final Flow 45
 Final Shut-In 45

Approved By _____

Our Representative

Jason M. Lomon Thank You

Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.