

Stanton

DX 78-1

KANSAS

Section 21 Township 30 Range 42W


Well No. #1 Hoopengartner

Company Huber Corp.

NORTH

WEST

EAST

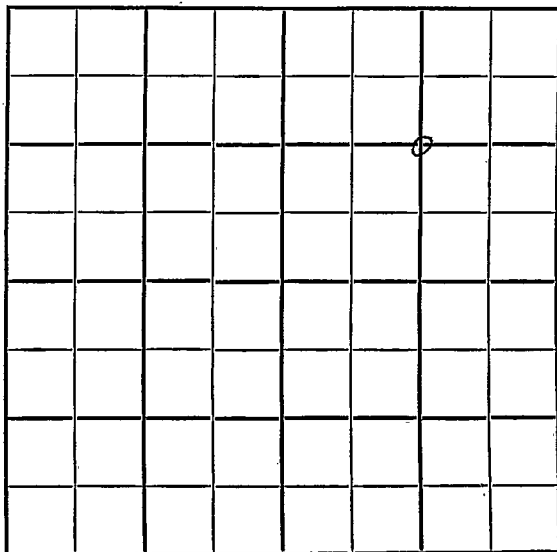

SOUTH

SEC. 1	TWP.	R.
21	30 S	42 W

WELL NO. _____

1 Hoopingarner

FARM

COMPANY

J. M. Huber Corp.

CONTRACTOR

Co. tools

Wildcat

1320 _____ Ft. from N. Line


Ft. from S. Line

1320 _____ Ft. from E. Line

Ft. from W. Line

C of NE 14.

MCPC \$4000.00 DHM

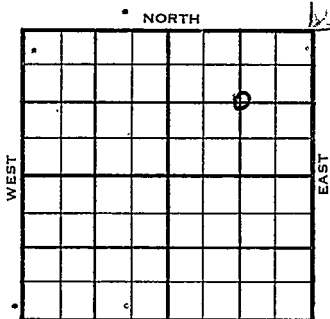

ELEVATION

1955 3518 DF 3514 REPORT
Gr

	To test Mississippi Lime approx 5500'
--	---------------------------------------

2/15	To commence not later than Mar.15,1955
	To complete not later than June 1,1955
3/4	RURT (Card-J.M. Huber)

3/7 Spud 3-5-55
Drig. 1060' (F.R. Ticket)"

3/8 Drlg. to 1230' & lost returns
about 4:30 P.M. yesterday.
Prep to spot cement this A.M.

3/9 Spotted 100 sacks cement at 1230'.
 . Waited 8 hrs. Cement filled up to
 1155'. Hole still taking mud.
 Spotted 100 sks cement at 1155'.
 Holding mud fairly well. Will
 probably drill ahead today. (Card-Huber)

3/10 Dry drilled to 1280'.
Still fighting circulation.

3/11 | Drlg. at 1493!.

3/14 TD 1528'. 8-5/8" @ 1526 w/1400
sacks. cement. WOT (Card-J.M. Huber)

3/15 Drlg. at 2111'. Set surface pipe
w/2200 sks cement instead of 1400.
as above. (Card-J.M. Huber)

1955

3/16 Drlg @ 2850' (Card - J.M. Huber)

3/17 Drlg. @ 2976' " "

3/18 Drlg. @ 3310' " "

3/21 Shut down @ 3806' for pump repairs.
(Card J.M. Huber)

3/22 Pump repaired. Preparing to
Drill ahead. (Card - J.M. Huber)

3/23 Drlg. 4016' " "

3/24 Lost circ. @ 4060'
Drlg. @ 4251' " "

3/24 Drlg. 4016' (Ltr-Gilstrap)

3/25 Tentative Sample tops: Winfield 2700',
Topeka 3260', Lansing 3560',
Had a drilling break at 4280'.
Drilling at 4520'. (Card-J.M. Huber)

3/28 Drlg. 5162'. Morrow Pay expected
around 5250'. (Wire-J.M. Huber)

3/29 Morrow shale 5000'
Morrow Sandy lime 5257-5300
Cored 5312-5362, rec 50' (5' black
rotten shale, 9' tite glauconitic
fine grained sand, 4' shale, 24'
sand, slight porosity & bottom 1'
having few bubbles of oil)
Tentative Top of Keyes Sand 5332'
Preparing to DST. (Card-J. M. Huber)

3/30 Core 3-29-55 had 32' sand instead
of 24'.
DST 5320- 5362' open 70 min, moderate
blow thruout, rec 200' very slightly
gas cut mud, 790' gas cut salt wtr.
FP 0-200# 15" BHP 1225#.
Drlg. at 5413' (Card-J.M. Huber)

3/31 Tentative T/Miss. St. Genevieve 5415'
Out of hole at 5489'. SD for weather.
(Card-J. M. Huber)

4/4 Drilled deeper to 5546'
Ran Electric Log. preparing to
DST.
Electric Log. Tops: Winfield 2700
Topeka 3172' Lansing 3474', Morrow
Shale 4996', Keyes Sd. 5332',
Miss 5411' (Card - J.M. Huber)

4/5 Attempted DST which failed.
Conditioned hole preparing to take
another DST. (Card- J.M. Huber)

1955

#1 Hoopingarner

4/6

Attempted DST 5367'-5382' failed to hold - no test.

Attempted DST 5367'-82', straddle test, hit a bridge going in the hole. Bypass tool was sprung open. Pkr failure.

DST, straddle test, 5369'-84',
opn $1\frac{1}{2}$ hrs, weak blow, rec. 140' SW
IFP 105#, FFP 105#, 20" BHP 1275#
Preparing to Plug & Abandon.

(Card - J.M. Huber)

4/7

Log Tops: Winf. 2700', Top 3172'
Lans 3474', Morrow sh. 4996',
Keyes Sd. 5332' Miss 5411'

4/14

D & A

(Sct, Ltr.)

4/13

Spud 3-5-55 D & A TD 5546
8" @ 1526 Lans 3560 Win 2700
Top 3260 Morrow 5257

DST 5320-62 open 70 min, rec 200'
VSGCM, 790' GCSW 1225#

Schl tops: Win. 2700', Top. 3172',
Lans. 3474', Morrow 4996',
Keyes sd 5332', Miss 5411',

DST 5367-82, failed.

DST 5367-82, failed.

DST 5369-84 open $1\frac{1}{2}$ hr rec 140' SW
1275# TD 5546' D & A

ABANDONED


4/27

Electric Log

Drillers log

Plugging record (All given Miss Morrow

FABEN GILSTRAP

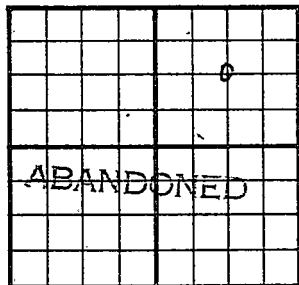County Stanton State KansasSec. 21 (Blk.
Twp.) 30 (Sur.
Rge.) 42W Map No.Operator Huber Corp.Well No. 1 Farm HoopengarnerElev. 3518 Location C NE/41320 Ft. From N Line NE1320 Ft. From E Line Quarter1st. ReportCompletion. APR 13 1955Remarks WildcatCo. toolsSpudding Date 3-5-55Drilg. Data D & A TD 55468" @ 1526 Lans. 3560 Win. 2700Top. 3260 Morrow 5257 DST 5320-62open 70 min. Rec. 200' vsgcm 790'gcsw 1225# SCHLUMBERGER TOPS:Win. 2700 Top. 3172 Lans. 3474Morrow 4996 Keyes sd. 5332 Miss. 5411DST 5367-82 failed DST 5367-82 failedDST 5369-84 open 1½ hr. Rec. 140' sw1275# TD 5546D & A

FABEN GILSTRAP