15-039-20136-00-00


STATE OF KANSAS
STATE CORPORATION COMMISSION

Form CP-4

Give All Information Completely
Make Required Affidavit
Mail or Deliver Report to:
Conservation Division
State Corporation Commission
212 No. Market
Wichita, Kansas 67202

WELL PLUGGING RECORD

NORTH

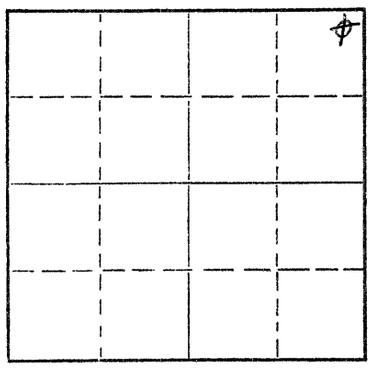

Locate well correctly on above Section Plat

Decatur County. Sec. 20 Twp. 5S Rge. 27W (E) (W)

Location as "NE/CNW¼SW¼" or footage from lines NE NE NE

Lease Owner Quintin Little

Lease Name Robben Well No. 1

Office Address Box 1509, Ardmore, Okla. 73401

Character of Well (completed as Oil, Gas or Dry Hole) dry hole

Date well completed February 1, 19 70

Application for plugging filed February 1, 19 70

Application for plugging approved February 1, 19 70

Plugging commenced February 1, 19 70

Plugging completed February 1, 19 70

Reason for abandonment of well or producing formation Dry hole 1,

If a producing well is abandoned, date of last production 19

Was permission obtained from the Conservation Division or its agents before plugging was commenced? yes

Name of Conservation Agent who supervised plugging of this well Mr. W. L. Nichols

Producing formation Depth to top Bottom Total Depth of Well 4608 Feet

Show depth and thickness of all water, oil and gas formations.

OIL, GAS OR WATER RECORDS 2-9-70 CASING RECORD

FORMATION	CONTENT	FROM	TO	SIZE	PUT IN	PULLED OUT
Fresh wtr. Sands & Shale	Water	0	230	8-5/8"	256.58	none
Cedar Hills	Water	2177	2299			
Heavner Sh.		3866	3869			
Kansas City lm.	Water	3909	4119			

RECEIVED
STATE CORPORATION COMMISSION
FEB 9 1970
CONSERVATION DIVISION
Wichita, Kansas

Describe in detail the manner in which the well was plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used, state the character of same and depth placed, from feet to feet for each plug set.

Well was logged by Welex Co.
Drill pipe was lowered into well to 1625' and hole was filled with good mud laden fluid. Halliburton Co. mixed, pumped and displaced 70 sax 50-50 Pozmix cement with 6% Gel added, placed cement plug from 1625' to 1289'. Drill pipe was pulled to 275' and hole was filled with good mud laden fluid. Halliburton mixed, pumped and displaced 25 sax 50-50 Pozmix cement with 6% Gel added and placed cement plug from 157' to 275'. Drill pipe was pulled to 40'. Hole was again filled with good mud laden fluid. Halliburton Co. mixed, pumped and displaced 10 sax cement and placed a cement plug from 0' to 40'. Job complete at 7:30 p.m. Feb. 1, 1970. Note: Surface pipe cut off 1 ft. below plow level of ground.

(If additional description is necessary, use BACK of this sheet)

Name of Plugging Contractor Halliburton Co.

Address Hill City, Kansas

STATE OF Oklahoma, COUNTY OF Carter, ss.

Glen D. Vanway (employee of owner) or (owner or operator) of the above-described well, being first duly sworn on oath, says: That I have knowledge of the facts, statements, and matters herein contained and the log of the above-described well as filed and that the same are true and correct. So help me God.

(Signature) Glen D. Vanway

Box 1509, Ardmore, Okla. 73401
(Address)

SUBSCRIBED AND SWORN TO before me this 6th day of February, 19 70

Jacque E. Kamhaus
Notary Public.

My commission expires Mar. 3, 1971