

697416

Date	Depth	
2/13/69	1180' 1201'	Drlg. split down blew fluid end
2/14/69	1201	out of pump
2/17/	3068	K.C. (-1734)
2/17/69	3059 3020	B.C. (-1725) corrected
2/18/69	3075'-93'	DST #1
		open 1 hr. good blow,
		Rec. 630' gas, 30' oil + gas cut mud
		60' Hvy oil + gas cut mud
		100' muddy gas oil
		80' muddy w/tr ^{In Dr. 11 Collars @} Temp 105
		ISBP 701# FSBP 545#
		IF 77#-FF 93# in 30 mins.
		3125 dly.
2/19/69	3300'	drlg.
2/20/69	3585'	drlg.
2/21/69	3693	top Miss (-2359)
		3' higher than #1
	3705'	Rotary total depth
		DST #2
2/21/	3695'- 3705'	open 1 hr steady
		blow throughout
		Rec. 3250' gas

State _____ County _____

Company _____ Well No. _____


Farm _____

Survey _____

Block No. _____ Sec. _____ Twp. _____ Range _____

Co-Ord. _____ Elev. _____

Oil Lease #3

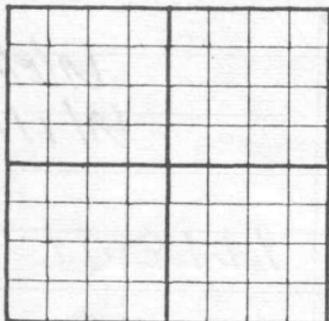

Page 2

NOTE: Show Sketch of Lease and Well Location in Above Space

Ft. from N. Line

Ft. from S. Line

Ft. from W. Line

Ft. from E. Line

Date	Depth	
		100' oil & gas cut mud
2/21/69		30' slightly oil & gas cut mud
		30' gassy oil
		Temp 116°
		Isbp 30 min 1274 #
		# #
		I.F.P. 38 - F.F.P. 62
		Isbp 857# still
		building —

Date	Depth	
2/22/	(D.S.T. #)	697416 3706-16
OPEN 1 hr, WK blow		
Rec. 235 gas, 5 sli		
oil & gas cut mud #		
ISIP 1116 # - FSIP 1227-(45")		
IF. 31 # FF 46 #		

RTD 3747, Ran Elect. Log.
 set 5 1/2 csg. @ 3746'
 225 ex Regular Cement
 2% Jell, 29# flo seal

2/23/69 Plug down @ 12¹⁵ AM

TD 3747

4/1/69

M.J.C.J. P.C. to Lubicon

4/2/69

Rig up & drill float shoe
 & Cement to 3733'
 Run correlation log +
 perf 3698' - 3706'
 4⁵ ft. - swab hole down
 dump 1 bbl. 15% acid +
 wtr. load - set overnight

could page 3

State _____ County _____

Company _____ Well No. _____


Farm _____

Survey _____

Block No. _____ Sec. _____ Twp. _____ Range _____

Co-Ord. _____ Elev. _____

Oil Lease #3

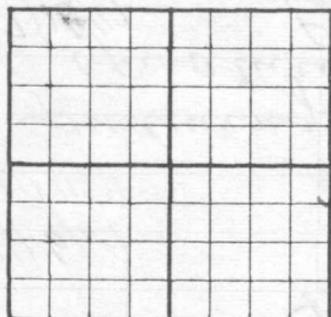

Page 3

NOTE: Show Sketch of Lease and Well Location in Above Space

Ft. from N. Line

Ft. from S. Line

Ft. from W. Line

Ft. from E. Line

Date	Depth	
4/3/69		swab hole down - 60 gal. oil fillup overnight Acidize w/500 gal - max. Press. 150#. On vacuum in 5" - swab hole down 1st hr. 9 bbl - 20% wtr.
4/4/69		2000 gal acid swab down set overnight
4/5/69		filled up overnight 1700' fluid

697416

Date	Depth	
		swab down to 50 ffls.
		fluid 40% water
1 hr.		8.35 ffls. fluid 40% oil.
2nd hr.		" " " "
3rd hr.		" " " "
4th hr.		6.68 ffls fluid 40% oil
		est 2 1/2 ffls oil per hr.
		+ 3 1/2 ffls wte @ hr.
4/7/69		run tubing + rods to
		pop. (put on pump)
4/16/69		1st day 22 ffls oil
		2nd day 30 ffls oil
		3rd day 30 ffls oil
		4th day 30 ffls oil
4/16/69		27.70 ffls oil
4/17/69		24.93 ffls oil 30% water
		producing enough gas to
		operate entire unit.
7/14/69		Perf. 20 Holes-3073-3078
7/15/		treat w/ 1000 gals acid-