

Tucker
LEASE

#1
WELL NO.

#1
TEST NO.


Coronado Oil Company
COMPANY

Kansas
DISTRICT



LOCATION	20-30s-15w		Date June 24, 1951 Ticket No. 5801-T HOWCO District Pratt, Kansas Kind of Job Open Hole Test Price \$215.00 Second Packer Assembly -- Safety Joint -- Extra Folder Charge -- Jars --
FIELD	Wildcat		
COUNTY	Barber		
STATE	Kansas		
CONTRACTOR	Warren and Bradshaw		Kind of Job Open Hole Test Price \$215.00 Second Packer Assembly -- Safety Joint -- Extra Folder Charge -- Jars --
MUD DATA			
Kind	Starch		Kind of Job Open Hole Test Price \$215.00 Second Packer Assembly -- Safety Joint -- Extra Folder Charge -- Jars --
Weight	9.8	lbs.-gal.	
Viscosity	40	sec.	Kind of Job Open Hole Test Price \$215.00 Second Packer Assembly -- Safety Joint -- Extra Folder Charge -- Jars --
Filter Loss	10	c. c. Filter Cake 2/32 in.	
Bt. P.R.D. No.	272	Blanked Off No	Kind of Job Open Hole Test Price \$215.00 Second Packer Assembly -- Safety Joint -- Extra Folder Charge -- Jars --
Hr. Clock No.	917	12	
Est. Gauge Depth Temp.	100	°F	Kind of Job Open Hole Test Price \$215.00 Second Packer Assembly -- Safety Joint -- Extra Folder Charge -- Jars --
Pressure Readings	Field	Office Corrected	
Initial Hydro Mud Pressure	--	2290 p.s.i.	Kind of Job Open Hole Test Price \$215.00 Second Packer Assembly -- Safety Joint -- Extra Folder Charge -- Jars --
Initial Flow Pres.	--	18 p.s.i.	
Tool Open	1 hour		Kind of Job Open Hole Test Price \$215.00 Second Packer Assembly -- Safety Joint -- Extra Folder Charge -- Jars --
Final Flow Pres.	--	28 p.s.i.	
Time Closed In	15 minutes		Kind of Job Open Hole Test Price \$215.00 Second Packer Assembly -- Safety Joint -- Extra Folder Charge -- Jars --
Closed in Pres.	--	55 p.s.i.	
Final Hydro Mud Pressure	--	2253 p.s.i.	Kind of Job Open Hole Test Price \$215.00 Second Packer Assembly -- Safety Joint -- Extra Folder Charge -- Jars --
REMARKS: Opened tool at 6:20 A.M. with fair blow. Recovered 45' slight oil cut mud.			
Amount of Blanket None			Kind of Job Open Hole Test Price \$215.00 Second Packer Assembly -- Safety Joint -- Extra Folder Charge -- Jars --
All depths measured from Kelly Bushings			
No. Folders Reproduced Five.			

TIME

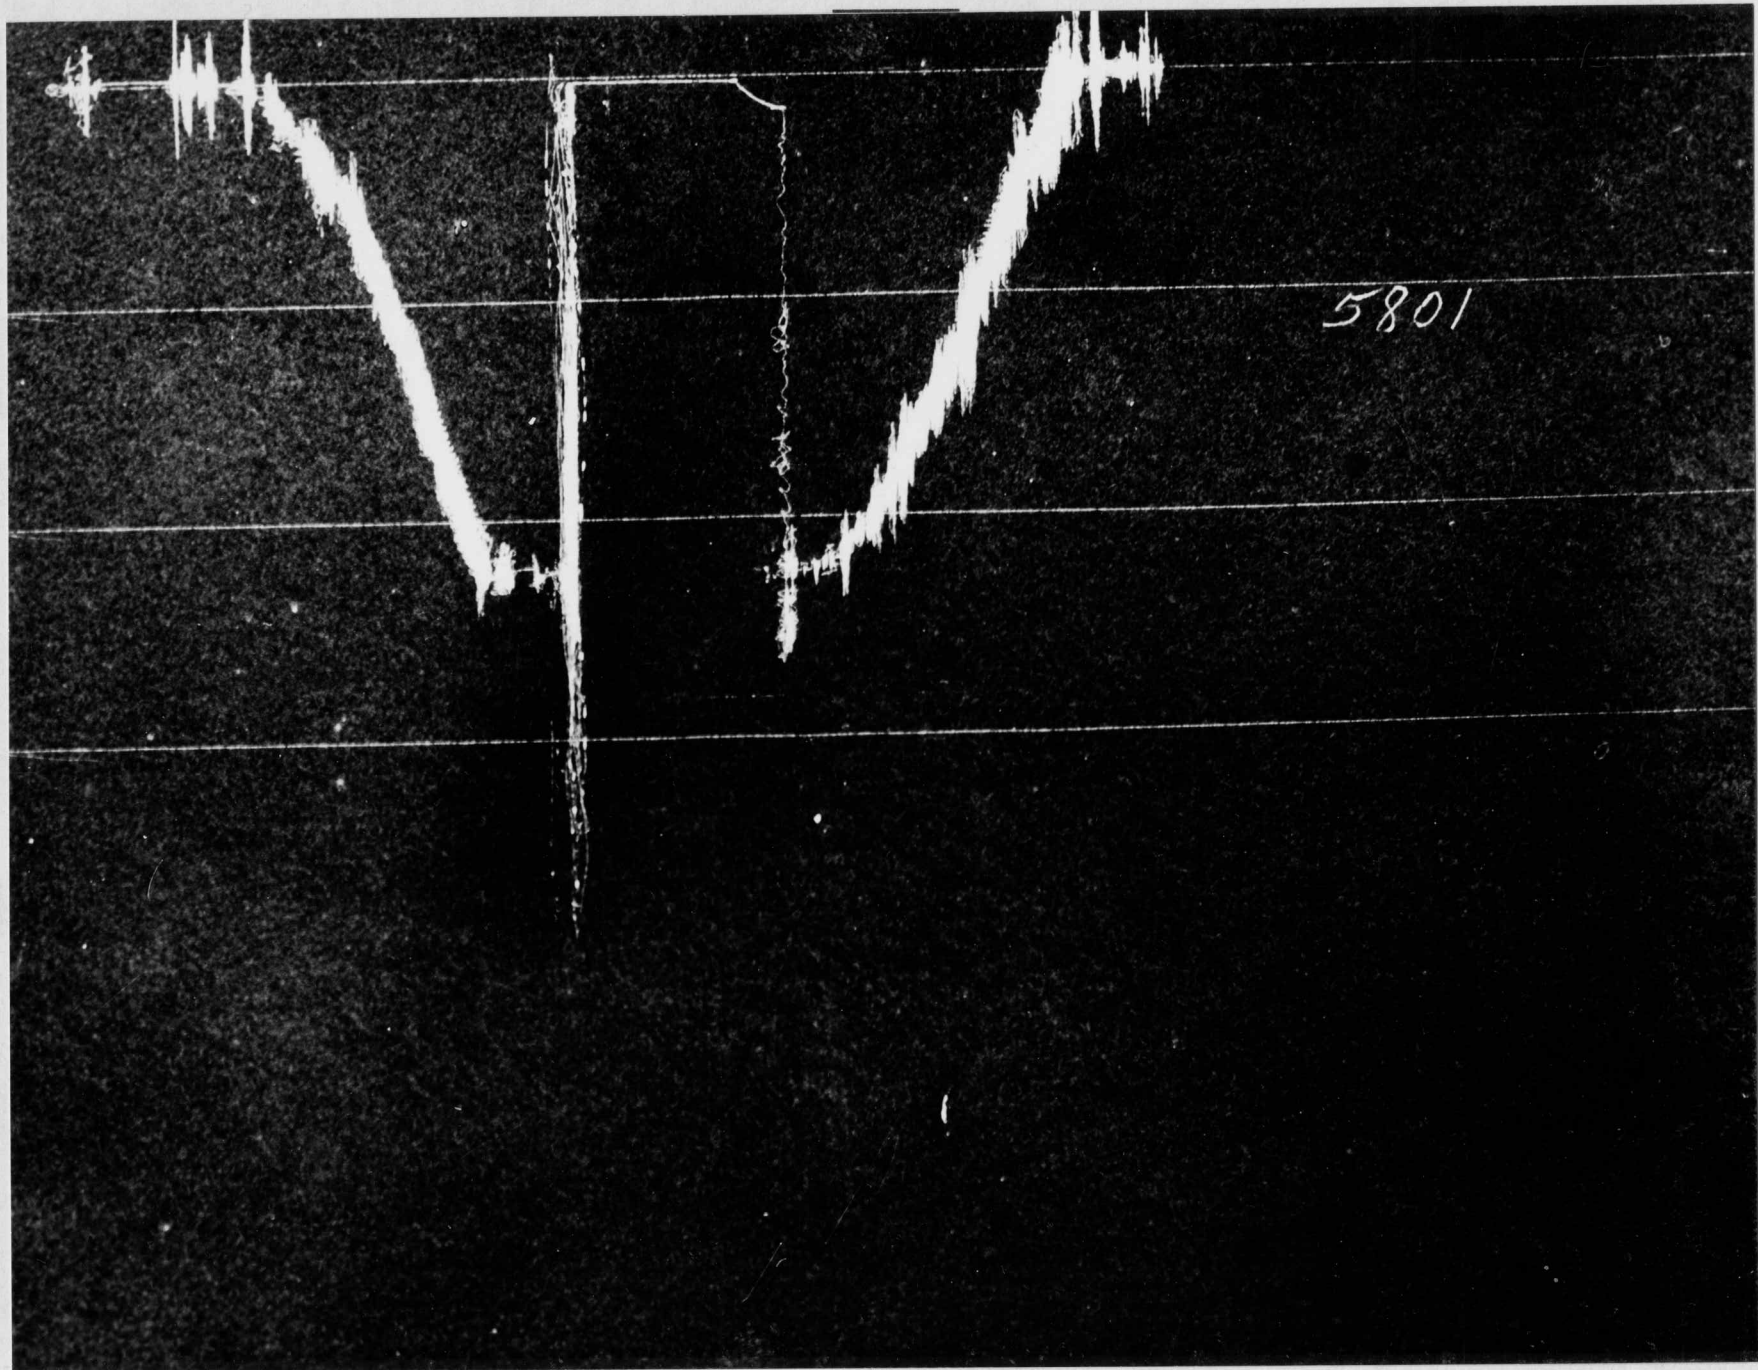

Each Horizontal Line Equal to 1000 p.s.i.

PRESSURE