


State Kansas Field Greenwood
 Company C.S.O. County Morton
 Farm Addington "A" No. 1
 Sec. 31 Twp. 32 Range 43
 Spot 330 N 1/2 of C (New loc: 330 N 1/2 660 E of C)
 Contractor Holm.
 Remarks ED 3300, amox, skelly, PEPL, 12-10
New spud 12-26-56
 Comm. 12-14-56 Comp. 1-30-57
 Elev. DF 3629 GL 3621 KB TD 3150 PB
 Pay 2958 - 3074

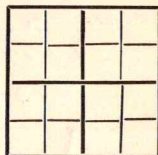

I.P. 15.800 MCF Press. 512.365
 Casing Record: 13 3/8" 7"
 20" 10 3/4" 5 1/2" 3139/400
 16" 8 5/8" 100/1400
1386/400

Loc	Sample	Log
DEC 19		Top 2916
LC 1160		
JAN 3 No recovery plug hole, skid rig. New loc: 330 N 1/2 660 E of C R.P. spud 12-26-56		
8 5/8" 1396/400		
2950 3042		
3139/400		
56		
JAN 9		
RTD 3150 ran log		
5 1/2" 3139/400		
MILT 10? PF 72/3056-74		
5.9. No water, A/2000 surrounding in		
JAN 16		
Swab in Bto B, 250 MCF + spray AW.		
100 PF 28/3011-18, 32/2996-3004, 44/2974-85, 28/295B-65, A/4000 + 100 balls to seal PF 3056-74, Swab in 12 in BD 9 9, 340 MCF, 5124 hrs, 5" OF 9 18, 300 MCF, 20" OF 9 15, 800 MCF, 2 in OF 9 12, 900 MCF, 5124 hrs		

2916

JAN 23

JAN 23

72/20" OF 15,800 MCF

SIP 365

PF/3056-74, 3011-18, 2996-3004,

2974-85, 2958-65 (Top.)

¢

AMARILLO TOPS

3621 GL

Topeka 2915 (#706)

TD 3621 (#477)