

3152-3173'

Dubois

Lease Name

1

Well No.

1

Test No.

Beacon Resources

Lease Owner

Wichita, Kansas

Owners District

LOCATION	Sec.27-T34-R32	FIELD	COUNTY	Seward	STATE	Kansas
----------	----------------	-------	--------	--------	-------	--------




BOMIN TESTING, INC.

BOX 782

LIBERAL, KANSAS 67901

FORMATION TESTING REPORT

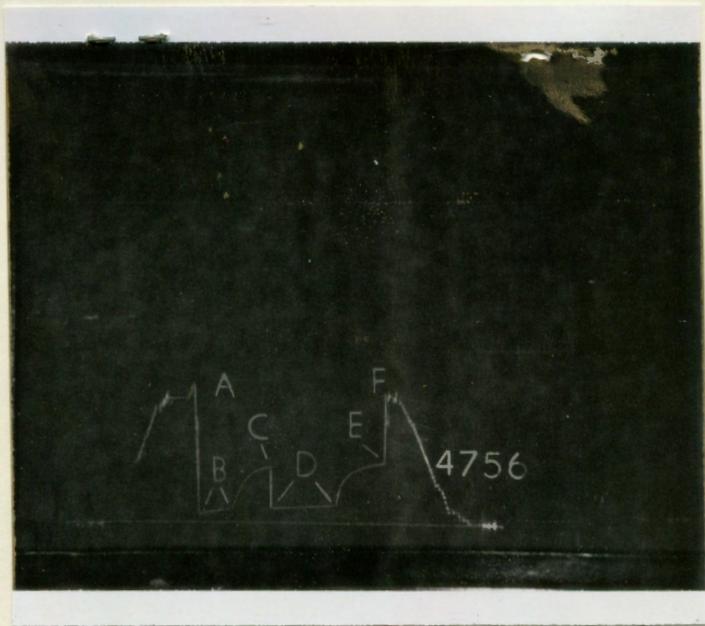

NOTATION
EXACT
TRUST

First Flow	30	Minutes	 BOMIN TESTING BOX 782 LIBERAL, KANSAS	Date	10-31-1969
First CIP	30	Minutes		Ticket No.	4756
Second Flow	60	Minutes		DISTRICT	Liberal, Kansas
Second CIP	45	Minutes		Kind of Job	Open Hole Test
Depth Top Gauge	3160	Ft.	Blanked Off	No	CONTRACTOR Sage Drlg. Co.
Recorder No.	2772		12	Hr. Clock	HOLE & TOOL DATA
Pressure Readings	Field		Office Corrected		Elevation 2742'
Initial Hydro Mud Pressure	A-1506		1516		Top Packer Depth 3152'
First Flow	B-110-154		108-152		Bottom Packer Depth
First CIP	C-660		664		Casing or Hole Size 77/8"
Second Flow	D-154-176		153-175		Size & Type Wall Packer 6 1/2" B.T.
Second CIP	E-686		689		Liner or Rathole Size
Final Hydro Mud Pressure	F-1495		1499		Size Bottom Choke 1/2"
Depth Bottom Gauge	3172	Ft.	Blanked Off	Yes	Interval Tested 3152'
Recorder No.	97		4	Hr. Clock	3173
Pressure Readings	Field		Office Corrected		Size Surface Choke 1"
Initial Hydro Mud Pressure					Formation Tested Uppr. Council Grove
First Flow					ID & Length Drill Collars 2 1/2" x 990'
First CIP					Est. Gauge Depth Temp. 97
Second Flow					Size Drill Pipe 4 1/2" F.H.
Second CIP					MUD DATA Weight 9.1
Final Hydro Mud Pressure					Viscosity 36
Recovered	1200	Feet of	All depths measured from K.B.		
Recovered	240	Feet of	No. Folders Reproduced 5		
Recovered	180	Feet of	REMARKS: Slid tool 16' to bottom.		
Recovered		Feet of	Received weak blow with slight		
Witnessed By	W.R. Atkinson				
Amount-Type of Cushion					
Tester	Tom Brown				

LOCATION Sec. 27-T34-R32

FIELD

COUNTY Seward

STATE Kansas

Lease Name Dubois

Well No. 1

Test No. 1

Lease Owner Beacon Resources

Owners District Wichita, Kansas

3152-3173'