

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 042608 15415

Well Name & No. Gosselin #30-1 Test No. 1 Date 4-9-11
 Company H+C Oil Operating INC Elevation 2158 KB 2150 GL
 Address PO BOX 860 Plainville KS 67463 +0086
 Co. Rep / Geo. Marc Downing Rig American Eagle #2
 Location: Sec. 30 Twp. 8 S Rge. 21 W Co. Graham State KS

Interval Tested 3486-3556 Zone Tested LKC-H-5
 Anchor Length 70 Drill Pipe Run 3490 Mud Wt. 9.5
 Top Packer Depth 3481 Drill Collars Run 0 Vis 52
 Bottom Packer Depth 3486 Wt. Pipe Run 0 WL 8.8
 Total Depth 3556 Chlorides 2800 ppm System LCM 2

Blow Description 1st-Weak Blow Built to 1/2 IN

1st-Dead NO Blow Back

2nd-Dead NO Blow

3rd-Dead NO Blow Back

Rec	Feet of	%gas	%oil	%water	%mud
<u>2</u>	<u>Mud with oil spots</u>				<u>100</u>
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud

Rec Total 2 BHT 107 Gravity _____ API RW _____ @ _____ °F Chlorides _____ ppm

(A) Initial Hydrostatic 1805

(B) First Initial Flow 36

(C) First Final Flow 35

(D) Initial Shut-In 91

(E) Second Initial Flow 37

(F) Second Final Flow 35

(G) Final Shut-In 60

(H) Final Hydrostatic 1780

Initial Open 30

Initial Shut-In 30

Final Flow 30

Final Shut-In 30

☒ Test 1125

☐ Jars

☐ Safety Joint

☐ Circ Sub

☐ Hourly Standby

☒ Mileage 1140 RT 145

☐ Sampler

☐ Straddle

☐ Shale Packer

☐ Extra Packer

☐ Extra Recorder

☐ Day Standby

☐ Accessibility

Sub Total 1270

T-On Location 19:30

T-Started 21:50

T-Open 00:00

T-Pulled 2:00

T-Out 4:23

Comments

☐ Ruined Shale Packer

☐ Ruined Packer

☐ Extra Copies

Sub Total 8


Total 1270

MP/DST Disc't

Approved By _____

Our Representative Jeff Brown

Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

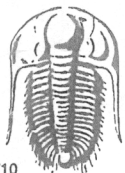

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 042609

4/10

APR 12 2011

Well Name & No. Gosselin #30-1 Test No. 2 Date 4-11-11
 Company H+C oil operating INC Elevation 2157 KB 2150 GL
 Address PO Box 86 Plainville KS 67663 + 0086
 Co. Rep / Geo. Marc Downing Rig American Eagle #2
 Location: Sec. 30 Twp. 8s Rge. 21W Co. Graham State KS

Interval Tested 3553-3582 Zone Tested LKC-K
 Anchor Length 26 29-Ancor - 204-Tail Drill Pipe Run 3552 Mud Wt. 9.9
 Top Packer Depth 3548 Drill Collars Run 0 Vis 59
 Bottom Packer Depth 3553 Wt. Pipe Run 0 WL 9.4
 Total Depth 3786 Chlorides 7300 ppm System LCM 2

Blow Description FFP-Fair Blow Built TO 4 1/4 IN
ISI-Dead NO Blow Back
FFP-Weak Blow Built TO 1 1/4 IN
FSI Dead NO Blow Back

Rec	Feet of	%gas	%oil	%water	%mud
<u>17</u>	<u>WM WITH A SCUM OF OIL</u>			<u>15</u>	<u>85</u>
<u>3</u>	<u>MO</u>		<u>95</u>		<u>5</u>

Rec Total 50 BHT 112 Gravity API RW 1.53 @ 68.3° F Chlorides 13000 ppm

(A) Initial Hydrostatic 1832 ☒ Test 1125 T-On Location 4:35
 (B) First Initial Flow 26 ☐ Jars 5:19
 (C) First Final Flow 28 ☐ Safety Joint 7:20
 (D) Initial Shut-In 905 ☐ Circ Sub 10:20
 (E) Second Initial Flow 34 ☐ Hourly Standby 12:27
 (F) Second Final Flow 40 ☒ Mileage 1140 RT 145 Comments
 (G) Final Shut-In 801 ☐ Sampler
 (H) Final Hydrostatic 1817 ☒ Straddle 600

Initial Open 45 ☐ Shale Packer ☐ Ruined Shale Packer
 Initial Shut-In 45 ☐ Extra Packer ☐ Ruined Packer
 Final Flow 45 ☐ Extra Recorder ☐ Extra Copies
 Final Shut-In 45 ☐ Day Standby ☐ Sub Total 0
 Sub Total 1870 ☐ Accessibility ☐ Total 1870
 MP/DST Disc't

Approved By _____ Our Representative Jeff Brown

Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.