

RECEIVED

Notice: Fill out COMPLETELY and return to Conservation Division at the address below within 60 days from plugging date.

KANSAS CORPORATION COMMISSION OIL & GAS CONSERVATION DIVISION

SEP 26 2005

Form CP-4 December 2003

WELL PLUGGING RECORD K.A.R. 82-3-117

KCC WICHITA

Type or Print on this Form Form must be Signed All blanks must be Filled

Lease Operator: Beredco
Address: Box 723 Hays KS 67601
Phone: (785) 628-6101 Operator License #: 5147
Type of Well: Oil Docket #:
The plugging proposal was approved on: 8-8-05
by: Case Morris (KCC District Agent's Name)
Is ACO-1 filed? Yes No
Producing Formation(s): List All (If needed attach another sheet)
Cong, L-KC, Platt Depth to Top: 2928 Bottom: 3306 T.D. 3306

API Number: 15 - 167-06026 100-00
Lease Name: Horace Fink
Well Number: 3
Spot Location (QQQQ): SW - SE - SE -
330 Feet from North / South Section Line
990 Feet from East / West Section Line
Sec. 16 Twp. 14 S. R. 14 East West
County: Russell
Date Well Completed: 7-21-47
Plugging Commenced: 8-8-05
Plugging Completed: 8-16-05

KCC
8-30-05
REDMS
CP 2/3

Show depth and thickness of all water, oil and gas formations.

Table with columns: Oil, Gas or Water Records (Formation, Content) and Casing Record (Surface Conductor & Production) (From, To, Size, Put In, Pulled Out). Rows include Platt, L-KC and Cong. formations.

Describe in detail the manner in which the well is plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug set.


Cut 7" casing loose from 10" surface pipe. Nipple 10" surface pipe to surface, Rig up 7" nipples-try to pull stretch in 7" casing parted 5' below ground level on a collar leaving pin looking up. Rig up 7" AD-1 pkr on 2 7/8 joint of tubing. Set pkr @ 25' - pull stretch - had 6" movement 0-40000 #. Start hole w/ 2 3/8 tubing to plug bottom of well. Run tubing to 3150 Rig up Allied Cementing Spot 75 sxs 60/40 poz 10% gel & 300# hulls. Pull tubing out of hole Rig up Perf Tech. Run 7" AD-1 w/ steel sheeve in place of shear ring. Got hold of 7" - pull 80000 into casing. Shot 7" @ 1980 didn't come free worked casing 0 to 70000. Rig up shot off 7" made shot @ 1675' - didn't come free Made shot @ 1546' - 7" came free. Pull 7" to 1510 spot 200 sxs 60/40 poz 10% gel w/ 300# hulls. pull 7" to 910', spot 25 sxs w/ 100# hulls Pull 7" to 610 spot 100 sxs w/ 100# hulls. Pull 7" to 190' circ cement to surface w/ 40 sxs. Pull 7" out of hole top surface pipe w/ 10 sxs well plugged.

Name of Plugging Contractor: Berexco License #: 5363
Address: Box 723 Hays KS 67601

Name of Party Responsible for Plugging Fees: Berexco Inc.
State of KS County, Russell, ss.

Dennis Kirmer (Employee of Operator) or (Operator) on above-described well, being first duly sworn on oath, says: That I have knowledge of the facts statements, and matters herein contained, and the log of the above-described well is as filed, and the same are true and correct, so help me God.

(Signature) Dennis Kirmer
(Address) Box 723 Hays KS 67601

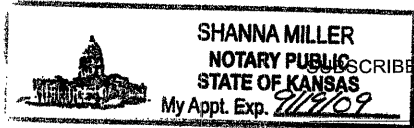

Subscribed and SWORN TO before me this 22 day of September, 2005
Shanna Miller My Commission Expires: 9/19/09
Notary Public

bm