

Notice: Fill out COMPLETELY and return to Conservation Division at the address below within 60 days from plugging date.

**KANSAS CORPORATION COMMISSION
OIL & GAS CONSERVATION DIVISION
WELL PLUGGING RECORD
K.A.R. 82-3-117**

RECEIVED
SEP 26 2005
KCC WICHITA
Form CP-4
December 2003
Type or Print on this Form
Form must be Signed
All blanks must be Filled

Lease Operator: Berexco
 Address: Box 723 Hays KS 67601
 Phone: (785) 628-6101 Operator License #: 5363
 Type of Well: Oil Docket #: _____
 (Oil, Gas D&A, SWD, ENHR, Water Supply Well, Cathodic, Other) (If SWD or ENHR)
 The plugging proposal was approved on: 8-1-05 (Date)
 by: Case Morris (KCC District Agent's Name)
 Is ACO-1 filed? Yes No If not, is well log attached? Yes No
 Producing Formation(s): List All (If needed attach another sheet)
L-KC ARB Depth to Top: 2919 Bottom: 3207 T.D. 3207
 _____ Depth to Top: _____ Bottom: _____ T.D. _____
 _____ Depth to Top: _____ Bottom: _____ T.D. _____

API Number: 15-167-02853-00-00
 Lease Name: Rusch
 Well Number: 2
 Spot Location (QQQQ): NE-SW-SE
990 Feet from North / South Section Line
1650 Feet from East / West Section Line
 Sec. 30 Twp. 14 S. R. 14 East West
 County: Russell
 Date Well Completed: 3-11-64
 Plugging Commenced: 8-2-05
 Plugging Completed: 8-4-05

*KCC
Ber
9-30-05
RBDMs
CP 2/3*

Show depth and thickness of all water, oil and gas formations.

Oil, Gas or Water Records		Casing Record (Surface Conductor & Production)				
Formation	Content	From	To	Size	Put In	Pulled Out
Tor L-KC	oil, water 2916-3186	0	610	8 5/8	3-11-64	-
ARB	oil, water 3203-3207	0	3203	5 1/2	3-11-64	
		0	1780	5 1/2		8-4-05

Describe in detail the manner in which the well is plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug set.


Ran tubing to 3150. Spot 50 sxs cement. PULL tubing. Shot off 5 1/2 casing at 1780. Pull casing to 1411; spot 100 sxs cement w/ 300# hulls. Pull casing to 820. Spot 40 sxs cement w/ 100# hulls. Pull casing to 360. Spot 30 sxs cement w/ 100 # hulls. Pull casing to 168. Circ cement to surface w/ 30 sxs. Pull casing out of hole. Top off surface w/ 20 sxs.

Name of Plugging Contractor: Berexco Company Tools License #: 5363 99998
 Address: Box 723 Hays KS 67601

Name of Party Responsible for Plugging Fees: Berexco, Inc.
 State of KS County, Ellis, ss.

Dennis Kirmer (Employee of Operator) or (Operator) on above-described well, being first duly sworn on oath, says: That I have knowledge of the facts statements, and matters herein contained, and the log of the above-described well is as filed, and the same are true and correct, so help me God.

(Signature) Dennis Kirmer
 (Address) Box 723 Hays KS 67601

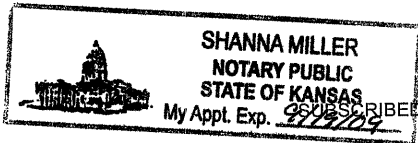

Subscribed and SWORN TO before me this 22 day of September, 2005
Shanna Miller My Commission Expires: 9/19/09
 Notary Public

Bur