

Notice: Fill out COMPLETELY and return to Conservation Division at the address below within 60 days from plugging date.

KANSAS CORPORATION COMMISSION
OIL & GAS CONSERVATION DIVISION
WELL PLUGGING RECORD
K.A.R. 82-3-117

Form CP-4
December 2003
Type or Print on this Form
Form must be Signed
All blanks must be Filled

Lease Operator: SunStone Operating Company, LLC
Address: 101 N. Robinson, Suite 810, Oklahoma City, OK 73102
Phone: (405) 605-1274 Operator License #: 33802
Type of Well: D&A Docket #: _____
(Oil, Gas D&A, SWD, ENHR, Water Supply Well, Cathodic, Other) (if SWD or ENHR)
The plugging proposal was approved on: _____ (Date)
by: Jim Holland (KCC District Agent's Name)
Is ACO-1 filed? Yes No If not, is well log attached? Yes No
Producing Formation(s): List All (if needed attach another sheet)

Depth to Top: _____ Bottom: _____ T.D. _____

Depth to Top: _____ Bottom: _____ T.D. _____

Depth to Top: _____ Bottom: _____ T.D. _____

API Number: 15 - 171-20592-0000
Lease Name: Schmidt Trust
Well Number: 10-1
Spot Location (QQQQ): 190'e of - NW - NE - NW
330 Feet from North / South Section Line
1840 Feet from East / West Section Line
Sec. 10 Twp. 19 S. R. 31 East West
County: Scott
Date Well Completed: _____
Plugging Commenced: 3/20/07
Plugging Completed: 3/20/07

KCC
PKT
3/28/07
Per
RBDMS

Show depth and thickness of all water, oil and gas formations.

Oil, Gas or Water Records		Casing Record (Surface Conductor & Production)				
Formation	Content	From	To	Size	Put In	Pulled Out
		Surface	330	10-3/4		n/a
		Surface	4393'	7-5/8"		n/a

Describe in detail the manner in which the well is plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug set.

Mix & pump 4382.78' plug with 50 sx cement & 400# hulls, displace POOH 70 jts to 2198.01', pumped 50 sx cement plug, POOH 16 jts to 1697.97', circulate hole with water, pumped 75 sx cement plug, balance plug. POOH 22 jts to 1007.14', pump 50 sx cement plug, balance plug. POOH 21 jts to 350.61', pump 50 sx cement plug, balance plug POOH 9 jts to 69.27', circulate cement to surface. RU to Surface annulus, pumped 3 sx cement. pressured up to 1000#, bled off, no back flow POOH last 2 jts and install tubing head. Cut off wellhead and cap 10 3/4" Surface. Cover up well and workover pit. Dig up deadman.


Name of Plugging Contractor: Cheyenne Well Service License #: KLN 6454
Address: P. O. Box 384, Ness City, KS 67560

Name of Party Responsible for Plugging Fees: SunStone Operating Company, LLC
State of _____ County, _____, ss.

Connie Swan (Employee of Operator) or (Operator) on above-described well, being first duly sworn on oath, says: That I have knowledge of the facts statements, and matters herein contained, and the log of the above-described well is as filed, and the same are true and correct, so help me God.

(Signature) Connie Swan
(Address) 4663 S. Maplewood, Tulsa, OK 74135

Notary Public My Commission Expires: 2-1-08 20 07

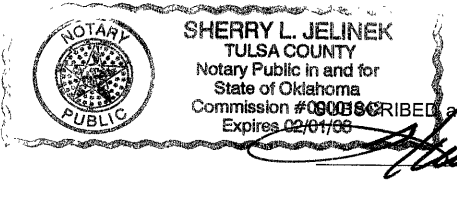

Mail to: KCC - Conservation Division, 130 S. Market - Room 2078, Wichita, Kansas 67202

RECEIVED
MAR 26 2007
KCC WICHITA