

Notice: Fill out COMPLETELY and return to Conservation Division at the address below within 60 days from plugging date.

KANSAS CORPORATION COMMISSION
OIL & GAS CONSERVATION DIVISION
WELL PLUGGING RECORD
K.A.R. 82-3-117

Form CP-4
December 2003
Type or Print on this Form
Form must be Signed
All blanks must be Filled

Lease Operator: Pardee Production Co.
Address: 11658 Santa Cruz Drive, Skiatook, OK 74070
Phone: (918) 396-9200 Operator License #: 31361
Type of Well: Gas Docket #: _____
(Oil, Gas D&A, SWD, ENHR, Water Supply Well, Cathodic, Other) (If SWD or ENHR)
The plugging proposal was approved on: August 30, 2007 (Date)
by: _____ (KCC District Agent's Name)

API Number: 15-175-10186-00-00
Lease Name: Light Heirs
Well Number: #1-A
Spot Location (QQQQ): 75N OF COF - W - E - SF - SW
735' Feet from North / South Section Line
1980' Feet from East / West Section Line
Sec. 5 Twp. 35S S. R. 32 East West
County: Seward
Date Well Completed: 9/6/60
Plugging Commenced: 9/4/07
Plugging Completed: 9/6/07

KCC
PPT
P
CP 2/3
9/18/07

Is ACO-1 filed? Yes No If not, is well log attached? Yes No
Producing Formation(s): List All (if needed attach another sheet)
Chester Depth to Top: 6052 Bottom: 6058 T.D. 6190
Morrow Depth to Top: 6168 Bottom: 6178 T.D. _____
Depth to Top: _____ Bottom: _____ T.D. _____

Show depth and thickness of all water, oil and gas formations.

Oil, Gas or Water Records		Casing Record (Surface Conductor & Production)				
Formation	Content	From	To	Size	Put In	Pulled Out
Chester	Gas	6168	6178	8-5/8	2189	5
Morrow	Gas	6052	6058	2-7/8	6238	1482

Describe in detail the manner in which the well is plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug set.

1-1/2" tbg stuck inside 2-7/8 tbg at 1600'. Cut off 1-1/2" tbg @ 1,510'. and pulled out. Cut 2-7/8 csg at 1,482 and pulled out. Went in hole around fish w/1-1/2" tbg swaged onto 2-7/8" tbg to 2,200'. Mix & pump 40 bbls mud. No circ. Pump 40 bbls water. No circ. Pump 50 sk cmt plug. Pull 10 stands 2-7/8 tbg. SION. Tag cement top at 1930', pull up to 1500', pump 35 bbls mud, hole circulated. Pump 50 sack cement plug. Pull up to 710'. Pump 50 sack cement plug. Pull up to 60'. Pump 25 sk cmt plug. Circ to surface. Dig out, cut off casing 5' below ground level. Weld plate on top of 8-5/8 casing. Backfill pit and cellar.

Name of Plugging Contractor: Dollar Well Service License #: 33311
Address: P.O. Box 744, Perryton, Texas

RECEIVED
KANSAS CORPORATION COMMISSION

Name of Party Responsible for Plugging Fees: Pardee Production Co.
State of Oklahoma County, Osage, ss.


James L. Pardee (Employee of Operator) or (Operator) on above-described well, being first duly sworn on oath, says: That I have knowledge of the facts statements, and matters herein contained, and the log of the above-described well is as filed, and the same are true and correct, so help me God.

(Signature) James L. Pardee
(Address) as above

CONSERVATION DIVISION
WICHITA, KS

SEP 10 2007

SUBSCRIBED and SWORN TO before me this 7th day of September, 20 07
Andrea R. Hudson My Commission Expires: _____
Notary Public

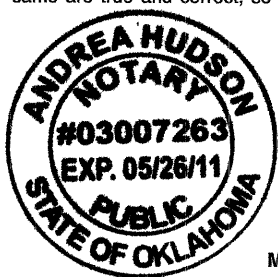

Mail to: KCC - Conservation Division, 130 S. Market - Room 2078, Wichita, Kansas 67202

PPT