

Larry Priest

KCC OIL/GAS REGULATORY OFFICE

Copy

Date 3/10/08

- New Situation
- Response to Request
- Follow-up

Operator license # 32825

Operator Pioneer Exploration, Ltd

Address 15603 Kuykendahl St 200 Location SE NE NW, Sec 20, T22S, R33W

Houston, Tx 77090

Lease Garden City Well # 3-30

County Finney

Operator phone number 281 893-9400

API # 15-055-21958

Reason for Investigation: Witness bond log & perforating

Problem: Circulation was lost while cementing the top stage of Alternate II cementing through a stage tool.

Well Data: Person(s) Contacted: 87% 327'; 5 1/2% 4949 w/ 305sx; Stage tool % 2694'
cemented with 500sx of on 2-19-08.

³⁻¹⁰⁻⁰⁸ Findings: (Radial sector) Log Tech ran cement bond log from 2682' to 50'. Logger called TOC % 830'. Bottom of usable water ≈ 1100'. Perf 4 holes % 700'.

03-12-08 Perf. casing @ 700' - Set packer @ 585'. pump 150sx common cement with good circulation, tailed in w/ 50sx common w/ 30% cc.


Cement by Basic Job, comp @ 3:30pm photos taken: S. Dumant

Action/Recommendations: _____

RECEIVED
KANSAS CORPORATION COMMISSION

MAR 20 2008

CONSERVATION DIVISION
WICHITA, KS

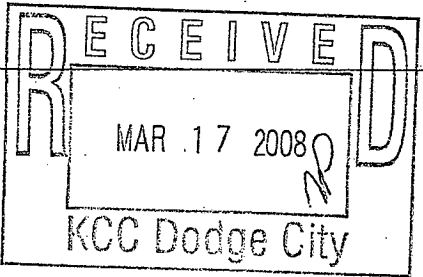

- Lease Inspection
- Complaint
- Field Report

By Ken Sehtik

PART II

Retain 1 copy Joint District Office
Send one copy Conservation Division

- RBDMS
- TA program
- KGS
- T-1 database
- District files
- Courthouse