


Give All Information Completely
Make Required Affidavit
Mail or Deliver Report to:
Conservation Division
State Corporation Commission
800 Bittig Building
Wichita, Kansas

WELL PLUGGING RECORD

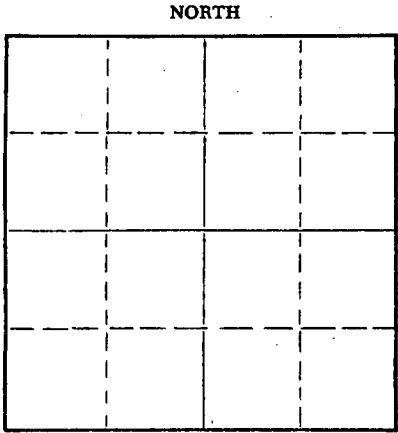

Locate well correctly on above Section Flat

Sheridan County. Sec. 12 Twp. 10 Rge. (E) 29W
Location as "NE/CNW/SW" or footage from lines SE SE NW
Lease Owner Jones, Shelburne & Farmer, Inc.
Lease Name SCHREINER Well No. 1
Office Address Russell, Kansas
Character of Well (completed as Oil, Gas or Dry Hole) Dry
Date well completed 8-24 19 55
Application for plugging filed 8-24 19 55
Application for plugging approved 8-24 19 55
Plugging commenced 8-24 19 55
Plugging completed 8-24 19 55
Reason for abandonment of well or producing formation Dry

If a producing well is abandoned, date of last production 19
Was permission obtained from the Conservation Division or its agents before plugging was commenced? Yes

Name of Conservation Agent who supervised plugging of this well Eldon Petty
Producing formation _____ Depth to top _____ Bottom _____ Total Depth of Well 4070 Feet
Show depth and thickness of all water, oil and gas formations.

OIL, GAS OR WATER RECORDS

CASING RECORD

FORMATION	CONTENT	FROM	TO	SIZE	PUT IN	PULLED OUT
				8-5/8	155	None

Describe in detail the manner in which the well was plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used, state the character of same and depth placed, from _____ feet to _____ feet for each plug set.

1. Filled hole with heavy mud
2. Pushed plug to 150'
3. Dumped 1/2 sack hulls on top of plug
4. Mixed 15 sacks cement and dumped on top of hulls
5. Filled hole to top
6. Pushed plug to 40'
7. Dumped in 1/2 sack hulls
8. Mixed 10 sacks cement and filled hole to top with same.

(If additional description is necessary, use BACK of this sheet)
Name of Plugging Contractor Jones, Shelburne & Farmer, Inc.
Address Russell, Kansas

STATE OF Kansas, COUNTY OF Russell, ss.
JOHN O. FARMER (Employer or owner) or (owner or operator) of the above-described well, being first duly sworn on oath, says: That I have knowledge of the facts, statements, and matters herein contained and the log of the above-described well as filed and that the same are true and correct. So help me God.
(Signature) John O. Farmer
Russell, Kansas (Address)

SUBSCRIBED AND SWORN TO before me this 30th day of August, 19 55

My commission expires October 11, 1958

Lucille Lunday Notary Public.

PLUGGING
FILE NO. 12710 R 264
PAGE 145 LINE 33

8-31-55
AUG 31 1955
CONSERVATION DIVISION
Wichita, Kansas


OPERATOR Jones, Shelburne & Farmer, Inc.

FORMATION RECORD

ADDRESS Russell, Kansas

Give detailed description and thickness of all formations drilled through, contents of sand, whether dry, water, oil or gas.

640 Acres
N

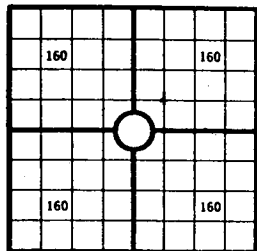

Locate well correctly

COUNTY Sheridan SEC. 12 TWP. 10 RGE. 26
 COMPANY OPERATING Jones, Shelburne & Farmer, Inc.
 OFFICE ADDRESS Russell, Kansas
 FARM NAME SCHREINER WELL NO. 1
 DRILLING STARTED 8-13-55 DRILLING FINISHED 8-24-55
 DATE OF FIRST PRODUCTION _____ COMPLETED _____
 WELL LOCATED SE 1/4 SE 1/4 NW 1/4 North of South
 Line and _____ ft. East of West Line of Quarter Section
 Elevation (Relative to sea level) DERRICK FLOOR 2584 GROUND 2579
 CHARACTER OF WELL (Oil, gas or dryhole) Dry

Formation	Top	Bottom	Formation	Top	Bottom
			TOPS:		
Shale	0	155	Elevation	RB	2587
Shale	155	505	Anhydrite		2203
Shale & sand	505	1785	Heebner		3799
Sand	1785	1895	Toronto		3819
Shale & shells	1895	2203	Lansing		3836
Anhydrite	2203	2238	Base Kansas		
Shale & shells	2238	2650	City		4067
Lime & shale	2650	3910	T.D.		4070
Lime	3910	3935		D & A	
Lime & shale	3935	4070			
T.D.		4070			

OIL OR GAS SANDS OR ZONES

Name	From	To	Name	From	To
1			4		
2			5		
3			6		

Perforating Record If Any

Shot Record

Formation	From	To	No. of Shots	Formation	From	To	Size of Shot

CASING RECORD

Amount Set				Amount Pulled				Packer Record			
Size	Wt.	Thds.	Make	Ft.	In.	Ft.	In.	Size	Length	Depth Set	Make
8-5/8				155							

Liner Record: Amount _____ Kind _____ Top _____ Bottom _____

CEMENTING AND MUDDING

Size	Amount Set		Sacks Cement	Chemical		Method of Cementing	Amount	Mudding Method	Results (See Note)
	Ft.	In.		Gal.	Make				
8-5/8	155		100						

Note: What method was used to protect sands if outer strings were pulled? _____

NOTE: Were bottom hole plugs used? _____ If so, state kind, depth set and results obtained _____

TOOLS USED

Tools used from _____ feet to _____ feet. Cable tools were used from _____ feet to _____ feet, and from _____ feet to _____ feet.

INITIAL PRODUCTION TEST

Describe initial test: whether by flow through tubing or casing or by pumping _____
 Amount Oil Production _____ bbls. Size of choke, if any _____ Length of test _____ Water
 Production _____ bbls. Gravity of oil _____ Type of Pump if pump is used, describe _____

I, the undersigned, being first duly sworn upon oath, state that this well record is true, correct and complete according to the records of this office and to the best of my knowledge and belief.

John Farmer Vice-President
 Name and title of representative of company

Subscribed and sworn to before me this 30th day of August, 1955
 My Commission expires 10-11-58
Lucille Kennedy
 Notary Public

FARM NAME SCHREINER WELL NO. 1 COUNTY Sheridan SEC. 12 TWP. 10 RGE. 26
 S-179-30180-0000