
## STATE OF KANSAS STATE CORPORATION COMMISSION

Give All Information Completely
Make Required Affidavit
Mail or Deliver Report to
Conservation Division
State Corporation Comm.
245 North Water
Wichita, KS 67202

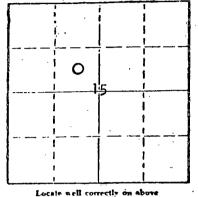

My commission expires August 22, 1982

## WELL PLUGGING RECORD

Clark County. Sec. 15	Twp. 345 Rge. 21 E/WX
Location as "NE/CNW\sw\sumsy or footage fr	com lines C-SE-NW
1980' FNL & 1980' FWL	<u> </u>
Lease OwnerUnion Oil Company of Califo	ornia
Lease Name J. C. Harper 'G''	Well No.
Office AddressOklahoma City, Oklahoma	Bldg 73106
Character of Well (Completed as Oil, C	Gas or Dry Hole)
Gas	
	nuary 14, 1960
Application for plugging filed Nov	ember 25, 1980
Application for plugging approved Dec	cember 2, 1980
Plugging commenced Dec	ember 1, 1980
Plugging completed Dec	ember 8, 1980
Reason for abandonment of well or prod	ducing formation
Depleted	
If a producing well is abandoned, date	of last production
March	19.75
Was permission obtained from the Conse	
its agents before plugging was commend	ed? Yes

Locate well correctly on Section Plat Name of Conservation Agent who supervised plugging of this well Clarence Thomas Producing formation Marmaton & Morrow Depth to top 5057 Bottom 5602 Total Depth of Well 5656 Show depth and thickness of all water, oil and gas formations. OIL, GAS OR WATER RECORDS CASING RECORD FORMATION CONTENT FROM TOSIZE PUT IN PULLED OUT Morrow 5602 13-3/811 Gas 5352 506 None Marmaton Dry 5224 8-5/8" 2599 5057 None 4-1/211 55561 3500 Describe in detail the manner in which the well was plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hold. If cement or other plugs were used, state the character of same and depth placed, from Surface feet to feet for each plug set. (10-18-75 Set cmt. ret. @ 5348 & squeezed Morrow perf's. 56561 5461-69 w/100 sx. cmt. @ 3000# Dumped 10 sx. cmt. on top of retainer. Perforated Marmaton 5461-69 w/100 sx. cmt. @ 3000# Dumped 10 sx. cmt. on top of retainer. Perforated Marmaton 5063-68', 5117-26' & 5178-95'. Set Cmt. ret. @ 5100' & squeezed perf's. 5117-26 & 5178-95 w/100 sx. cmt. @ 1900#) 12-1-80 M.I.R.U. unit P.O.O.H. w/tbg. R.I.H. w/4½" gauge ring to 5060'. Set cmt. ret. @ 5025', Toaded csg. w/wtr. & press. to 500#, Toad tbg. & squeezed perf's. 5063-68' w/100 sx. Class "H" cmt. Pull out of ret. & dump 5' cmt. on top of retainer. Displace hole w/10 Tb. 36 Vis. mud. Shot 4½" off @ 3499' & pulled out of hole w/approx. 3500' 4½" csg. Spot 50 sx. cmt. plug 2649-2549', 25 sx. cmt. plug 700'-60', Cut 13-3/8" & 8-5/8" csg. off 4' below ground level, Spotted 10 sx. cmt. plug 34' to 4'. Welded on steel plate, filled cellar, removed all surface equipment. Well plugged and abandoned 12-8-80. (If additional description is necessary, use BACK of this sheet) Name of Plugging Contractor Lillard Casing Pullers - Woodward, Oklahoma STATE OF Oklahoma 0klahoma COUNTY OF SS. (employeexaxxaxxxx) or (owner or operator) of the above-described well, being first duly sworn on oath, says: That I have knowledge of the facts, statements, and matters herein contained and the log of the above-described well as filed and that the same are true and correct. So help me God. (Signature) Center South Building Classen Oklahoma City, Oklahoma 73 (Address) SUBSCRIBED AND SWORN TO before me this 9th day of 1980 Wanda J. Cooper