


Give All Information Completely
Make Required Affidavit
Mail or Deliver Report to:
Conservation Division
State Corporation Commission
211 No. Broadway
Wichita, Kansas

WELL PLUGGING RECORD

NORTH

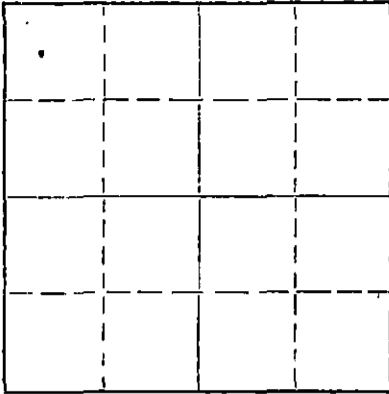

Locate well correctly on above
Section Plat

Seward County, Sec. 6, Twp. 31S, Rge. 34 W(E) (W)
Location as "NE/CNW/SW" or footage from lines 584' FWL & 687' FNL
Lease Owner Mobil Oil Corporation
Lease Name George B. Strong Well No. 8
Office Address P. O. Box 5444 Denver, CO 80217
Character of Well (completed as Oil, Gas or Dry Hole) oil FOR
Date well completed March 23, 1970
Application for plugging filed January 31, 1983
Application for plugging approved February 21, 1983
Plugging commenced April 12, 1983
Plugging completed April 13, 1983
Reason for abandonment of well or producing formation wouldn't produce

If a producing well is abandoned, date of last production - 19
Was permission obtained from the Conservation Division or its agents before plugging was commenced? Yes

Name of Conservation Agent who supervised plugging of this well Paul Luthi, 302 McArtor, Dodge City, KS 67801
Producing formation Morrow Depth to top Bottom Total Depth of Well 5650' Feet
Show depth and thickness of all water, oil and gas formations.

OIL, GAS OR WATER RECORDS

CASING RECORD

FORMATION	CONTENT	FROM	TO	SIZE	PUT IN	PULLED OUT
				9 5/8"	660'	
				5 1/2"	5649'	
Kansas City			4500'			

Describe in detail the manner in which the well was plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used, state the character of same and depth placed, from feet to feet for each plug set.

4/12/83 - Rig up Patrick #3 - Rig up McCullough and new bridge plug. Tag fish at 2575'. Set bridge plug at 2546. Perforated at 2500. Run tubing and packer and set packer at 2026. Howco pumped 50 sx. cement and displaced with mud. Pulled tubing and laid packer down. Run 51 jts. tubing to 1580. Circulated mud to surface (43 bbl.). Spot 15 sx. cement and flushed w/mud. Pulled tubing and rigged up McCullough and perforate at 650. Started cement in 5 1/2" casing at 2 1/2 bpm and lost circulation where cement hit perms. Reduced rate to 1 bpm pumping mud. Got circulation back after 17 bbl. Pumped 25 bbls. mud to clear casing and surface pipe. Very little cement return. SION.

4/13/83 - Pumped 10 bbl. mud in casing - circulation OK. Filled 5 1/2 casing w/cement and circulated to surface. Left surface pipe and 650 ft. of casing full of cement.

RECEIVED
STATE CORPORATION COMMISSION

7-05-83 JUL 05 1983

CONSERVATION DIVISION
Wichita, Kansas

(If additional description is necessary, use BACK of this sheet)

Name of Plugging Contractor Halliburton Services
Address Box 1598, Liberal, Kansas 67901

STATE OF Colorado, COUNTY OF Denver, ss.
C. J. Park (employee of owner) or (owner or operator) of the above-described

well, being first duly sworn on oath, says: That I have knowledge of the facts, statements, and matters herein contained and the log of the above-described well as filed and that the same are true and correct. So help me God.

(Signature) C. J. Park, Prod. Acctg. Supv.

P. O. Box 5444 Denver, CO 80217
(Address)

SUBSCRIBED AND SWORN to before me this 30th day of June, 1983

My commission expires 6/08/86
Hanna J. Skinner Notary Public.