

1955

State Kansas County PawneeCompany G-M-R Drlg Co. & Newmont Well No. 1Farm Sweeny "B"

Survey _____

Block No. _____ Sec. 8 Twp. 21S Range 15WCo-Ord. _____ Elev. 1957 KB

C W/2 SW SE

C.T.U. #2

55%-Newmont Oil Co.

35%-G-M-R Drlg Co.

10%-Wm. Graham Oil Co.

NOTE: Show Sketch of Lease and Well Location in Above Space

Ft. from N. Line

Ft. from S. Line

Ft. from W. Line

Ft. from E. Line

Date	Depth	WORKOVER
6-24-55	MICT	
6-25	Squeezed w/75 sx cem. Max press-3500#. Displaced 12 sx. WOC	
6-27	Perf 3822-30/32 ^s . Acidized w/1000 gals. Max press-450#. Finished on vacuum. Flowed 6 mil cfg & 7 BFPH (90% wtr, 10% oil) for 5 hrs thru tbg.	
6-28	Squeezed w/75 sx Posmix. Maximum	

1956

State Kansas County Lawrence

Company Gmr Drilg Co & Minmont Well No. 1

Farm Sweeney "B"


Survey

Block No. Sec. 8 Twp. 21S Range 15W

Co-Ord. Elev. 1957 KB

Ctr 1/2 Sw 8

CSU #2

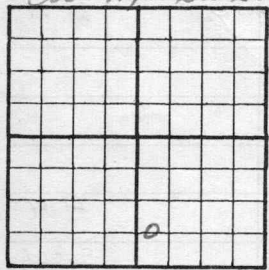

NOTE: Show Sketch of Lease and Well Location in Above Space

Ft. from N. Line 660 Ft. from S. Line

Ft. from W. Line 2310 Ft. from E. Line

Date	Depth	
		<u>Workover to squeeze off water</u>
<u>10-9</u>		<u>MICT</u>
<u>10-10</u>		<u>Retainer set @ 3782. Acidized w/1000 Gal. 2000 psi - 150". Went in @ 3 Bbl/min.</u>
		<u>Squeezed w/100 sp. Permian.</u>
		<u>Displaced 50 sp. HOC</u>
<u>10-11</u>		<u>To start drilg cem this morning.</u>
<u>10-12</u>		<u>Drilg cement. Have about 13' to drill</u>
<u>10-13</u>		<u>DOC to 3808. Perf 3804-08 w/16⁵</u>

703000

Date	Depth	
		Show gas.
		Put in 50 gal acid. Let set overnight.
		To start testing this morning. Gas increased but not enough to measure. Noite
10-14		Put in 100 gals acid. Let set 4 hrs. Little change in amt of gas.
		Put in another 100 gals. Let set overnight. To start testing this morning. No increase in gas.
10-15		Dreg out cement perf 3830-35
10-17		DOC to 3838. (perfs 3804-08 open) Perf. 3830-35 w/10 ^s . Swab 25WPH Sumped 4 st cems. VOC
10-18		Swabbed hole down. Put in 4 gal cement.
		To acidize perfs 3804-08 this a.m.
10-19		Tried to acidize w/250 gals - Press - 1500 ⁺ . Only 84 gals would go in in 2 hrs. To start swabbing hole down this a.m.

State

County

Lawrence

Company

G.M.K. Drilling Co + Newmont Well No. ,

Farm

Success "B"

Survey

Block No.

Sec.

8

Twp.

21 S


Range

15 W

Co-Ord.

Elev. 1957 KB

Cts w/2 SW SE

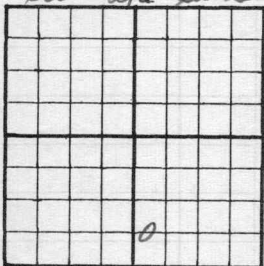

C.T.U. # 2

Page 2

NOTE: Show Sketch of Lease and Well Location in Above Space

Ft. from N. Line

Ft. from S. Line

Ft. from W. Line

Ft. from E. Line

Date	Depth	
10-20	Swabbed 5 Buph yesterday eve. making 1/2 million gas. Unit will be down several days while crew work on C.T.U. #1	
10-21	DL 80 BW in 24 hrs.	
10-31	Tearing down unit. Completion being postponed.	
4-17-56	Plugging operations started 4-16-56	

Date

Depth

703000

Slugging completed 4-19-56.
Rec. 2408' of 5 1/2".