

CWWD

State Kansas County Stafford
 Company Messman-Lindahl Well No. 1
 Farm Brodie Trust
 Survey SW SE SW
 Block No. _____ Sec. 27 Twp. 22S Range 13W
 Co-Ord. OTD 3847 Elev. _____

P&A	4-16-74								
		27							

Was Clinton Oil Co
 #14 Brodie D&G 12-30-70
 Interest Owners
 Roger L. Messman
 Co. L. Lindahl

Lease: Red Tiger Drly
 Prod: George Klein

NOTE: Show Sketch of Lease and Well Location in Above Space

Ft. from N. Line _____ Ft. from S. Line _____
 1973 Ft. from W. Line _____ Ft. from E. Line _____


Date	Depth	
Dec 15		Moved in rigged up
Dec 16		wash down to total depth of 3750
Dec 17		Circulating wash ing on 4 1/2" casing should arrive today
Dec 18		Run 118 lbs 3709.24' out at 3700 Cemented

717449

Date	Depth	
		with 110 each. 10% Salt Plug down
	woct	10:45 p.m. 12-17-73
1974		Perf 3 to 19-24/20
3-1		5000' Max pres. 2000' Min. 1300' swab back, mud & raw @
3-2		1000 gal @ inc 90 swab down 1000' information at 3" rate, swab mud & some oil shut down & sch over weekend
3-4		2000' into 1% oil swab 4 lbs fluid g/hrs setting plug to perf next zone
3-5		Frank got hole dried up sch two plugs now thinks he has a hole in the pipe. Going to get tubing.

State Kansas County Stafford
 Company Mesman Leach Well No. 1
 Farm Brodie farm
 Survey SW SE SW
 Block No. 27 Sec. 27 Twp. 22S Range 13W
 Co-Ord. _____ Elev. _____

OTD 3847

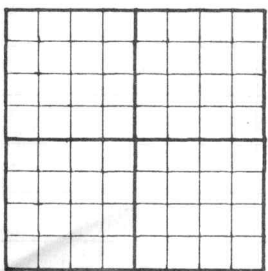

NOTE: Show Sketch of Lease and Well Location in Above Space

Ft. from N. Line

Ft. from S. Line

Ft. from W. Line

Ft. from E. Line

1972

Date	Depth	
3-5		shut down for a few days.
3-8		On the way back set @ 3562 and set hole dry
3-9		Perf. 35-92-99/4 Acidize w/ 250 gal. swabbed 2 bbls fluid 30" 15-20% oil Acidize w/ 1500 gal
3-10		Shut down

Date

Depth

717449

Plugged April 16,
1974

~~Production~~ ~~Study~~ Brodie
Brodie

Give to Pet. Info.

Ran correlation log
Perf. 4 holes per foot. 3619 - 24. Acidize with
300 gal. 15% acid. 2000[#] Max pressure. Acidize at
1300[#]. Swab 1 bbl. mud & acid water per hour for
4 hrs. Acidize 1000 gal. 28% acid. Average
pressure 1650[#]. Swab 3 bbls water with slight
show of oil per hr. Set plug 3610'. Perf. 4
shots per foot 3593 - 99 feet. Acidize 300 gal.
15% acid. Max pressure 1900[#]. Average pressure 1000[#]
Swab 2 bbls fluid ^{hr.} 15% oil for 2 hrs. Acidize
1500 gal. 15% acid. Max. pressure 850[#]. Swab 5 bbls
oil & wtr first hour. Decrease to 1 bbl fluid per hr
20% oil. ^{Will plug &} ~~Plug & Abandoned.~~
_{less than}