

15-009-00335

BEE FORMATION TESTING CO.

TEST TICKET
33-17-13DATE Oct. 12 - 1956

P. O. BOX 491

Nº 1800

GREAT BEND, KANSAS


CUSTOMER'S
ORDER NO. _____NAME OF COMPANY Petroleum Inc.ADDRESS TO MAIL INVOICE 311 E ThirdADDRESS TO MAIL PRESSURE CHARTS Wichita Ks.LEASE Demel. WELL NO. 1 (D-1) COUNTY Barton STATE KS.TESTER JOH. APPROVED James G. MorrisDRILL STEM TEST NO. 1 SUCCESSFUL NO. 1 MIS-RUN NO. _____ FORMATION TESTED KC.SIZE HOLE 7 7/8 TOOL JT. 4 1/2 F.h.RUBBER SIZE 6 3/4 x 2 7/8 x 30- TEST TOOL SIZE 7 5/8PACKER SET AT 3136 ANCHOR SIZE 61' 4 1/2 - 21' 5 7/16TOTAL DEPTH WELL 3218 LENGTH ANCHOR 82'PRESSURE RECORDER CAP. 2500 - 3500 DRILL PIPE RUN: DRY all WITH FLUID

RESULTS:

PACKER SET 4:45 A.M. TOOL OPEN 4:49 A.M. TOOL OPEN 1 HRS.BLOW Strong Through-out-Test-RECOVERY 250 H.O.G.C.M. 250 G.M.C.O.SHUT IN PRESSURE TIME 1/2 hr. MUD WT. 10 3/4 VIS. 40 WATER LOSS 16.BHP 900 # IFP 75 # FFP 150 # HYDROSTATIC HEAD 1500 #EXTRA EQUIPMENT ✓ JARS _____ NO. _____ SIZE 2OPERATOR TIME _____ TOOL RENTAL TIME ✓

BEE FORMATION TESTING CO.

SHALL NOT BE LIABLE FOR DAMAGE OF ANY KIND TO THE PROPERTY OR PERSONNEL OF THE PARTY FOR WHOM A TEST IS MADE, OR FROM ANY LOSS SUFFERED OR SUSTAINED, DIRECTLY OR INDIRECTLY, THROUGH OR IN THE COURSE OF THE USE OF ITS EQUIPMENT, ALL OF WHICH LOSS OR DAMAGE IS ASSUMED BY THE CUSTOMER. TOOLS LOST OR DAMAGED IN THE HOLE SHALL BE PAID FOR AT THE COST OF THE PARTY FOR WHOM TEST IS MADE.

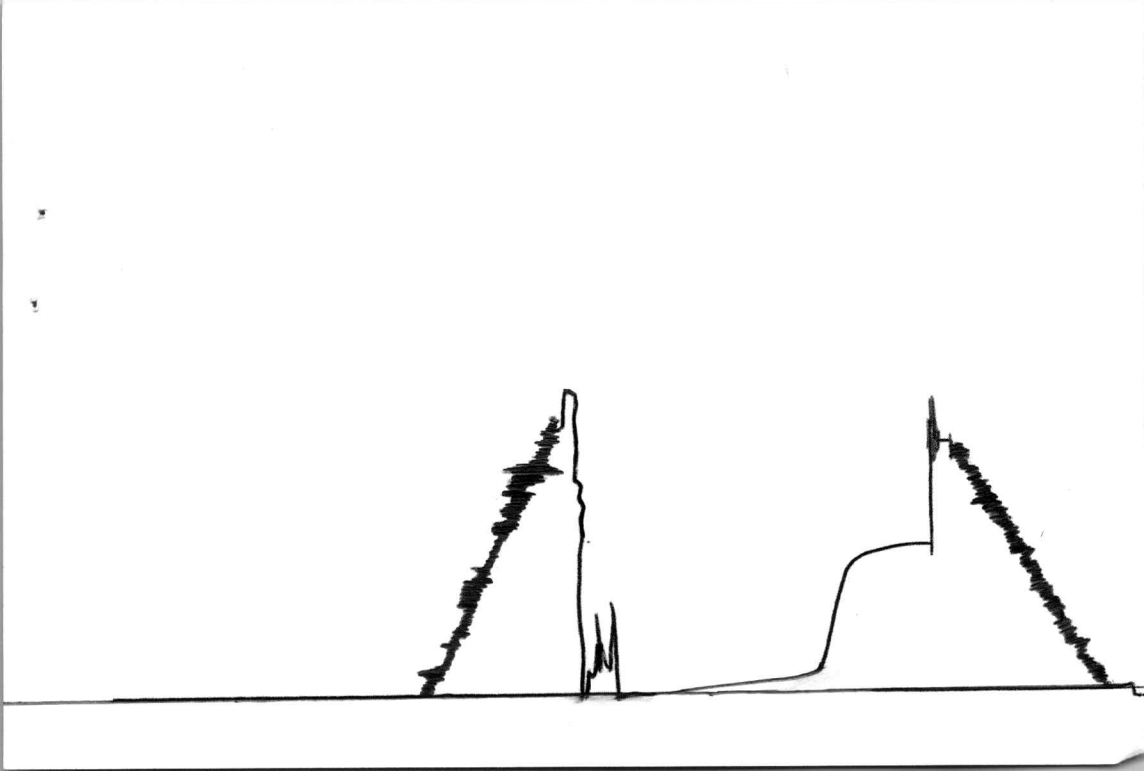

BEE FORMATION TESTING CO.

P. O. BOX 491

GREAT BEND, KANSAS

DATE 10-12-56N^o 1845CUSTOMER'S
ORDER NO. _____

NAME OF COMPANY _____

PET. INC.

ADDRESS TO MAIL INVOICE _____

305 E. 3rd WICHITA, KS.

ADDRESS TO MAIL PRESSURE CHARTS _____

SAME

LEASE _____

Demel

WELL NO. _____

10-17

COUNTY _____

BARTON

STATE _____

Ks.

TESTER _____

William M. Blake

APPROVED _____

James A. Morris

DRILL STEM TEST NO. _____

2

SUCCESSFUL NO. _____

2

MIS-RUN NO. _____

FORMATION TESTED _____

K.C.

SIZE HOLE _____

7 7/8

TOOL JT. _____

4 1/2 F.H.

RUBBER SIZE _____

6 3/4 - 2 7/8 - 30

TEST TOOL SIZE _____

4 5/8

PACKER SET AT _____

32 16

ANCHOR SIZE _____

4 1/2

TOTAL DEPTH WELL _____

3240

LENGTH ANCHOR _____

24'

PRESSURE RECORDER CAP. _____

3500 - 3500

DRILL PIPE RUN: DRY _____

yes

WITH FLUID _____

RESULTS:

PACKER SET _____

3:18

P.M. TOOL OPEN _____

3:23

P.M. TOOL OPEN _____

1 hr.

HRS. _____

BLOW _____

Weak Blow For 10 min.By - Passed Tool.

RECOVERY _____

30' Watery Mud.

SHUT IN PRESSURE TIME _____

30 min.

MUD WT. _____

9.9

VIS. _____

38

WATER LOSS _____

17

BHP _____

100

IFP _____

0

FFP _____

0

HYDROSTATIC HEAD _____

1800

EXTRA EQUIPMENT _____

No

JARS _____

NO. _____


SIZE _____

OPERATOR TIME _____

TOOL RENTAL TIME _____

BEE FORMATION TESTING CO.

SHALL NOT BE LIABLE FOR DAMAGE OF ANY KIND TO THE PROPERTY OR PERSONNEL OF THE PARTY FOR WHOM A TEST IS MADE, OR FROM ANY LOSS SUFFERED OR SUSTAINED, DIRECTLY OR INDIRECTLY, THROUGH OR IN THE COURSE OF THE USE OF ITS EQUIPMENT, ALL OF WHICH LOSS OR DAMAGE IS ASSUMED BY THE CUSTOMER. TOOLS LOST OR DAMAGED IN THE HOLE SHALL BE PAID FOR AT THE COST OF THE PARTY FOR WHOM TEST IS MADE.

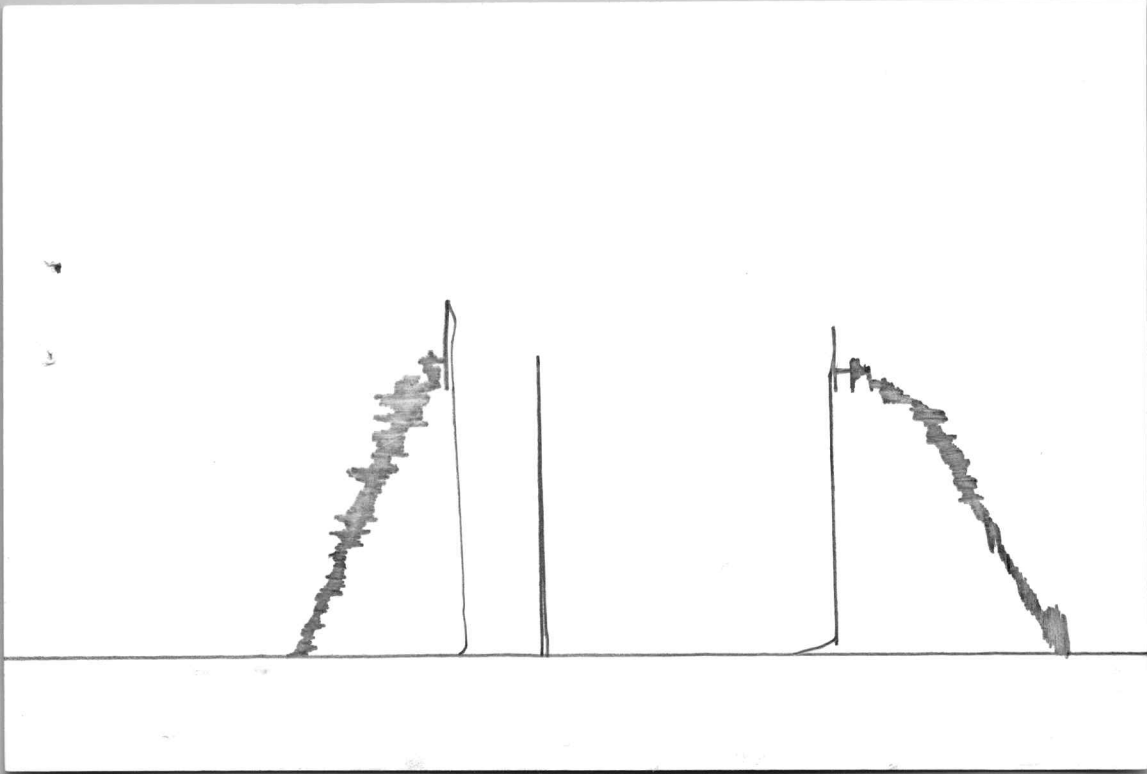

BEE FORMATION TESTING CO.

P. O. BOX 491

GREAT BEND, KANSAS

DATE 10-13-56N^o 1846CUSTOMER'S
ORDER NO. _____NAME OF COMPANY PET. INC.ADDRESS TO MAIL INVOICE 305 E 3rd WICHITA, KS.ADDRESS TO MAIL PRESSURE CHARTS SameLEASE Demel WELL NO. 1^(D-1) COUNTY BARTON STATE KS.TESTER William M. Blake APPROVED James A. MorrisDRILL STEM TEST NO. 3 SUCCESSFUL NO. 3 MIS-RUN NO. _____ FORMATION TESTED K.C.SIZE HOLE 7 7/8 TOOL JT. 4 1/2 F.H.RUBBER SIZE 6 3/4 - 2 7/8 - 30 TEST TOOL SIZE 4 5/8PACKER SET AT 3274 ANCHOR SIZE 4 1/2TOTAL DEPTH WELL 3350 LENGTH ANCHOR 76'PRESSURE RECORDER CAP. 3500-3500 DRILL PIPE RUN: DRY yes WITH FLUID

RESULTS:

PACKER SET 11:11 A.M. TOOL OPEN 11:15 A.M. TOOL OPEN 1 hr. HRS.BLOW Good Blow Through Out Test.RECOVERY 1320' Gas in Pipe120' V.H.O.G.C.M.60' Gassy OilSHUT IN PRESSURE TIME 30 min. MUD WT. 10.4 VIS. 35 WATER LOSS 19.BHP 1050 IFP 0 FFP 0 HYDROSTATIC HEAD 1850EXTRA EQUIPMENT No JARS — NO. — SIZE —OPERATOR TIME — TOOL RENTAL TIME —

BEE FORMATION TESTING CO.

SHALL NOT BE LIABLE FOR DAMAGE OF ANY KIND TO THE PROPERTY OR PERSONNEL OF THE PARTY FOR WHOM A TEST IS MADE, OR FROM ANY LOSS SUFFERED OR SUSTAINED, DIRECTLY OR INDIRECTLY, THROUGH OR IN THE COURSE OF THE USE OF ITS EQUIPMENT, ALL OF WHICH LOSS OR DAMAGE IS ASSUMED BY THE CUSTOMER. TOOLS LOST OR DAMAGED IN THE HOLE SHALL BE PAID FOR AT THE COST OF THE PARTY FOR WHOM TEST IS MADE.

