



WILDCAT TESTING COMPANY

P. O. BOX 83

PHONE 658-5151

WILSON, KANSAS

DEC 23 1970

DRILL STEM TEST REPORT

LEASE MCKER WELL NO. 1


DRILL STEM TEST RECOVERY REPORT

WILDCAT TESTING COMPANY

Best Scanned Copy

Date 11-23-70

Ticket No. 223

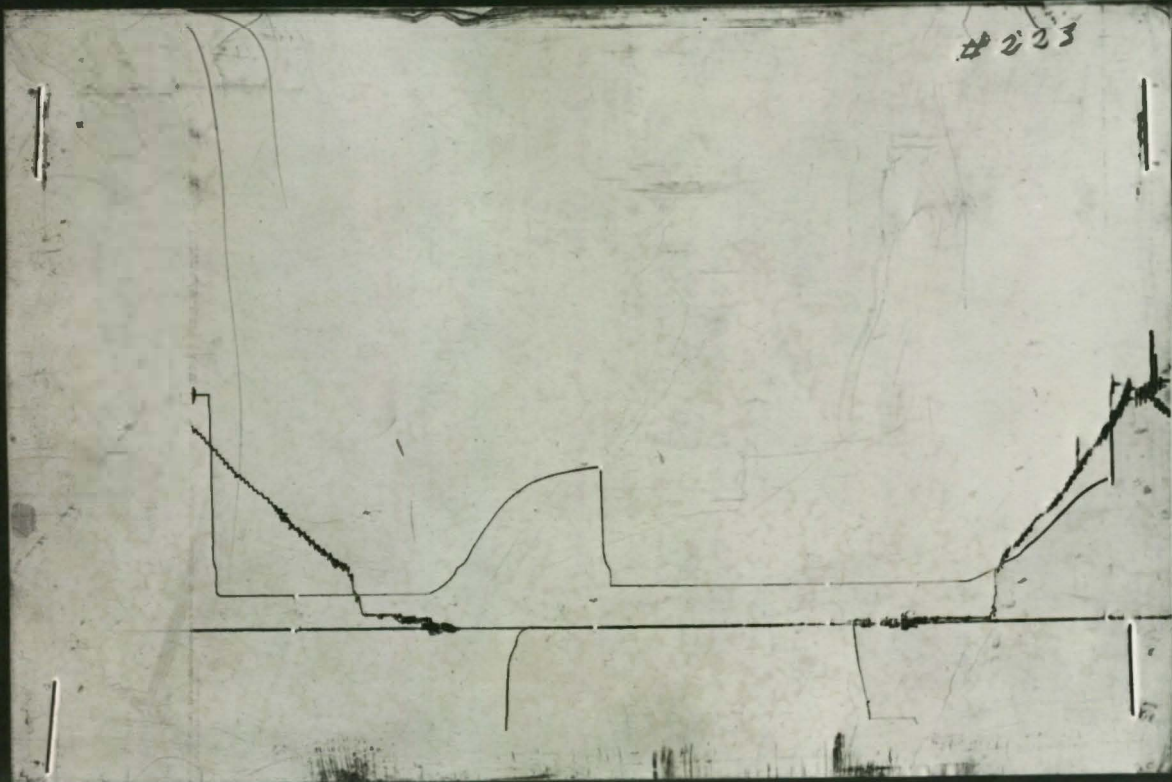

Company HUPE & BELL Contractor H-30 DRILLING CO.

Well No. 1 Lease MACEK County ELLISWORTH Sec. Rg. Twp.

Test No. 1 Size Hole 7 7/8 Packer Size 6 3/4 Drill Pipe Size 4 1/2 F H

Interval Tested From 2802 To 2831 Depth of Well 2831 Size Choke 1/8

Fluid Recovered In FLEXWEIGHT Temp. Elev.

Initial Hyd. P.S.I. Final Hyd. P.S.I.

First Initial Flow Pressure 185 P.S.I. Opened Tool 4:45 AM P.M.

First Final Flow Pressure 185 P.S.I. First Flow Pres. 30 Min.

Initial Closed-in Pressure 1140 P.S.I. Initial Closed-in Pres. 60 Min.

Second Initial Flow Pressure 205 P.S.I. Second Flow Pres. 60 Min.

Second Final Flow Pressure 205 P.S.I. Final Closed-in Pres. 60 Min.

Final Closed-in Pressure 940 P.S.I.

Blow VERY WEAK INC. TO PAIR 2ND. OPENING VERY WEAK THRU-OUT

Recovery 45 FT. THIN SLIGHT WATERY MUD. TRACE FREE OIL SPECKS & GAS
BUBBLES IN TOP OF TOOL

Remarks

Approved By RICHARD M. POLEY Tester ED PHILBERN

DRILL STEM TEST RECOVERY REPORT


WILDCAT TESTING COMPANY

Best Scanned Copy



Date 11-23-70

Ticket No. 224

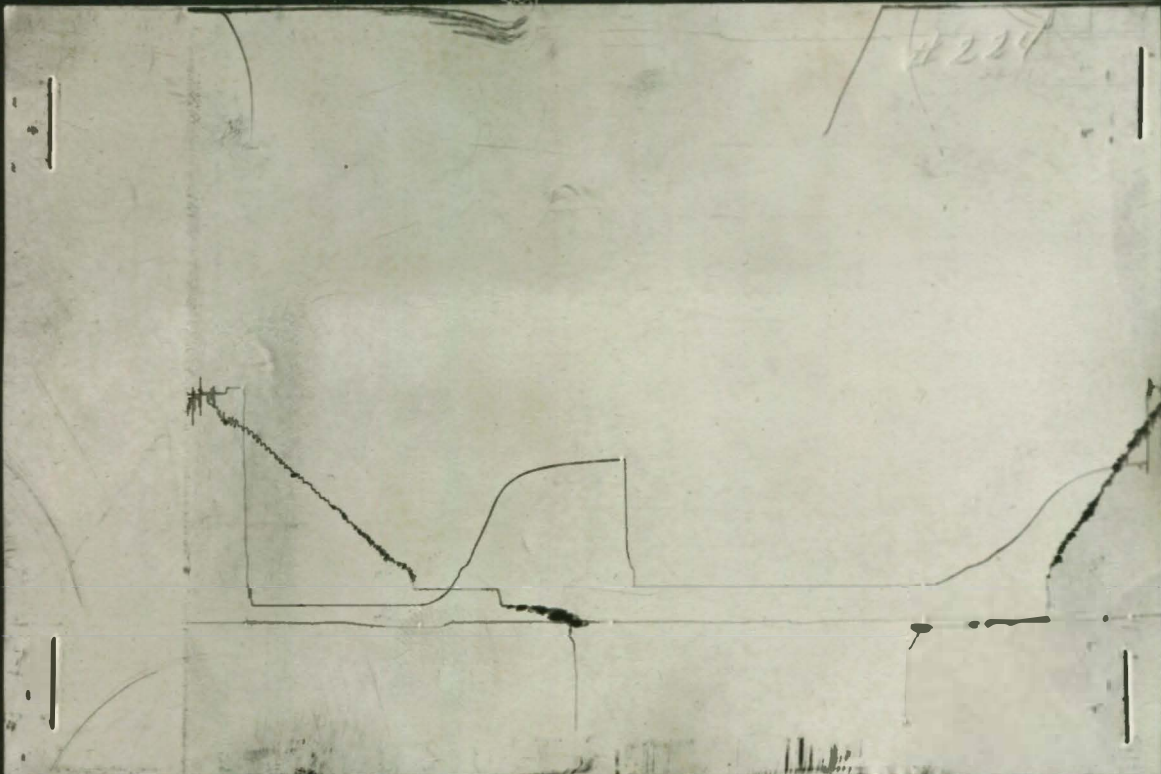

Company RUPE & BALL Contractor H-30 D.L.G. CO.
 Well No. 1 Lease HACEK County CLINTON Re. 1
 Test No. 2 Size Hole 7 7/8 Packer Size 6 3/4 Drill Pipe Size 4 1/2
 Interval Tested From 2894 To 2910 Depth of Well 2910 Size Choke 1/2
 Fluid Recovered In FLEXITEIGHT Temp. Elev.
 Initial Hyd. 1715 P.S.I. Final Hyd. 1715 P.S.I.
 First Initial Flow Pressure 60 P.S.I. Opened Tool 2:35 AM P.M.
 First Final Flow Pressure 60 P.S.I. First Flow Pres. 30 Min.
 Initial Closed-in Pressure 1190 P.S.I. Initial Closed-in Pres. 60 Min.
 Second Initial Flow Pressure 195 P.S.I. Second Flow Pres. 60 Min.
 Second Final Flow Pressure 195 P.S.I. Final Closed-in Pres. 60 Min.
 Final Closed-in Pressure 1110 P.S.I.
 Blow WEAK STEADY BLOW THRU TEST

Recovery 75 FT. VERY SLIGHT OIL&GAS CUT MUD
 WITH FREE OIL IN TOP OF TEST TOOL

Remarks

Approved By RICHARD M. FOLEY Tester ED PHILBERN



WILDCAT TESTING COMPANY

Route 1 Phone 793-9278
GREAT BEND, KANSAS

TEST TICKET

No.

223

Date 11-3-70 Place S-E Wilson
Charge to Rupp & Bell Order No. _____
Mail Address _____ City _____ State _____
Owner of Well SAME Contractor H-30 DRILLING CO.
Well No. 1 Lease MACEK County ELLISWORTH Sec. _____ Twp. _____ Rng. _____
Test No. 1 Successful No. _____ Mis-run No. _____
Size Hole 7/8 Depth Well 2831 Tool Joint 4 1/2 FH. Test Tool Size 3 1/2 x 4 1/2 FH.
Packer Size 6 3/4 Packer set at 2802 Sub Rented From _____ Sub Size _____
Anchor Size 4 1/2 Length 22'
Rot Hole Size V Depth to Shoulder V Size Bean 6
Drill Stem: Run Dry _____ with Fluid _____
Pressure Recorder Make H & T Cap. No. 5000 & 3500 PSI

RESULTS:

Time Packer Set 4:45 PM Hyd. Pressure _____
Tool Open Initial 30 Min. Tool Open Final 60 Min.
Initial BHP 1140 In 60 Min. Final BHP 940 In 60 Min.
Initial Flow Pressure 185 Final Flow Pressure 205
Blow very weak inc to fair (30 min) 2nd open very weak thru out (60")
Recovery 45' thin sl. watery mud. Trace free oil specks & gas bubbles in top of tool.

Fluid Recovered In _____ Drill Pipe _____
Flexweight V Drill Collars _____ Was Tool Plugged? No Was Anchor Plugged? No
Mud Weight 106 Visc. 41 Elevation GL _____ KB _____
Extra Equipment _____
Formation Tested LANS 80 Top Temperature _____

Price Job _____
Other Charges _____
Total _____

Wildcat Testing Company shall not be liable for damages of any kind to the property or the personnel of the one for whom a test is made or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statement or opinion concerning the result of any test. Tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

Approved _____

Tester Ed Philbrick

A ticket must be made with complete information for each run, whether successful or not.



WILDCAT TESTING COMPANY

Route 1 Phone 793-9278
GREAT BEND, KANSAS

No 224

TEST TICKET

Date 11-4-70 Place S-E-Wichita
Charge to Rope & Ball Order No. _____
Mail Address _____ City _____ State _____
Owner of Well SAME Contractor H-30
Well No. 1 Lease WACK County ALLS WORTH Twp. _____ Rng. _____
Test No. 2 Successful No. 2 Mis-run No. XX
Size Hole 2 7/8 Depth Well 2910 Tool Joint _____ Test Tool Size _____
Packer Size 6 3/4 Packer set at 2894 Sub Rented From _____ Sub Size _____
Anchor Size 4 1/2 Length 16'
Rat Hole Size 1 Depth to Shoulder 1 Size Bean 1
Drill Stem: Run Dry _____ with Fluid _____
Pressure Recorder Make H & T Cap. No. 5000 & 3500 P51

RESULTS:

Time Packer Set 2:35 P M Hyd. Pressure 1715
Tool Open Initial 30 Min. Tool Open Final 80 Min.
Initial BHP 1190 In 60 Min. Final BHP 1110 In 60 Min.
Initial Flow Pressure 60 Final Flow Pressure 195
Blow WEAK STEADY BLOW TARD TEST
Recovery 75' V. SLI. OIL & GAS OUT MOD
W/ FREE OIL IN TOP OF TEST TOOL.

Price Job _____
Other Charges _____
Total _____

Fluid Recovered In _____ Drill Pipe _____
Flexweight 1 Drill Collars _____ Was Tool Plugged? No Was Anchor Plugged? No
Mud Weight 10.3 Visc. 40 Elevation GL _____ KB _____
Extra Equipment None
Formation Tested LOAMS 80 Temperature _____

Wildcat Testing Company shall not be liable for damages of any kind to the property or the personnel of the one for whom a test is made or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statement or opinion concerning the result of any test. Tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

Approved Richard M. Foley

Tester Ed Philbert

A ticket must be made with complete information for each run, whether successful or not.