

Gore #7 Luerman
Russell Co., Ks.

28-15-12W

CORE DESCRIPTION

Core #1 2979-2991 Full recovery

2979-80	SH. GRY.
2980-82	LS. GRY. SH. LAM.
2982-88	LS. FOSIL. OOL. & OOLIC. F. VUG. POROSITY FEW VUGS. BU. O. MUCH BARREN POROSITY
2988-90	LS. DSE.
2990-91	LS. SHY.

CORE #7 Luerman
Russell Co., Ks.

28-15-12W

CORE DESCRIPTION

Core #2 3015-3025 Full recovery

3015-20

SH. GRY.

3020-25

LS. F. X. DSE. TR. STN. G. GS. ODOR 3024-25

Gore #7 Luerman
Russell Co., Ks.

28-15-12W

CORE DESCRIPTION

Core#3 3040-3062 Full recovery

3040-46	LS. FOSIL. & COL. F. VUG. POROSITY V. S. S. F. O. 30% SATR.
3046-60	LS. FOSIL. F. VUG. POROSITY
3060-62	LS. DSE. GRY. SH. LAM.

GORE #7 Luerman
Russell Co., Ks.

28-15-12W

CORE DESCRIPTION

Core #4 3079-3102 Full recovery

3079-88	LS. THIN GRY. SH. LAM.
3088-90	LS. PT. FOSIL. SCAT. VUG. POROSITY BU. O. IN SPOTS
3090-92	LS. SHY.
3092-95	LS. FOSIL. F. VUG. POROSITY BU. O. 95% SATR.
3095-3102	LS. GRY. SH. LAM.

Gore #7 Luerman
Russell Co., Ks.

28-15-12W

CORE DESCRIPTION

Core #5 3124-3144 Full recovery

3124-25	SH. GRY.
3125-35	LS. FOSIL. F. FR. & VUG. POROSITY BU. O. IN FEW SPOTS SEVERAL BARREN VUGS.
3135-40	LS. GRY. DSE.
3140-44	LS. GRY. SH. LAM.



GORE #7 Luerman
Russell Co., Ks.

28-15-12W

CORE DESCRIPTION

Core #6 3230-3243 Full recovery

3230-32	DOL. LS. SHY. F. X. DSE.
3232-43	DOL. M.C. X/N GRN. SH. LAM. G. VUG. POROSITY BL. O. IN SPOTS 75% SATR.

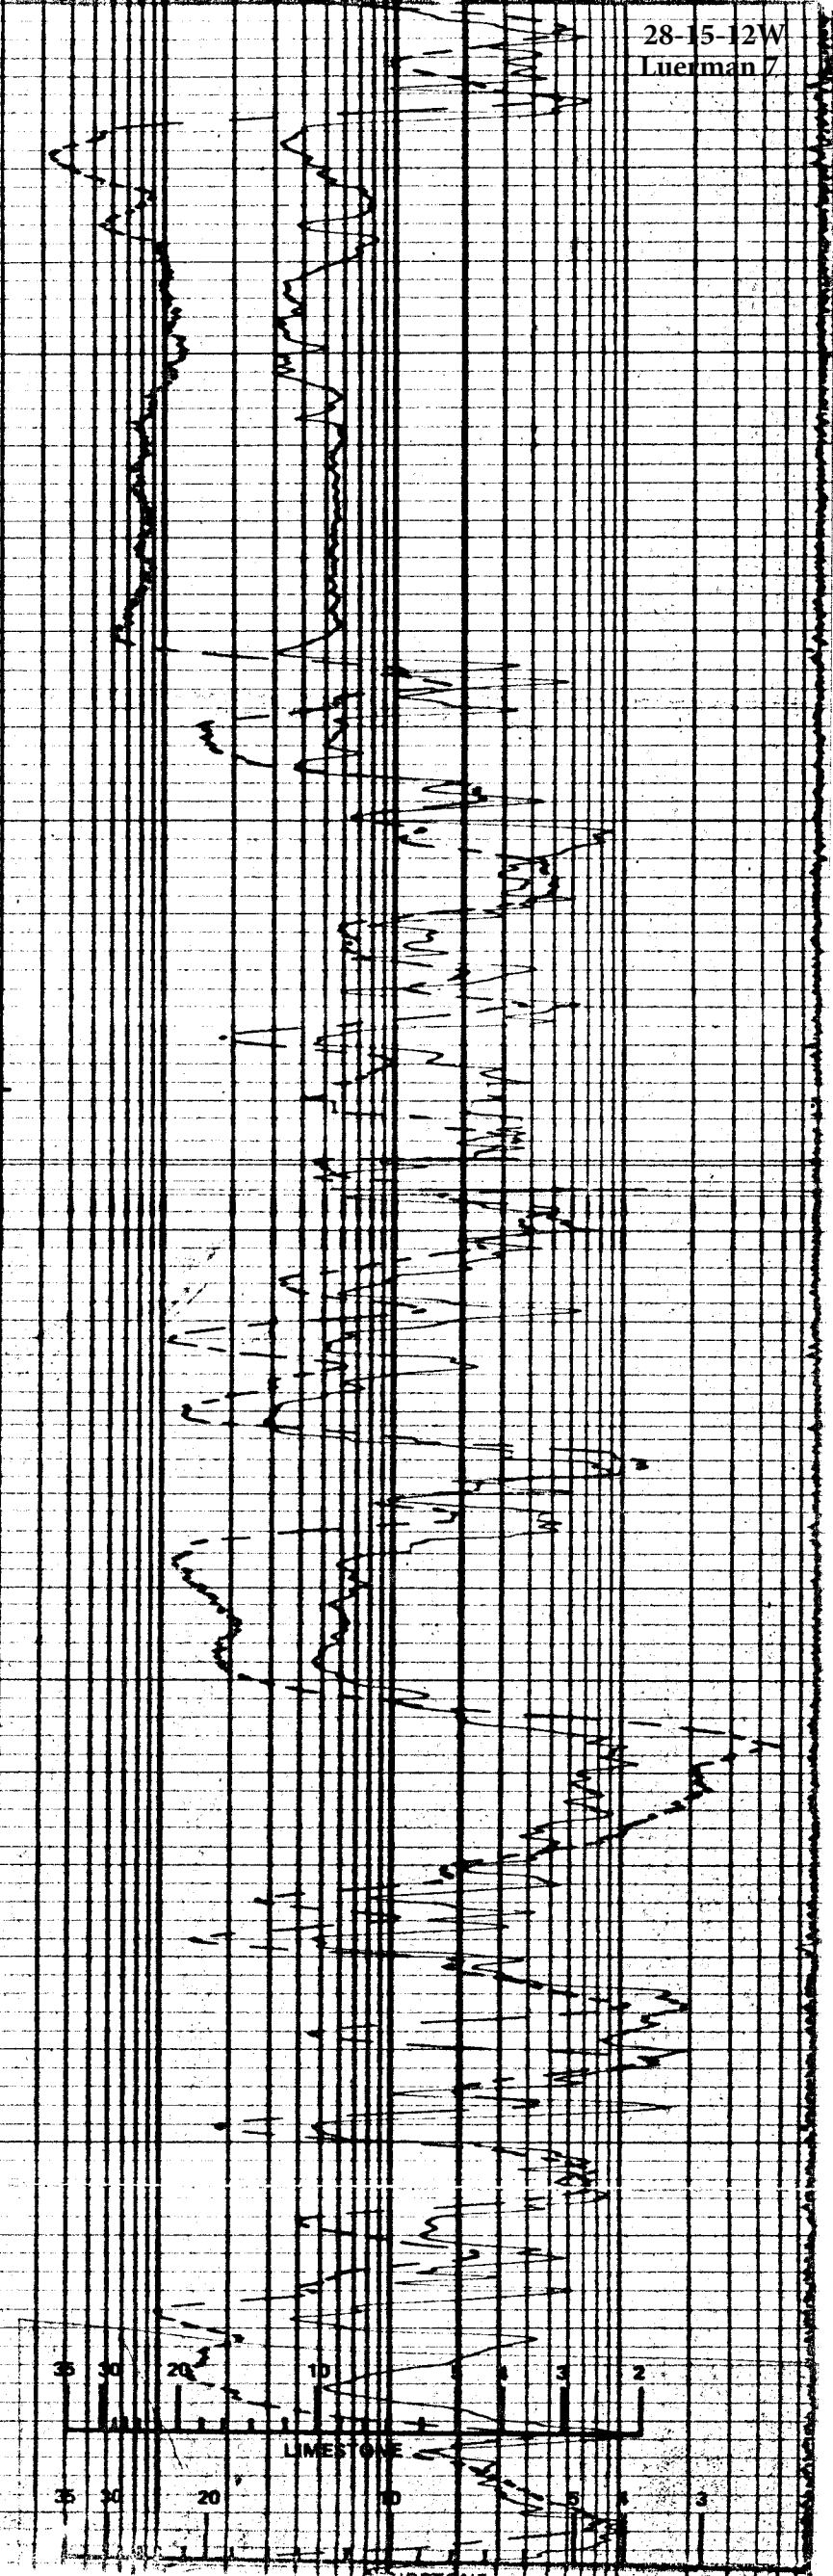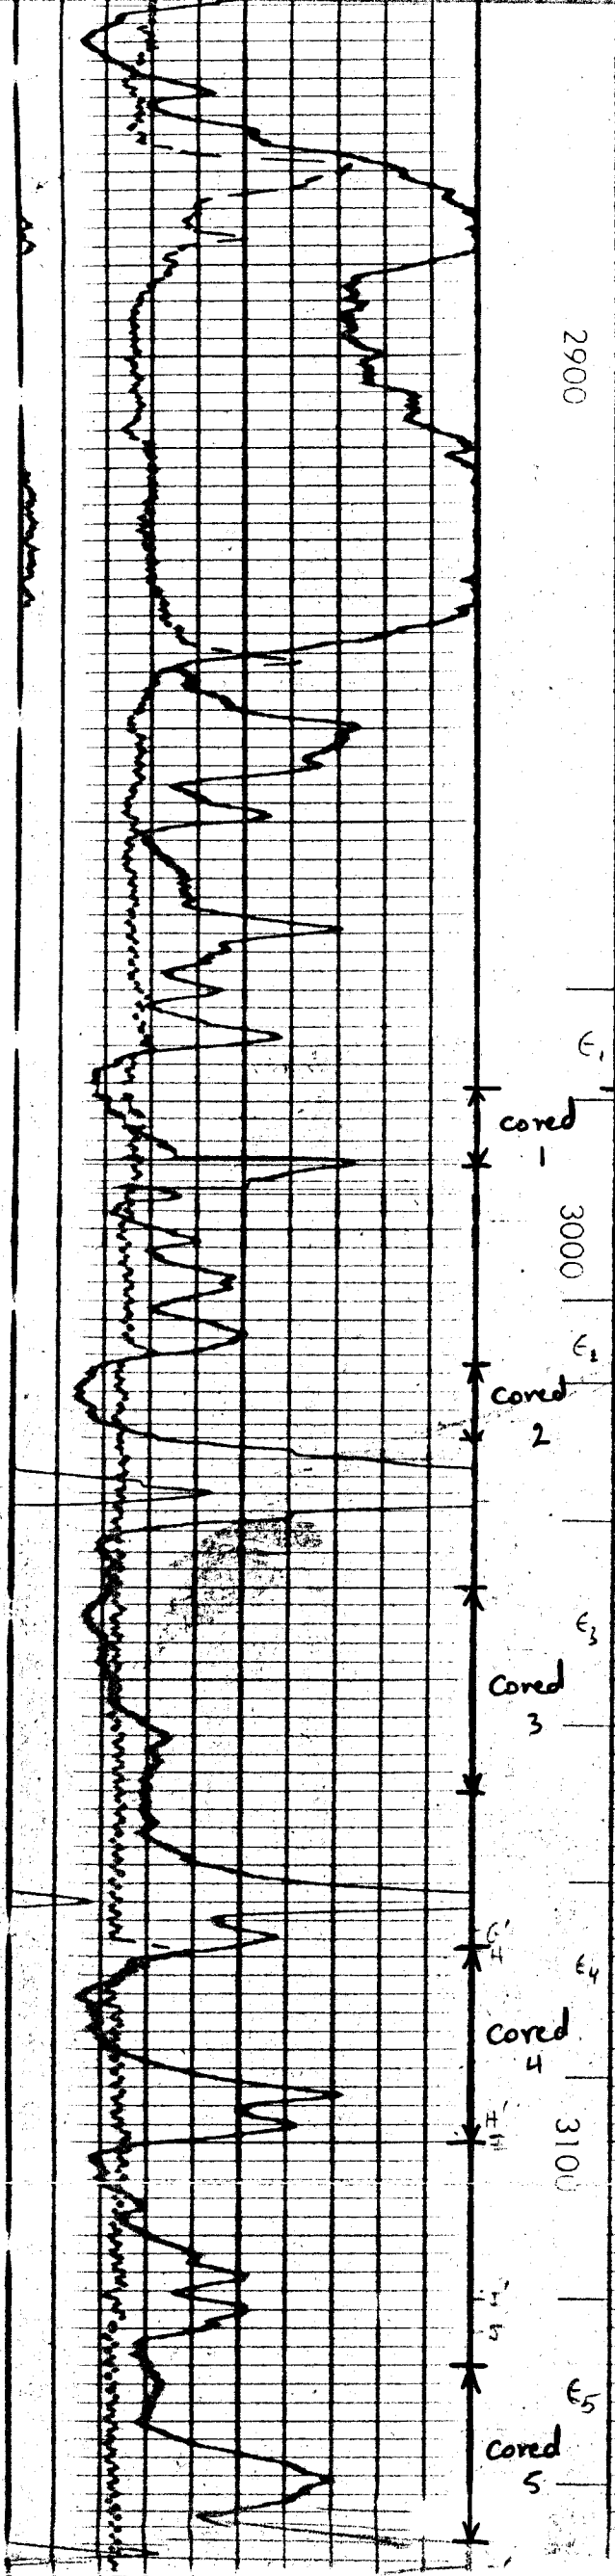



28-15-12W
 Luerman 7

0	120
120	360
GAMMA API Gamma Ray	
4	16

