

3-28W Map No. _____

OPER TILCO, ET AL

WICHITA, KS


WELL #1-B FWY

CONTR LEBEN DRIG CO

FIELD EXT - HANSTON-OPPY FIELD (MISS)

I.P. STATE IPP 56 BOPD + 10% WTR

24 GTY, MAR 4308-28, API 15-083-20060

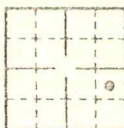

S-T-R 11-22S-23W

SPOT C NE SE

CO HODGEMAN, KS

ELEV 2332 KB

~~2329 EDF~~

2327 64

KB LOG TOPS

ANH 1522 + 810

B/ANH 1551 + 781

HB 3872 -1540

TOR 3888 -1556

DG 3903 -1571

LAN 3929 -1597

BKC 4232 -1900

MAR 4303/41971

FS 4396 -2064

CHER LM 4460 -2128

SHLY MISS

45437-2211

OS 45587-2226

LTD 4577 -2245

TD IN OS FORM

SPUD 11-10-68 8 5/8" 531/300 SX GEOL-FRANK BROOKS

DST 1 (MAR) 4290-4330, OP 70 MIN, REC 150' SOGCM + 60'
HOGCM + 300' MCO + 240' GCMD, ISIP 491#/30 MIN, FP
74-298#, FSIP 384#/30 MIN

DST 2 (MISS) 4530-65 FAILED

DST 3 (MISS) 4557-65, OP 40 MIN, REC 10'M, ISIP 1380#/30
MIN, FP 0-21#, FSIP 1223#/30 MIN

DST 4 (MISS) 4550-77, FAILED

DST 5 (MISS) 4562-77, OP 60 MIN, REC 30' M W/SSO, ISIP
1275#/30 MIN, FP 10-17#, FSIP 1160#/30 MIN

DST 6 (MISS) 4562-84, OP 35 MIN, REC 125' WCM, ISIP 1300#/
30 MIN, FP 100-120#, FSIP 1200#/30 MIN

RTD 4584 LOG 5 1/2" 4398/100 SX

3

MICT CO PERF 16/4324-28 (MAR) SO/NAT, 500 MCA, SWAB
LOAD, SWAB 1.16 BOPH/5 HRS, 2000 A, SWAB PART LOAD, SWAB
1 BOPH/7 HRS, 2000 A, SWAB PART LOAD, NO TESTS, SET BP
4320, PERF 32/4308-16 (MAR) 500 MCA, SWAB PART LOAD, SWAB
1.16 BPPH/2 HRS. + 50% ACID WTR, 5000 A, SWAB PART LOAD, CO
PLUG AT 4320, CO EST 4375, POP, CO P 35 BO + 35 BW/24 HRS,
STATE IPP 56 BOPD + 10% WTR, GTY 24%, MAR 4308-28 COMPLETED
2-4-69 (INFO RELEASED 3-4-69)

KB SPL TOPS

ANH 1522

B/ANH 1551

HB 3871

LAN 3925

MAR 4300

RTD 4584 -2252

(MAR WILL BE NEW PAY - IF INCLUDED IN HANSTON-OPPY FIELD)

COMP ISSUED 3-7-69