



Date 12-26-55
 Ticket No. 52416
 HOWCO DISTRICT
 Kind of Job Open Hole Test
 Price \$ 75.00
 Second Packer Assembly -
 Safety Joint -
 Extra Folder Charge -
 Jars -
 Total \$ 75.00
 Witnessed By Mr. R. Smith
 Tester V. E. Snidle


HOLE AND TOOL DATA

Total Depth	4952'	Casing Perforations	Top - Bottom -
Top Packer Depth	4864'	Bottom Packer Depth	-
Casing or Hole Size	7 7/8"	Liner or Rathole Size	-
Formation Tested	Mississippi		
Size Drill Pipe	4 1/2" API FH	Size Drill Collars	6 3/4"
Size Bottom Choke	3/4"	Size Surface Choke	1"
Size Hook Wall Packer	-	Size Rings	-
Size & Type Wall Packer	6 3/4" ESA	No. Packers	1
Size & Length Anchor	5" x 88'	Blanked Off	Yes
PRD Device No.	1987	Depth	4947'

REMARKS: MISRUN: Packer seat would not hold.
 KBE 2306'

LOCATION Sec. 4-27-20
 FIELD Wildcat
 COUNTY Kiowa
 STATE Kansas
 CONTRACTOR BARBOUR DRILLING CO.
 MUD DATA
 Kind Starch
 Weight 10 lbs.-gal.
 Viscosity 49 Sec.
 Filter Loss 9.6 c. c. Filter Cake 2/32 in.
 Est. Gauge Depth Temp. Calc. 110 F°
 Time Tool Open MISRUN
 Time Closed In. MISRUN
 Depth BT. Gauge 4938'
 BT. P. R. D. No. 196 Blanked Off No
 12 Hr. Clock No. 2055
 Pressure Readings Field Office Corrected
 Initial Hydro Mud Pressure 2654 p.s.i.
 Initial Flow Pres. - p.s.i.
 Final Flow Pres. - p.s.i.
 Closed in Pres. - p.s.i.
 Final Hydro Mud Pressure 2654 p.s.i.

TIME

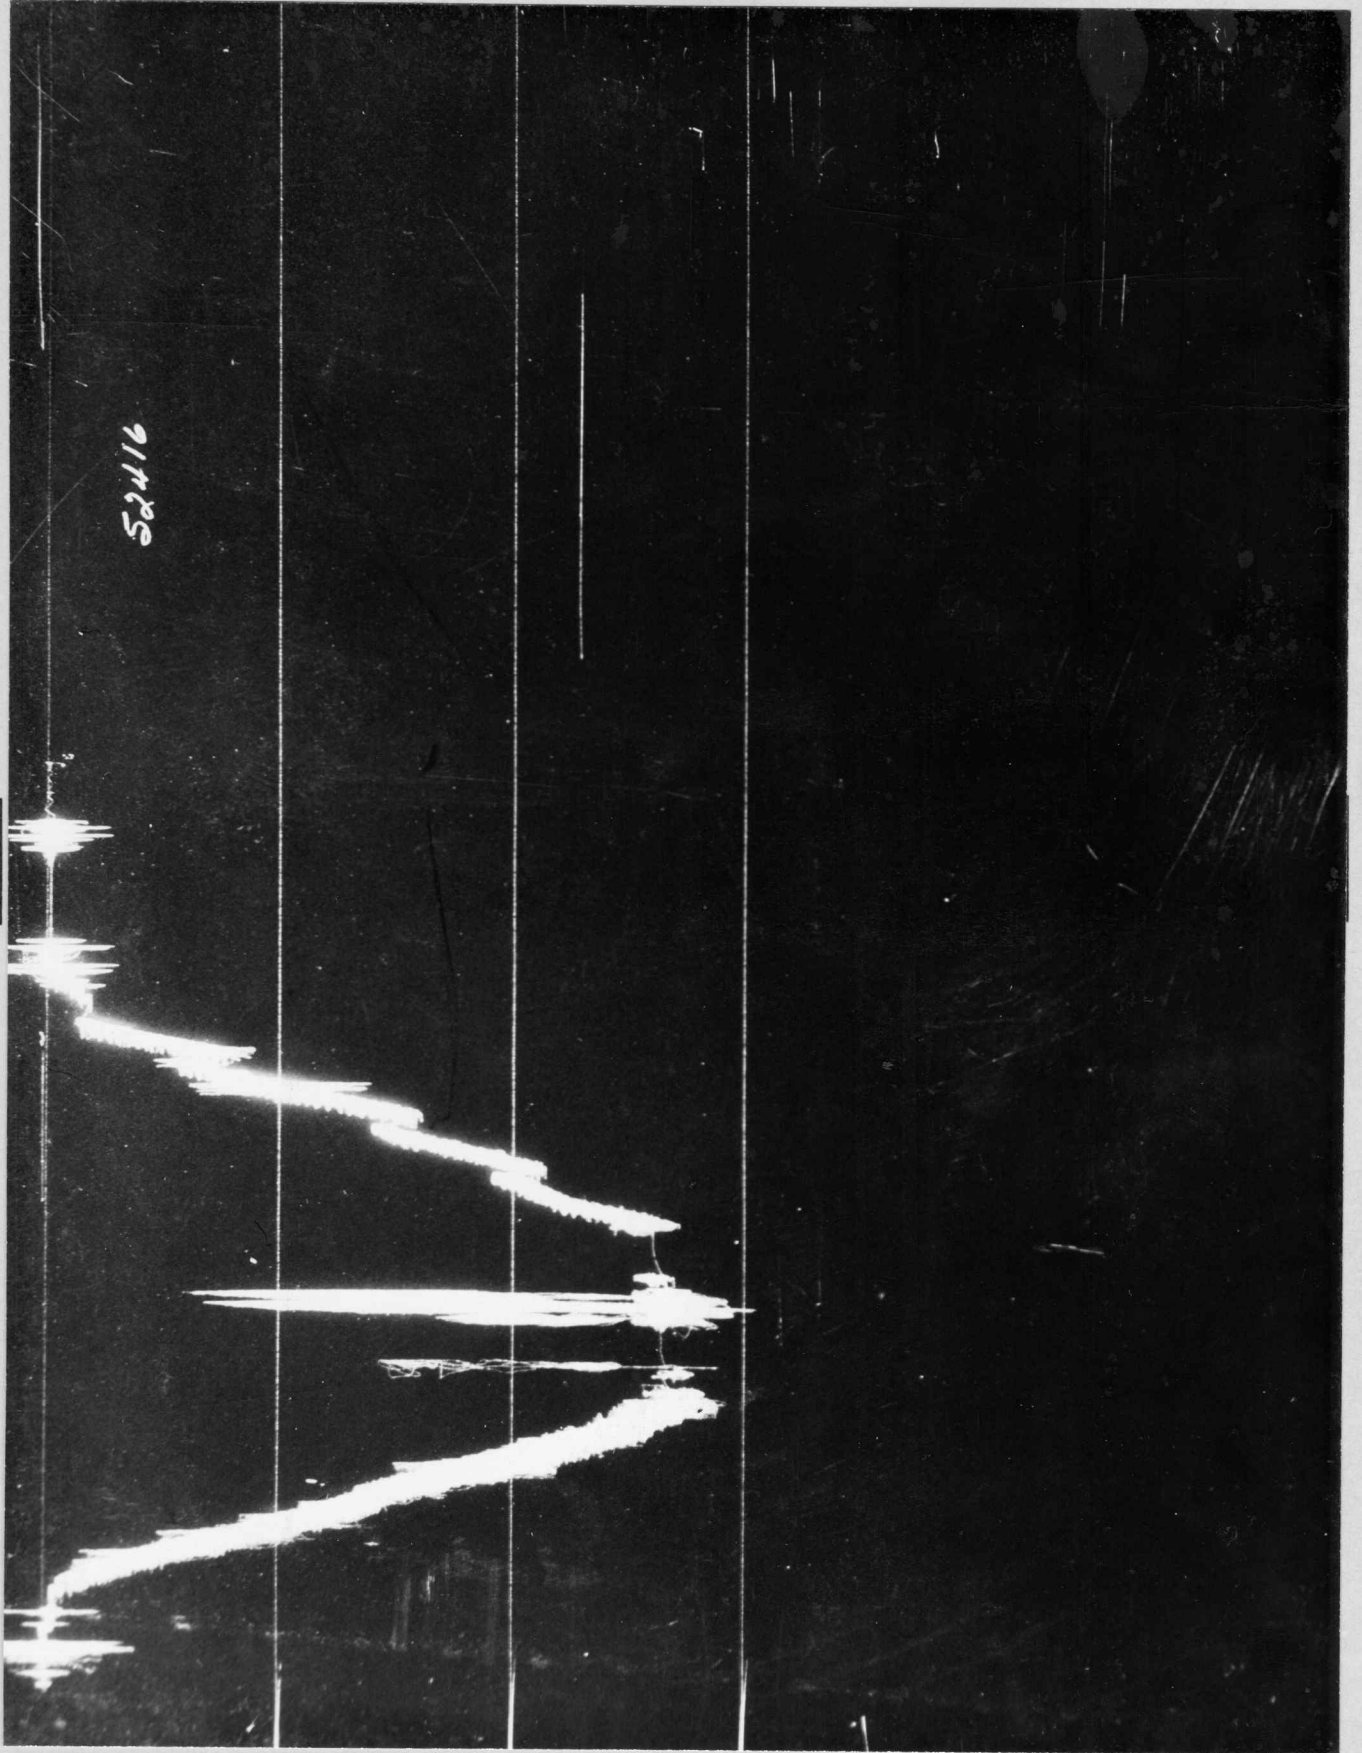

PRESSURE

Each Horizontal Line Equal to 1000 p.s.i.