

CSO2 N WIS

State K.S. Field Sparks
 Company Superior County Stanton
 Farm Neeme No. 1-19
 Sec. 19 Twp. 30 Range 42

Spot CSE
 Contractor COX
 Remarks non test




Comm. 2-1-57 Comp. 2-27-57
 Elev. DF 3581 GL 3570 KB 3583 TD 5477 PB
 Pay D + A

I.P. _____ Press. _____
 Casing Record: 13 3/8 _____ 7"
 20" _____ 10 3/4 _____ 15 1/8 / 800 _____ 5 1/2"
 16" _____ 8 5/8 _____

Loc	Sample	Log
FEB 6		uob 2888
Spud 2-1-57		Elmont 3198
Ø 1550		TOP 3357
FEB 13		hec 3513
Ø 7/4 @ 1518/800		Heeb 3609
Ø 3558		han 3683
FEB 20		MARM 4267
Ø 4950		MOR 5022
FEB 27		sidzone 5302
DST 5389-5449 op 1hr,		" FOR 5389
rec 180'm, F+2720'SW		MISS 5442
(22,000 PPH) FP 460-1310		
BHP 1310/30		
RTD 5477 ran log		

D + A.

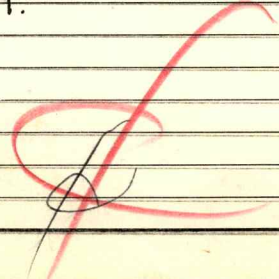

AMARILLO TOPS

3583 KB

Topeka 3196 (~~387~~)

Heebner 3614 (-31)

Lansing 3736 (-153)

Morrow 5032 (-1449)

"S-2" Sd 5192 (-1609) T 8', 0' por, NT

"S-3" Sd 5320 (-1737) T 20', 3' por, NT

Keyes 5358 (-1775) T 74', 60' por, tst'd XW

Chester 5441 (-1858)

TD 5477 (-1894)