


***** OFFSET

State KS Field SPARKS
 Company W. M. GRUENERTWALD County STANTON
 Farm TUCKER No. 1
 Sec. 29 Twp. 30 Range 41

Spot SE

Contractor HOLM

Remarks 5450 MISS.

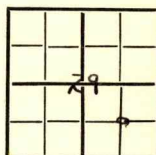

Comm. 8-11-57 Comp. 12-4-57

Elev. DF 3429 GL 3422 KB TD 5400 PB

Pay 5152-62

I.P. COF 1045 MCF Press.

Casing Record: 13 3/8 7"

20" 10 3/4 5 1/2" 5400/2

16" 8 5/8 1570/800

	Sample	Log
WOP	Wab 2952	FLM 3173
AUG 21 3180	TOP 3168	TOP 3334
AUG 28 5000	Heeb 3601	LECO 3492
SEP 4 DST (MOR) 5145-	MOR 4913	Heeb 3608
5252 op l hts 3"	" ssd 5140	TOR 3636
g l 200 MCF 1/2" rec 5' GCM	" POR 5160	LANS 3736
FP 150-110 BHP 1630/20	" sd 5230	MARM 4253
LE 5274 DST 5335-60		MOR 4933
op 1 hr. rec 35' DM		" sd 5152-
FP 0 BHP 200/30		64
RTD 5400 ran log		" " zone 5228
swanning csg.		" " Por 5390-
SEP 11 540		54
RUCT Co 3 5152-62	} CORR.	MISS 5375
Pf 300/40 5252-65		
g l, 686 MCF MA/250	g l, 115 MCF	
FR/6000 sd/3000	NO INCREASE	
1 hr. BP g l, 1000 MCF	SI	
SEP 18	SEP 25 frac went into wrong zone	
OCT 2	will sq and re-treat	
OCT 9	OCT 16	OCT 23
NOV 6	NOV 13	NOV 20

NOV 27

DEC 4

~~1st~~
~~1st~~ ~~1st~~ CoF 1,045 MCF
FCP

AMARILLO TOPS

3431 KB

Topeka 3174 (-257)

Heebner 3615 (-184)

Lansing 3738 (-307)

Morrow 4932 (-1501) T 422', 44' Tss

"S-2" Sd 5150 (-1719) T 15', 12' por, G 1,045 MCF

"S-3" Sd 5278 (-1847) T 5', 0' por, NT

Keyes 5306 (-1875) T 14', 0' por, NT

Keyes 5344 (-1913) T 10', 4' por, NS

Chester 5354 (-1923)

TD 5401 (-1970)