


State K.S. Field unnamed
 Company PEPL County Monter
 Farm Cummins No. 1-14
 Sec. 14 Twp. 31 Range 41

Spot CSE NW

Contractor Canvey

Remarks MISS

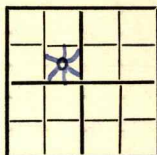

Comm. 4-14-57 Comp. 4-16-58

Elev. DF 3374 GL 3368 KB TD 5577 PB 5374

Pay 5359-69 10. MOR

3. I.P. 866 MCF Press. none avail.

Casing Record: 13 3/8 7"

20" 10 3/4 5 1/2" 5472/125

16" 8 5/8 1528/850

	Sample	Log
Ø 1375	<u>LIBERAL</u>	<u>KAI 2187</u>
<u>APR 24</u>	<u>KP 2186 + 1188</u>	<u>min 2246</u>
<u>8 5/8</u>	<u>W 2245 + 1129</u>	<u>wab 2906</u>
<u>Ø 3410</u>	<u>GG 2480 + 894</u>	<u>TOP 3178</u>
<u>MAX 44510</u>		<u>CSO lam 3531</u>
<u>MAY 8 DST 5162-90 OP45</u>		<u>han 3768</u>
<u>REL 5119cm FP 0. BHP 150/10</u>		<u>max 4340</u>
<u>DST (STPK) 5358-73 op 1 1/2</u>		<u>clm 4526</u>
<u>REL 5409 1/2 DP + 30' 9cm,</u>		<u>MOR 5028</u>
<u>FP ? BHP ?</u>		<u>5d 5142-63</u>
<u>Ø ahead</u>		<u>5310-21</u>
<u>MAY 15 DST 5384-5420</u>		<u>5357-73</u>
<u>op 1 1/4 35' + STM REL</u>		<u>5381-5406</u>
<u>210' 59cm + 240' 3W</u>		<u>MISS 5464</u>
<u>FP 70-200 No BHP</u>		<u>-2090</u>
<u>RTD 5577 run log</u>		
<u>5 1/2 @</u>		

MAY 22 RUCT CO. P/B 5391-93 Swab 3960ph
Pf 12/5388-91, Swab water, A/500
Swab 1759wph + S.G. prep sq.
MAY 28 sq/5388-93/300 CO 5374 PF40/
5359-69 A/500 Swab 5577 g 171MIE
A1000 g 388 + AW + ST

Topeka 3179 (~~1~~89)
Heebner 3642 (-274)
Lansing 3760 (-392)
Morrow 5008 (-1640) T 457', 70' Tss
"S-2" Sd 5144 (-1776) T 19', por 18', tst'd SSG?
"S-3" Sd 5310 (-1942) T 11', por 8', NT
Keyes 5358 (-1990) T 16', por 9', $\emptyset$ 866 MCF
Keyes 5382 (-2014) T 24', por 20', tst'd SSG $\neq$ XW
Chester 5465 (-2097)
St. Gen 5510 (-2142)
TD 5573 (-2205)