

Notice: Fill out COMPLETELY and return to Conservation Division at the address below within 60 days from plugging date.

KANSAS CORPORATION COMMISSION
OIL & GAS CONSERVATION DIVISION
WELL PLUGGING RECORD
K.A.R. 82-3-117

Form CP-4
December 2003
Type or Print on this Form
Form must be Signed
All blanks must be Filled

Lease Operator: Herman L Loeb
Address: PO Box 524 Lawrenceville, IL 62439
Phone: (812) 853-3813 Operator License #: 3273
Type of Well: SWD Docket #: D-19460
(Oil, Gas D&A, SWD, ENHR, Water Supply Well, Cathodic, Other) (If SWD or ENHR)
The plugging proposal was approved on: 4-9-04 4-14-04 (Date)
by: Steve Middleton (KCC District Agent's Name)
Is ACO-1 filed? Yes No If not, is well log attached? Yes No
Producing Formation(s): List All (If needed attach another sheet)
KC Depth to Top: 4055 Bottom: 4075 T.D. _____
Miss. Depth to Top: 4512 Bottom: 4542 T.D. 4565
Depth to Top: _____ Bottom: _____ T.D. 4606

15-007-01267-00
API Number: 15-N/A Drilled 10/55
Lease Name: WIA Newkirk
Well Number: # 16
Spot Location (QQQQ): ne - ne - SW -
2200 Feet from North / South Section Line
2200 Feet from East / West Section Line
Sec. 20 Twp. 33 S. R. 11 East West
County: Barber
Date Well Completed: 13
Plugging Commenced: 4-09-04
Plugging Completed: 4-13-04

Show depth and thickness of all water, oil and gas formations.

Oil, Gas or Water Records		Casing Record (Surface Conductor & Production)				
Formation	Content	From	To	Size	Put In	Pulled Out
<u>surf</u>			<u>259</u>	<u>8 5/8</u>	<u>259</u>	<u>0</u>
<u>Rio d</u>			<u>4606</u>	<u>5 1/2</u>	<u>4609-4606</u>	<u>2200</u>

Describe in detail the manner in which the well is plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug set.

Laydown duraline tbg and pkr. Run 5 1/2 scraper to 4350' Lay down work string. Set CIBP @ 4330' and dump 2 sxs portland cement with dump bailor. Set another CIBP @ 3998' dump 2 more sxs portland cement. Stretch and cut csg @ 2200'. Lay down csg. Run 2 7/8 tbg to 598', RU Allied and pump 10 sxs jel, and 50 sxs cement, pull tbg to 290' and spot 50 sxs cement pull tbg to 60' and circ cement to surface 60/40 6% jel


Name of Plugging Contractor: Clarke Corp License #: 5105
Address: 107 w Fowler, Medicine Lodge ks 67104
Name of Party Responsible for Plugging Fees: Herman L Loeb
State of Kansas County, Barber, ss.

RECEIVED
APR 27 2004
KCC WICHITA

(Employee of Operator) or (Operator) on above-described well, being first duly sworn on oath, says: That I have knowledge of the facts statements, and matters herein contained, and the log of the above-described well is as filed, and the same are true and correct, so help me God.

(Signature) Alan Vantel

(Address) 509 N cedar, medicine Lodge KS

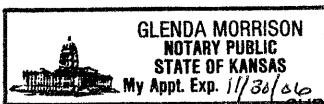

SUBSCRIBED and SWORN TO before me this 14 day of April, 2004

Glenda Morrison My Commission Expires: 11/30/06
Notary Public

Mail to: KCC - Conservation Division, 130 S. Market - Room 2078, Wichita, Kansas 67202

Handwritten mark