

Notice: Fill out COMPLETELY and return to Conservation Division at the address below within 60 days from plugging date.

KANSAS CORPORATION COMMISSION
OIL & GAS CONSERVATION DIVISION
WELL PLUGGING RECORD
K.A.R. 82-3-117

Form CP-4
December 2003
Type or Print on this Form
Form must be Signed
All blanks must be Filled

Lease Operator: Questa Energy Corp
Address: P.O. Box 19297 Amarillo, TX 79114
Phone: (806) 358-8161 Operator License #: 03062
Type of Well: gas Docket #: _____
(Oil, Gas D&A, SWD, ENHR, Water Supply Well, Cathodic, Other) (If SWD or ENHR)
The plugging proposal was approved on: _____ (Date)
by: _____ (KCC District Agent's Name)
Is ACO-1 filed? Yes No If not, is well log attached? Yes No
Producing Formation(s): List All (If needed attach another sheet)
_____ Depth to Top: 5302' Bottom: 5308' T.D. 5483'
_____ Depth to Top: _____ Bottom: _____ T.D. _____
_____ Depth to Top: _____ Bottom: _____ T.D. 5260'

API Number: 15-119-20389-00-00
Lease Name: Edwards
Well Number: # 1
Spot Location (QQQQ): _____ - C - SW - NW
1980 Feet from North / South Section Line
660 Feet from East / West Section Line
Sec. 36 Twp. 31 S. R. 28 East West
County: Meade
Date Well Completed: 4/28/80
Plugging Commenced: 12/13/2004
Plugging Completed: 12/16/2004

Show depth and thickness of all water, oil and gas formations.

Oil, Gas or Water Records		Casing Record (Surface Conductor & Production)				
Formation	Content	From	To	Size	Put In	Pulled Out
		Surface	1414'	8 5/8"	1414'	none
		Surface	5397'	4 1/2"	5397'	2739'

RECEIVED
JAN 10 2005
KCC WICHITA

Describe in detail the manner in which the well is plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug set.


POH w/ tbg & Pkr . RU wireline trk & set 4 1/2" CIBP @ 5250' & cap w/ 2 sks cement. Run tbg @ 4050' & spot 50 sks cement to cover csg leak @ +/- 4000' . POH & WOC . Load & test csg w/ 50 bbl drilling mud @ 500 psi. Cut & pull 4 1/2 casing from 2739'. Run tbg @ 1430' & spot 50 sks cement up to 1265' . Pull up hole @ 500' & spot 40 sks cement up to 370'
POH w/ tbg & top out 40' to surface w/ 12 sks cement . Dig out & cut off csg 4' below ground & weld ID plate.

Name of Plugging Contractor: Orr Enterprises, Inc. License #: 33338
Address: P.O. Box 1706 Duncan, OK 73534
Name of Party Responsible for Plugging Fees: Questa Energy Corporation
State of Texas County, Randall, ss.

Dale W. Rufenacht (Employee of Operator) or (Operator) on above-described well, being first duly sworn on oath, says: That I have knowledge of the facts statements, and matters herein contained, and the log of the above-described well is as filed, and the same are true and correct, so help me God.

(Signature) Dale W Rufenacht
(Address) P. O. Box 19297, Amarillo, TX 79114

SUBSCRIBED and SWORN TO before me this 6 day of January, 2005
Pam Killian My Commission Expires: 8/25/05
Notary Public

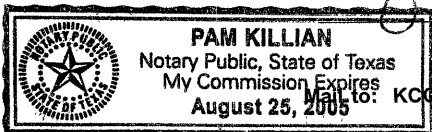

Mail to: KCC - Conservation Division, 130 S. Market - Room 2078, Wichita, Kansas 67202

Bo