

15-163-00116-00-01

STATE OF KANSAS
STATE CORPORATION COMMISSION


Form CP-4

Give All Information Completely
Make Required Affidavit
Mail or Deliver Report to:
Conservation Division
State Corporation Commission
212 No. Market
Wichita, Kansas

WELL PLUGGING RECORD

Rocks _____ County. Sec. 32 Twp. 6 Rge. 17 (E) _____ (W) X

NORTH

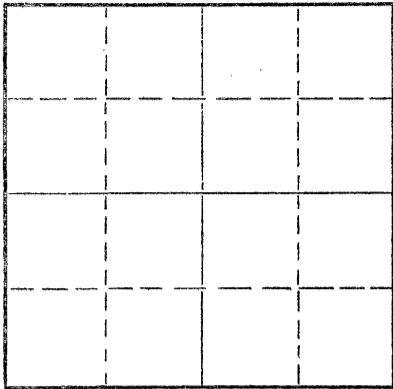

Locate well correctly on above
Section Plat

Location as "NE/CNW $\frac{1}{4}$ SW $\frac{1}{4}$ " or footage from lines SE SE SE
Lease Owner Armstrong - Jackman - Aspen
Lease Name Wagner Well No. 1
Office Address 915 Century Plaza Building Wichita, Kansas 67202
Character of Well (completed as Oil, Gas or Dry Hole) _____
Date well completed _____ 19____
Application for plugging filed 12-26-69 19____
Application for plugging approved 12-27-69 19____
Plugging commenced 12-29-69 19____
Plugging completed 1-3-70 19____
Reason for abandonment of well or producing formation _____

If a producing well is abandoned, date of last production _____ 19____
Was permission obtained from the Conservation Division or its agents before plugging was commenced? Yes

Name of Conservation Agent who supervised plugging of this well Leo F. Massey
Producing formation _____ Depth to top _____ Bottom _____ Total Depth of Well 3347 Feet
Show depth and thickness of all water, oil and gas formations.

OIL, GAS OR WATER RECORDS

CASING RECORD

FORMATION	CONTENT	FROM	TO	SIZE	PUT IN	PULLED OUT
				10 3/4	354	None
				5 1/2	None	2093

1-13-70

RECEIVED
STATE CORPORATION COMMISSION
JAN 13 1970
CONSERVATION DIVISION
Wichita, Kansas

Describe in detail the manner in which the well was plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used, state the character of same and depth placed, from _____ feet to _____ feet for each plug set.

Moved rig on location. Put up pole. Set plug at 2940' and dumped 30' of sand. Rigged up jacks and took slips out of braden head. Worked pipe - had 16" stretch at 2500 psi or 110,000 lbs.

Dumped 5 sacks of cement on bottom with dump bailer. Working pipe - no change in stretch. Shot pipe at 2210' and 2105'. Worked pipe loose. Pulled 38 joints of 5 1/2" casing.

Dakota water flowing out of 5 1/2" casing - tried to get swedge on but had to get 5 1/2" orbit valve. Dowell pumped weight mud down pipe to kill water flow.

Pulled 29 joints of 5 1/2" casing. Tore down unit and loaded equipment. Cleaned cellar out and put swedge on 10 3/4. Moved rig off location.

Globe Cementing Company pumped 15 sacks of gel and 180 sacks of 60/40 pozmix into 10 3/4.

(If additional description is necessary, use BACK of this sheet)

Name of Plugging Contractor Forbes Casing Pulling Company, Inc.
Address P. O. Box 221 Great Bend, Kansas 67530

STATE OF Kansas, COUNTY OF Barton, ss.

James W. Rockhold (employee of owner) or (owner or operator) of the above-described well, being first duly sworn on oath, says: That I have knowledge of the facts, statements, and matters herein contained and the log of the above-described well as filed and that the same are true and correct. So help me God.

(Signature)

James W. Rockhold
P. O. Box 221 Great Bend, Kansas

(Address)

SUBSCRIBED AND SWORN to before me this 9 day of January, 19 70

My Commission expires May 27, 1973

Notary Public.

