


Give All Information Completely
Make Required Affidavit
Mail or Deliver Report to:
Conservation Division
State Corporation Commission
211 No. Broadway
Wichita, Kansas

WELL PLUGGING RECORD

NORTH

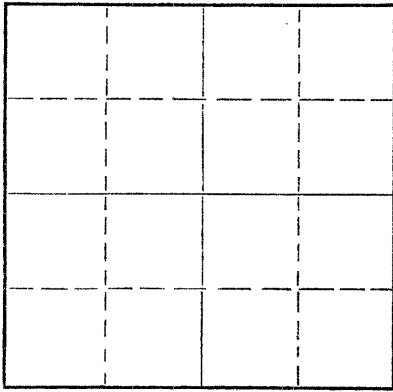

Locate well correctly on above
Section Plat

Graham County. Sec. 30 Twp. 6 Rge. (E) 25 (W)
Location as "NE/CNW $\frac{1}{2}$ SW $\frac{1}{2}$ " or footage from lines NW/Se/NW
Lease Owner Jones, Shelburne, & Farmer, Inc.
Lease Name Tedro Well No. 2
Office Address Russell, Kansas
Character of Well (completed as Oil, Gas or Dry Hole) Dry
Date well completed _____ 19____
Application for plugging filed _____ 19____
Application for plugging approved _____ 19____
Plugging commenced _____ 2-25 1956
Plugging completed _____ 3-8 1956
Reason for abandonment of well or producing formation _____
If a producing well is abandoned, date of last production _____ 19____
Was permission obtained from the Conservation Division or its agents before plugging was commenced? Yes

Name of Conservation Agent who supervised plugging of this well MA. Rives
Producing formation _____ Depth to top _____ Bottom _____ Total Depth of Well 3885' Feet
Show depth and thickness of all water, oil and gas formations.

OIL, GAS OR WATER RECORDS

CASING RECORD

FORMATION	CONTENT	FROM	TO	SIZE	PUT IN	PULLED OUT

Describe in detail the manner in which the well was plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used, state the character of same and depth placed, from _____ feet to _____ feet for each plug set.

Plugging started 2-25-56 and completed 3-8-56. Measured in to TD 3885' and put in 45' of sand and 5 sacks of cement. Shot casing off at 3140' and pumped in 25 sacks of aqua gel mud and 5 sacks of hulls. Shot casing off at 1000' and pulled pipe out of hole. Plugged well as follows: Filled hole with heavy mud to 320'; set permanent rock bridge and dumped in 15 sacks of cement. Filled hole with heavy mud to 35' of top and dumped in 10 sacks of cement for cap on well.

(If additional description is necessary, use BACK of this sheet)

Name of Plugging Contractor J. O. FORBES d/b/a FORBES CASING PULLING CO.
Address P. O. Box 221, Great Bend, Kansas

STATE OF Kansas, COUNTY OF Russell, ss.
JOHN O. FARMER (employee of owner) or (owner or operator) of the above-described well, being first duly sworn on oath, says: That I have knowledge of the facts, statements, and matters herein contained and the log of the above-described well as filed and that the same are true and correct. So help me God.

(Signature) John O. Farmer
Russell, Kansas (Address)

SUBSCRIBED AND SWORN TO before me this 14th day of March, 19 56

My commission expires October 11, 1958

Lucille Funder
Notary Public.

PLUGGING
FILE SEC 30 T 6 R 25 W
BOOK PAGE 35 LINE 33

MAR 11 1956
CONSERVATION
WICHITA, KANSAS
3-8-56