

Notice: Fill out COMPLETELY
and return to Conservation Division
at the address below within
60 days from plugging date.

KANSAS CORPORATION COMMISSION
OIL & GAS CONSERVATION DIVISION
WELL PLUGGING RECORD
K.A.R. 82-3-117

Form CP-4
December 2003
Type or Print on this Form
Form must be Signed
All blanks must be Filled

Lease Operator: AX&P Inc.
Address: PO Box 1176 Independence, KS 67301
Phone: (620) 331-0144 Operator License #: 3830
Type of Well: Oil Docket #: _____
(Oil, Gas D&A, SWD, ENHR, Water Supply Well, Cathodic, Other) (If SWD or ENHR)
The plugging proposal was approved on: 12/28/04 (Date)
by: Allen Dunning (KCC District Agent's Name)
Is ACO-1 filed? ☐ Yes ☒ No If not, is well log attached? ☐ Yes ☒ No
Producing Formation(s): List All (If needed attach another sheet)
Bartlesville Depth to Top: NA Bottom: NA T.D. +/- 800'

Depth to Top: _____ Bottom: _____ T.D. _____

Depth to Top: _____ Bottom: _____ T.D. _____

15-205-19379-00-00
API Number: 15 - NA
Lease Name: Johnson
Well Number: 01
Spot Location (QQQQ): NW - NW - NW - SE
2632 Feet from ☐ North / ☒ South Section Line
2498 Feet from ☒ East / ☐ West Section Line
Sec. 28 Twp. 30 S. R. 16 ☒ East ☐ West
County: Wilson
Date Well Completed: NA
Plugging Commenced: 12/28/04
Plugging Completed: 3/28/05

Show depth and thickness of all water, oil and gas formations.

Oil, Gas or Water Records		Casing Record (Surface Conductor & Production)				
Formation	Content	From	To	Size	Put In	Pulled Out
		Surface	20'	7"	Cemented	To Surface
Bartlesville	Oil & Water	Surface	+/- 800'	2"	Rag Packer?	


Describe in detail the manner in which the well is plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug set.

Ran 1" pipe to 775' inside 2" pipe. Wash well for perforating. Pull 1" pipe, well perforated, ran 1" pipe in to 775'. Circulate gel and spot 10 sacks of cement. Pull 1" pipe out. Ran in 250' of 1" pipe inside 2" pipe. Circulate cement to surface. Pull 1" pipe, top off with cement. Dig out and cut off casing.

Total sacks of cement - 82

Name of Plugging Contractor: Rick's Well Service License #: 33422
Address: PO Box 268 129 Railroad Cherryvale, Kansas 67335
Name of Party Responsible for Plugging Fees: AX&P Inc.
State of Kansas County, Wilson, ss. CHANUTE, KS
Rick Housel - Agent

(Employee of Operator) or (Operator) on above-described well, being first duly sworn on oath, says: That I have knowledge of the facts statements, and matters herein contained, and the log of the above-described well is as filed, and the same are true and correct, so help me God.

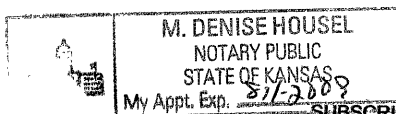

(Signature) Rick Housel - Agent
(Address) _____
SUBSCRIBED and SWORN TO before me this 26th day of August, 2005
M. Denise Housel My Commission Expires: 8/1-2008
Notary Public

Mail to: KCC - Conservation Division, 130 S. Market - Room 2078, Wichita, Kansas 67202

PFS