

Notice: Fill out COMPLETELY and return to Conservation Division at the address below within 60 days from plugging date.

KANSAS CORPORATION COMMISSION  
OIL & GAS CONSERVATION DIVISION  
**WELL PLUGGING RECORD**  
K.A.R. 82-3-117

Form CP-4  
December 2003  
Type or Print on this Form  
Form must be Signed  
All blanks must be Filled

Lease Operator: Berexco, Inc.  
Address: PO Box 723 Hays KS 67601  
Phone: (785) 628-6101 Operator License #: 5363  
Type of Well: Oil Docket #: \_\_\_\_\_  
(Oil, Gas D&A, SWD, ENHR, Water Supply Well, Cathodic, Other) (If SWD or ENHR)  
The plugging proposal was approved on: 8-11-06 (Date)  
by: Jay Pfeifer (KCC District Agent's Name)  
Is ACO-1 filed?  Yes  No If not, is well log attached?  Yes  No  
Producing Formation(s): List All (If needed attach another sheet)  
ARB Depth to Top: 3840 Bottom: 3849 T.D. 3849  
LKC Depth to Top: 3534 Bottom: 3793 T.D. \_\_\_\_\_  
Depth to Top: \_\_\_\_\_ Bottom: \_\_\_\_\_ T.D. \_\_\_\_\_

API Number: 15-163-03139-00-00  
Lease Name: Glick  
Well Number: 1  
Spot Location (QQQQ): NW1/4 - NW1/4 - NE1/4 - 8/23106  
4950 Feet from  North /  South Section Line *KCC PKT per CP213*  
2310 Feet from  East /  West Section Line  
Sec. 4 Twp. 10 S. R. 20  East  West  
County: Rooks  
Date Well Completed: 9-23-1948  
Plugging Commenced: 8-10-06  
Plugging Completed: 8-11-06

Show depth and thickness of all water, oil and gas formations.

Oil, Gas or Water Records		Casing Record (Surface Conductor & Production)				
Formation	Content	From	To	Size	Put In	Pulled Out
ARB	oil	0	218'	8-5/8	9-23-1948	----
		0	3841'	5-1/2	9-23-1948	-----


Describe in detail the manner in which the well is plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used, state the character of same depth placed from (bottom), to (top) for each plug set.  
Shot 2 holes @ 2200', 1760', and 975'. Run 99 jts of 2-3/8 tbg open ended to 3021'. Mix 115 sks 60/40 pos 10% gel w/ 400# hulls. Circ to surface.  
Pull 50 jts to 1507'. Mix 125 sks 60/40 pos 10%gel w/ 200# hulls. Pull tbg, hook to 5-1/2. Mix 15 sks 60/40 pos 10% gel  
Max pressure 600# shut in pressure 500#. Hook to surface pipe 100# instant pressure. Didn't get any cement in.

Name of Plugging Contractor: Berexco, Inc Lic # 5363  
Address: PO Box 723 Hays, KS 67601  
Name of Party Responsible for Plugging Fees: Bob Grant - Berexco, Inc  
State of KS County, Ellis, ss. \_\_\_\_\_  
(Employee of Operator) or (Operator) on above-described well, being first duly

RECEIVED  
AUG 21 2006  
KCC WICHITA

sworn on oath, says: That I have knowledge of the facts statements, and matters herein contained, and the log of the above-described well is as filed, and the same are true and correct, so help me God.

(Signature) Robert A Grant  
(Address) PO Box 723 Hays, KS 67601

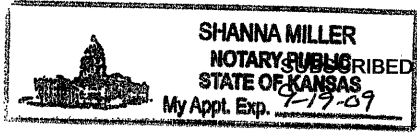

Subscribed and SWORN TO before me this 17 day of August, 20 06  
Shanna Miller My Commission Expires: 9-19-09  
Notary Public

Mail to: KCC - Conservation Division, 130 S. Market - Room 2078, Wichita, Kansas 67202

PKT