


STATE OF KANSAS
STATE CORPORATION COMMISSION

Form CP-4

WELL PLUGGING RECORD

Give All Information Completely
Make Required Affidavit
Mail or Deliver Report to:
Conservation Division
State Corporation Commission
P. O. Box 17027
Wichita, Kansas 67217
NORTH

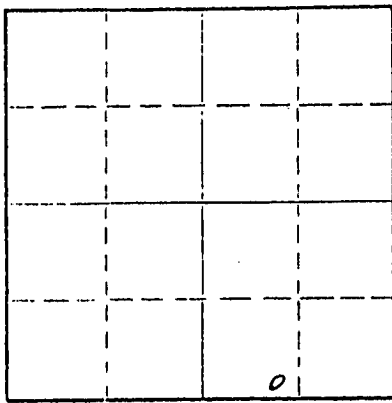

Locate well correctly on above
Section Plat

Rooks _____ County, Sec 35 Twp 10S Rge. (E) 17 (W)
Location as "NE/CNWESW" or footage from lines SE-SW-SE
Lease Owner Champlin Petroleum Company
Lease Name Brungardt (Unit Well #9) Well No. 8
Office Address P. O. Box 1678, Oklahoma City, Okla. 73101
Character of Well (completed as Oil, Gas or Dry Hole) Oil
Date well completed 4-3 1953
Application for plugging filed 2-4 1972
Application for plugging approved 2-9 1972
Plugging commenced 4-4 1972
Plugging completed 4-4 1972
Reason for abandonment of well or producing formation depleted production
If a producing well is abandoned, date of last production 10-4 1964
Was permission obtained from the Conservation Division or its agents before plugging was commenced? Yes

Name of Conservation Agent who supervised plugging of this well Leo Massey, Box 582, Hays, Kansas 67526
Producing formation Conglomerate Depth to top 3482 Bottom 3502 Total Depth of Well 3590 Feet
Show depth and thickness of all water, oil and gas formations.

OIL, GAS OR WATER RECORDS

CASING RECORD

FORMATION	CONTENT	FROM	TO	SIZE	PUT IN	PULLED OUT
Conglomerate	Oil	3482	3502	8-5/8"	120	None
				5 1/2"	3589	None

Describe in detail the manner in which the well was plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used, state the character of same and depth placed, from _____ feet to _____ feet for each plug set.

On 4-4-72 ran 104 jts. 2-3/8" tubing to 3178'. Mixed and pumped 25 sacks gel and 1 sack of hulls followed by 25 sacks of Halliburton Light Cement. Cement plug from 2928' to 3178'. Mud from 510 to 2928'. Pulled 2668' of tubing to 510'. Mixed and pumped 55 sacks of Halliburton Light Cement. Pulled remaining tubing. Cement plug from 510' to surface. Could not pump any cement in annulus between 5 1/2" and 8-5/8" casing. Well plugged and abandoned at 12:00 noon on 4-4-72.

RECEIVED
STATE CORPORATION COMMISSION
4-11-72
APR 11 1972
CONSERVATION DIVISION
Wichita, Kansas

(If additional description is necessary, use BACK of this sheet)
Name of Plugging Contractor Bills Well Service and Halliburton
Address Box 42, Codell, Kansas

STATE OF Oklahoma COUNTY OF Oklahoma, ss.

Harold E. Melvin (employee of owner) or (~~OWNER REPRESENTATIVE~~) of the above-described well, being first duly sworn on oath, says: That I have knowledge of the facts, statements, and matters herein contained and the log of the above-described well as filed and that the same are true and correct. So help me God.

(Signature) Harold E Melvin
P. O. Box 1678, Okla. City, Okla. 73101
(Address)

Subscribed and Sworn to before me this 10th day of April, 1972

My commission expires 10-8-75
Mary A. Owens Notary Public.

Rocks

35

108

17W

Champlin Refining Company

Box 52 - Enid, Oklahoma

Brungardt

(8) Unit # 9

330' from South Line & 1790' from East Line SE/4

or SE/4 of the SW/4 of the SE/4 of Section 35

Oil

March 11, 1953

April 3, 1953

8-5/8" 22.7#	Spiral Weld Amco	120'	75 Sacks
5-1/2" 14#	8 Hd National	3589'	150 Sacks
2-1/2" EUE 6.5#	National	3564	

RECEIVED
 STATE CORPORATION COMMISSION
 FEB 7 1972
 CONSERVATION DIVISION
 Wichita, Kansas

Elevation: 2002' D.F.

Geological Topog:

Topoka	2921
Hoobnor	3140
Toronto	3170-82
Lansing-K.C.	3191
Conglomerate	3773 2) 3482
Arbuckle	3577-90

Shale-Shells	0	400
Shale-Sand	400	680
Iron	600	736
Shale-Sand	736	903
Shale-Red Bed	903	1195
Anhydrite	1195	1243
Shale-Shells-Salt	1243	1405
Shale-Shells	1405	1795
Shale-Limo	1795	2355
Limo	2355	2430
Shale-Limo	2430	3102
Limo	3102	3143
Shale-Limo	3143	3178
Limo	3178	3213
Shale-Limo	3213	3256
Limo	3256	3300
Shale-Limo	3300	3374
Limo	3374	3411
Shale-Limo	3411	3473
Conglomerate-Chert	3473	3575
Limo	3575	3590 T.D.

J. G. Wentworth

30 April 53

Price

August 14, 1954