


15-169-00719-00-00

STATE OF KANSAS
STATE CORPORATION COMMISSION

Give All Information Completely
Make Required Affidavit
Mail or Deliver Report to:
Conservation Division
State Corporation Commission
800 Bitting Building
Wichita, Kansas

WELL PLUGGING RECORD

NORTH

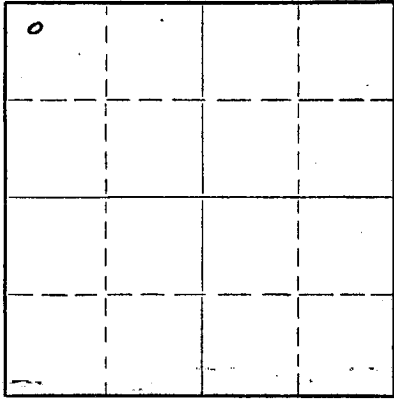

Locate well correctly on above
Section Plat

SALINE County. Sec. 4 Twp. 16 Rge. 2 (W) (W)
Location as "NE/CNW/SW" or footage from lines NW/4 - NW/4 - NW/4
Lease Owner E.H. RIGGS ETAL
Lease Name R. LEANDER Well No. 1
Office Address 701 UNION NATL BANK BLDG. WICHITA
Character of Well (completed as Oil, Gas or Dry Hole) DRY HOLE
Date well completed 4-20 19 53
Application for plugging filed 4-20 19 53
Application for plugging approved 4-20 19 53
Plugging commenced 4-20 19 53
Plugging completed 4-20 19 53
Reason for abandonment of well or producing formation DRY HOLE

If a producing well is abandoned, date of last production NONE 19
Was permission obtained from the Conservation Division or its agents before plugging was commenced? YES

Name of Conservation Agent who supervised plugging of this well RUEL DURKEE
Producing formation _____ Depth to top _____ Bottom _____ Total Depth of Well 3530 Feet
Show depth and thickness of all water, oil and gas formations.

OIL, GAS OR WATER RECORDS

CASING RECORD

FORMATION	CONTENT	FROM	TO	SIZE	PUT IN	PULLED OUT
				<u>8 5/8"</u>	<u>344'</u>	<u>0</u>

Describe in detail the manner in which the well was plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hole. If cement or other plugs were used, state the character of same and depth placed, from _____ feet to _____ feet for each plug set.

circulated heavy mud on bottom & halfway out of hole - Pushed wooden plug to 190' & bridged with rock to hold drill pipe at 185' - Run 15 sacks cement through 6 joints drill pipe - Filled hole with mud to 30' & bridged - Run 5 sacks cement filling hole to cellar floor

RECEIVED
STATE CORPORATION COMMISSION
JUN 4 1953
CONSERVATION DIVISION
Wichita, Kansas


(If additional description is necessary, use BACK of this sheet)
Name of Plugging Contractor Salina Drilling Corp.
Address Box 566, Salina, Kansas

STATE OF Kansas, COUNTY OF Saline, ss.
Elmer Rider (employee of owner) or (owner or operator) of the above-described well, being first duly sworn on oath, says: That I have knowledge of the facts, statements, and matters herein contained and the log of the above-described well as filed and that the same are true and correct. So help me God.

(Signature) Elmer Rider
Box #566, Salina, Kansas.
(Address)

SUBSCRIBED AND SWORN TO before me this 26 day of May, 1953
Notary Public.

My commission expires _____

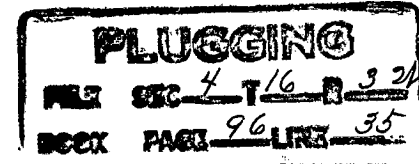

15-169-0079-00-00

ROTARY DRILLER'S LOG

LEASER #1

C NW NW NW/4 of Sec. 4,
Twp. 16, Range 37, Saline
County, Kansas.

OPERATOR: E. H. Riggs,
701 Union National Bank Bldg.
Wichita, Kansas.

Elevation: by Laughlin & Simmons
1318 RB 1315 IF

"CASINO RECORD"
8 5/8" - 3 1/4" - 250 Sacks Cement
(Cement Circulated)
Contractor: Salina Drilling Corp., Inc.
Box #566,
Salina, Kansas.

Well Commenced: 4-7-53
Well Completed: 4-20-53

Geologist: Donald Hoy Smith, 5206 E. Central
Wichita, Kansas.

FIGURES INDICATE BOTTOM OF FORMATIONS K.D.

Rotary Table, Base & Cellar	8	Lime	2385
Surface Clay	40	Lime & Shale	2490
Sand	55	Lime Broken	2585
Shale	130	Broken Lime	2685
Lime, Clay & Shale	226	" "	2795
Shale and Shells	299	Shale & Shells	2816
Anhydrite	312	Lime	2835
Shale	327	Shale & Shells	2860
Anhydrite	343	Lime	2875
Broken Lime	360	Lime	2915
Lime	400	Lime	3110
Broken Lime & Shale	470	Shale	3323
Red Bed	485	Dolomite	3339
Shale & Lime	520	Lime	3358
Broken Lime	800	Lime & Shale	3388
Lime	950	Lime	3404
Shale	1020	Lime & Shale	3506
Shale & Shells	1170	Shale & Lime	3516
Shale & Lime Shells	1800	Simpson	3530
Lime	1960		
Lime Shale & Shells	2130		
Broken Lime	2255	T. D.	3530

TOPS AS PICKED BY GEOLOGIST

Mississippian	2816	Viola Lime	3388
Kinderhook Shale	3091	Simpson Dolomite	3473
Maquoketa Shale	3253	Simpson Shale	3487
Maquoketa Dolomite	3323	Simpson Sand (Dolomite)	3515
		Simpson Sand	3522
		T. D.	3530

The above rotary driller's log is complete and correct to the best of my knowledge.

RECEIVED
STATE CONSERVATION COMMISSION
MAY 16 1953
CONSERVATION DIVISION
Wichita, Kansas

SALINA DRILLING CORPORATION, INC.
Loren D. Hallam
President.

PLUGGING
FILE SEC 4 T 16 R 3W
BOOK PAGE 96 LINE 35