

TO:
STATE CORPORATION COMMISSION
CONSERVATION DIVISION - PLUGGING
130 SOUTH MARKET, SUITE 2078
WICHITA, KANSAS 67202

API Well Number: 15-127-20031-00402 0002
Spot: SWSENE Sec/Twnshp/Rge: 24-16S-7E
4255 feet from S Section Line, 334 feet from E Section Line
Lease Name: FLOYD BOSCH Well #: 2
County: MORRIS Total Vertical Depth: 3136 feet

Operator License No.: 31142
Op Name: PETROLEUM PROPERTY SERVICES, IN
Address: 125 N MARKET SUITE 1251
WICHITA, KS 67202

String	Size	Depth (ft)	Pulled (ft)	Comments
CIBP		3050		
PROD	5.5	3093		100 SX
SURF	8.625	155		100 SX

Well Type: SWD UIC Docket No: D17340.0 Date/Time to Plug: 08/27/2012 8:00 AM
Plug Co. License No.: 33961 Plug Co. Name: CONSOLIDATED OIL WELL SERVICES LLC
Proposal Rcvd. from: LEON KUHN Company: Phone: (785) 483-1559

Proposed Plugging Method: SET CIBP AT 3050' AND CAP WITH 2 SX. PERFORATRE AT 200' AND CIRCULATE CEMENT TO SURFACE. 60 X 40 < 4% GEL.

Plugging Proposal Received By: Witness Type: NONE
Date/Time Plugging Completed: 08/27/2012 8:00 AM KCC Agent: PATRICK SHIELDS

Actual Plugging Report:

A CIBP WAS SET AT 3050' AND CAPPED WITH 2 SX OF 60X40 POZ <4% GEL. PRODUCTION CASING WAS PERFORATED AT 200', TUBING WAS TRIPPED IN, AND 125 SX WERE CIRCULATED TO SURFACE. UPON FOLLOW UP INSPECTION ON 8/31/12 THE TOP PLUG HAD SLID TO AN UNKNOWN DEPTH. OPERATOR WAS NOTIFIED AND RE-ESTABLISHED THE TOP PLUG ON 9/5/12. THE TOP PLUG WAS RE-CHECKED ON 9/13/12 AND HELD. ANNULUS WAS FILLED WITH WATER AND PRESSURED APPLIED, THEN WATER WAS SEEN COMING OUT OF GROUND NEAR WELL HEAD.

Perfs:

Top	Bot	Thru	Comments
3093	3136		
2784	2832		

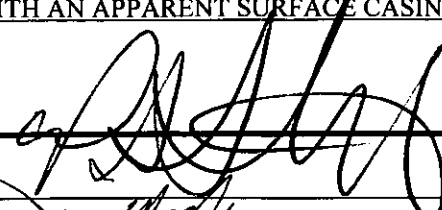
RECEIVED
OCT 25 2012
KCC WICHITA

Remarks: THIS WELL HAD FAILED ITS MIT ON 3/6/12 WITH AN APPARENT SURFACE CASING LEAK.

Plugged through: TBG

District: 02

Signed


TECHNICIAN
ce to mtc 10/29/12

12