
Form CP-3 Rev. 6-26-62

KANSAS STATE CORPORATION COMMISSION

CONSERVATION DIVISION AGENT'S REPORT

J. P. Roberts
Assitant Director
500 Insurance Building
212 North Market
Wichita 2, Kansas

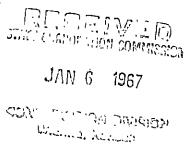

Lease Name Denker Well No. # 3 Location E/2 SW SE Sec. 9 Twp. 22 Rge. 12 (E) (W) W County Stafford Total Depth 3686' Abandoned Oil Well X Gas Well Input Well SWD Well D & A Other well as hereafter indicated: Plugging Contractor: Knight Casing Pulling Company Address: Box 405, Chase, Kansas License No. 436 Operation Completed: Hour 1:45FM Day 2nd Month Jan. Year 1967 The Above well was plugged as follows: 340' of 8 5/8" surface pipe, cement circulated. 3685' of 5½" long string, cemented with 100 sacks. This is an open hole. Bottom of the hole was sanded to 3675', and cemented with 5 sacks, through the dump bailer. 2595' of 5½" long string was recovered from the hole. Hole was squeezed. 10 sacks of Gelmud and 80 sacks of cement was pumped into the surface pipe, through an 8 5/ swage, to a pressure of 200 lbs. A wiping plug was run between the Gel-Mud, and the cement. This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated. INVOICED Signed: Lucus Clouing	Operator's Full Name Theodore	Gore
Sec. 9 Twp. 22 Rge. 12 (E) (W) W County Stafford Total Depth 3686' Abandoned Oil Well X Gas Well Input Well SWD Well D & A Other well as hereafter indicated: Plugging Contractor: Knight Casing Pulling Company Address: Box 405, Chase, Kansas License No. 436 Operation Completed: Hour 1:45PM Day 2nd Month Jan. Year 1967 The Above well was plugged as follows: 340' of 8 5/8" surface pipe, cement circulated. 3685' of 5½" long string, cemented with 100 sacks. This is an open hole. Bottom of the hole was sanded to 3675', and cemented with 5 sacks, through the dump bailer. 2595' of 5½" long string was recovered from the hole. Hole was squeezed. 10 sacks of Gelmud and 80 sacks of cement was pumped into the surface pipe, through an 8 5/ Swage, to a pressure of 200 lbs. A wiping plug was run between the Gel-Mud, and the cement. This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated.	Complete Address: 650 Fourth	National Bank Bldg., Wichita, Kansas
Abandoned Oil Well X Gas Well Input Well SWD Well D & A Other well as hereafter indicated: Plugging Contractor: Knight Casing Pulling Company Address: Box 405, Chase, Kansas License No. 436 Operation Completed: Hour 1:45PM Day 2nd Month Jan. Year 1967 The Above well was plugged as follows: 340' of 8 5/8" surface pipe, cement circulated. 3685' of 5½" long string, cemented with 100 sacks. This is an open hole. Bottom of the hole was sanded to 3675', and cemented with 5 sacks, through the dump bailer. 2595' of 5½" long string was recovered from the hole. Hole was squeezed. 10 sacks of Gelmud and 80 sacks of cement was pumped into the surface pipe, through an 8 5/ swage, to a pressure of 200 lbs. A wiping plug was run between the Gel-Mud, and the cement. This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated.	Lease Name Denker	
Other well as hereafter indicated: Plugging Contractor: Knight Casing Pulling Company Address: Box 405, Chase, Kansas License No. 436 Operation Completed: Hour 1:45PM Day 2nd Month Jan. Year 1967 The Above well was plugged as follows: 340' of 8 5/8" surface pipe, cement circulated. 3685' of 5½" long string, cemented with 100 sacks. This is an open hole. Bottom of the hole was sanded to 3675', and cemented with 5 sacks, through the dump bailer. 2595' of 5½" long string was recovered from the hole. Hole was squeezed. 10 sacks of Gelmud and 80 sacks of cement was pumped into the surface pipe, through an 8 5/ swage, to a pressure of 200 lbs. A wiping plug was run between the Gel-Mud, and the cement. This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated.	Location E/2 SW SE	Sec. 9 Twp. 22 Rge. 12 (E) (W) W
Other well as hereafter indicated: Flugging Contractor: Knight Casing Pulling Company Address: Box 405, Chase, Kansas Degration Completed: Hour 1:45PM Day 2nd Month Jan. Year 1967 The Above well was plugged as follows: 340' of 8 5/8" surface pipe, cement circulated. 3685' of 5½" long string, cemented with 100 sacks. This is an open hole. Bottom of the hole was sanded to 3675', and cemented with 5 sacks, through the dump bailer. 2595' of 5½" long string was recovered from the hole. Hole was squeezed. 10 sacks of Gelmud and 80 sacks of cement was pumped into the surface pipe, through an 8 5/ swage, to a pressure of 200 lbs. A wiping plug was run between the Gel-Mud, and the cement. This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated.	County Stafford	Total Depth 3686
Plugging Contractor: Knight Casing Pulling Company Address: Box 405, Chase, Kansas License No. 436 Operation Completed: Hour 1:45PM Day 2nd Month Jan. Year 1967 The Above well was plugged as follows: 340' of 8 5/8" surface pipe, cement circulated. 3685' of 5½" long string, cemented with 100 sacks. This is an open hole. Bottom of the hole was sanded to 3675', and cemented with 5 sacks, through the dump bailer. 2595' of 5½" long string was recovered from the hole. Hole was squeezed. 10 sacks of Gelmud and 80 sacks of cement was pumped into the surface pipe, through an 8 5/ swage, to a pressure of 200 lbs. A wiping plug was run between the Gel-Mud, and the cement. This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated.	Abandoned Oil Well X Gas Well	Input Well D & A
Address: Box 405, Chase, Kansas License No. 436 Operation Completed: Hour 1:45PM Day 2nd Month Jan. Year 1967 The Above well was plugged as follows: 340' of 8 5/8" surface pipe, cement circulated. 3685' of 5½" long string, cemented with 100 sacks. This is an open hole. Bottom of the hole was sanded to 3675', and cemented with 5 sacks, through the dump bailer. 2595' of 5½" long string was recovered from the hole. Hole was squeezed. 10 sacks of Gelmud and 80 sacks of cement was pumped into the surface pipe, through an 8 5/ swage, to a pressure of 200 lbs. A wiping plug was run between the Gel-Mud, and the cement. This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated.	Other well as hereafter indicated:	
Operation Completed: Hour 1:45PM Day 2nd Month Jan. Year 1967 The Above well was plugged as follows: 340' of 8 5/8" surface pipe, cement circulated. 3685' of 5½" long string, cemented with 100 sacks. This is an open hole. Bottom of the hole was sanded to 3675', and cemented with 5 sacks, through the dump bailer. 2595' of 5½" long string was recovered from the hole. Hole was squeezed. 10 sacks of Gel- mud and 80 sacks of cement was pumped into the surface pipe, through an 8 5/ swage, to a pressure of 200 lbs. A wiping plug was run between the Gel-Mud, and the cement. This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated.	Plugging Contractor: Knight Cas	sing Pulling Company
The Above well was plugged as follows: 340' of 8 5/8" surface pipe, cement circulated. 3685' of 5½" long string, cemented with 100 sacks. This is an open hole. Bottom of the hole was sanded to 3675', and cemented with 5 sacks, through the dump bailer. 2595' of 5½" long string was recovered from the hole. Hole was squeezed. 10 sacks of Gel- mud and 80 sacks of cement was pumped into the surface pipe, through an 8 5/ swage, to a pressure of 200 lbs. A wiping plug was run between the Gel-Mud, and the cement. This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated.	Address: Box 405, Chase, Kar	isas License No. 436
340' of 8 5/8" surface pipe, cement circulated. 3685' of 5½" long string, cemented with 100 sacks. This is an open hole. Bottom of the hole was sanded to 3675', and cemented with 5 sacks, through the dump bailer. 2595' of 5½" long string was recovered from the hole. Hole was squeezed. 10 sacks of Gelmud and 80 sacks of cement was pumped into the surface pipe, through an 8 5/ swage, to a pressure of 200 lbs. A wiping plug was run between the Gel-Mud, and the cement. This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated.	Operation Completed: Hour 1:45PM	Day 2nd Month Jan. Year 1967
cemented with 100 sacks. This is an open hole. Bottom of the hole was sanded to 3675, and cemented with 5 sacks, through the dump bailer. 2595 of 5½" long string was recovered from the hole. Hole was squeezed. 10 sacks of Gelmud and 80 sacks of cement was pumped into the surface pipe, through an 8 5/ swage, to a pressure of 200 lbs. A wiping plug was run between the Gel-Mud, and the cement. This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated.	The Above well was plugged as follo	ws:
to 3675, and cemented with 5 sacks, through the dump bailer. 2595, of 5½ long string was recovered from the hole. Hole was squeezed. 10 sacks of Gelmud and 80 sacks of cement was pumped into the surface pipe, through an 8 5/ swage, to a pressure of 200 lbs. A wiping plug was run between the Gel-Mud, and the cement. This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated.	340' of 8 5/8" surface pipe	, cement circulated. 3685' of $5\frac{1}{2}$ " long string,
long string was recovered from the hole. Hole was squeezed. 10 sacks of Gel- mud and 80 sacks of cement was pumped into the surface pipe, through an 8 5/ swage, to a pressure of 200 lbs. A wiping plug was run between the Gel-Mud, and the cement. This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated.	cemented with 100 sacks. Thi	s is an open hole. Bottom of the hole was sanded
mud and 80 sacks of cement was pumped into the surface pipe, through an 8 5/ swage, to a pressure of 200 lbs. A wiping plug was run between the Gel-Mud, and the cement. This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated.	to 3675', and cemented with	5 sacks, through the dump bailer. 2595' of 52"
swage, to a pressure of 200 lbs. A wiping plug was run between the Gel-Mud, and the cement. This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated.	long string was recovered for	om the hole. Hole was squeezed. 10 sacks of Gel-
and the cement. This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated.	mud and 80 sacks of cement v	vas pumped into the surface pipe, through an 8 5/
This cementing was done by Globe Cementing Company. I hereby certify that the above well was plugged as herein stated.	swage, to a pressure of 200	lbs. A wiping plug was run between the Gel-Mud,
I hereby certify that the above well was plugged as herein stated.	and the cement.	
I hereby certify that the above well was plugged as herein stated.	This cementing was done by (lobe Cementing Company.
Stoned: (K. Lue, Chrena	· · · · · · · · · · · · · · · · · · ·	1 was plugged as herein stated.
Well Plugging Supervisor		

INV. NO. 4568-W